

# GXV3240/GXV3275 Firmware Release Note

## Table of Content

<b>FIRMWARE VERSION 1.0.3.131 .....</b>	<b>5</b>
PRODUCT NAME.....	5
DATE .....	5
CHANGES SINCE FIRMWARE VERSION 1.0.3.92.....	5
<i>ENHANCEMENT</i> .....	5
<i>BUG FIX</i> .....	7
<b>FIRMWARE VERSION 1.0.3.92 .....</b>	<b>10</b>
PRODUCT NAME.....	10
DATE .....	10
CHANGES SINCE FIRMWARE VERSION 1.0.3.75.....	10
<i>ENHANCEMENT</i> .....	10
<i>BUG FIX</i> .....	11
<b>FIRMWARE VERSION 1.0.3.75 .....</b>	<b>12</b>
PRODUCT NAME.....	12
DATE .....	12
CHANGES SINCE FIRMWARE VERSION 1.0.3.62.....	12
<i>ENHANCEMENT</i> .....	12
<i>BUG FIX</i> .....	13
<b>FIRMWARE VERSION 1.0.3.62 .....</b>	<b>14</b>
PRODUCT NAME.....	14
DATE .....	14
CHANGES SINCE FIRMWARE VERSION 1.0.3.55.....	14
<i>ENHANCEMENT</i> .....	14
<i>BUG FIX</i> .....	14
<b>FIRMWARE VERSION 1.0.3.55 .....</b>	<b>15</b>
PRODUCT NAME.....	15
DATE .....	15
CHANGES SINCE FIRMWARE VERSION 1.0.3.46.....	15
<i>ENHANCEMENT</i> .....	15
<i>BUG FIX</i> .....	15
<b>FIRMWARE VERSION 1.0.3.46 .....</b>	<b>17</b>

PRODUCT NAME.....	17
DATE .....	17
CHANGES SINCE FIRMWARE VERSION 1.0.3.37 .....	17
<i>ENHANCEMENT</i> .....	17
<i>BUG FIX</i> .....	17
<b>FIRMWARE VERSION 1.0.3.37 .....</b>	<b>18</b>
PRODUCT NAME.....	18
DATE .....	18
CHANGES SINCE FIRMWARE VERSION 1.0.3.30 .....	18
<i>ENHANCEMENT</i> .....	18
<i>BUG FIX</i> .....	18
<b>FIRMWARE VERSION 1.0.3.30 .....</b>	<b>20</b>
PRODUCT NAME.....	20
DATE .....	20
CHANGES SINCE FIRMWARE VERSION 1.0.3.22 .....	20
<i>ENHANCEMENT</i> .....	20
<i>BUG FIX</i> .....	20
<b>FIRMWARE VERSION 1.0.3.22 .....</b>	<b>22</b>
PRODUCT NAME.....	22
DATE .....	22
CHANGES SINCE FIRMWARE VERSION 1.0.3.20 .....	22
<i>BUG FIX</i> .....	22
<b>FIRMWARE VERSION 1.0.3.20 .....</b>	<b>23</b>
PRODUCT NAME.....	23
DATE .....	23
CHANGES SINCE FIRMWARE VERSION 1.0.3.15 .....	23
<i>ENHANCEMENT</i> .....	23
<i>BUG FIX</i> .....	23
<b>FIRMWARE VERSION 1.0.3.15 .....</b>	<b>25</b>
PRODUCT NAME.....	25
DATE .....	25
CHANGES SINCE FIRMWARE VERSION 1.0.3.6 .....	25
<i>ENHANCEMENT</i> .....	25
<i>BUG FIX</i> .....	25
<b>FIRMWARE VERSION 1.0.3.6 .....</b>	<b>27</b>

PRODUCT NAME.....	27
DATE .....	27
CHANGES SINCE FIRMWARE VERSION 1.0.3.3.....	27
<i>ENHANCEMENT</i> .....	27
<i>BUG FIX</i> .....	27
<b>FIRMWARE VERSION 1.0.3.3 .....</b>	<b>28</b>
PRODUCT NAME.....	28
DATE .....	28
CHANGES SINCE FIRMWARE VERSION 1.0.2.15.....	28
<i>ENHANCEMENT</i> .....	28
<i>BUG FIX</i> .....	28
<b>FIRMWARE VERSION 1.0.2.15 .....</b>	<b>30</b>
PRODUCT NAME.....	30
DATE .....	30
CHANGES SINCE FIRMWARE VERSION 1.0.1.54.....	30
<i>ENHANCEMENT</i> .....	30
<i>BUG FIX</i> .....	30
<b>FIRMWARE VERSION 1.0.1.54 .....</b>	<b>32</b>
PRODUCT NAME.....	32
DATE .....	32
CHANGES SINCE FIRMWARE VERSION 1.0.1.50.....	32
<i>ENHANCEMENT</i> .....	32
<b>FIRMWARE VERSION 1.0.1.50 .....</b>	<b>33</b>
PRODUCT NAME.....	33
DATE .....	33
CHANGES SINCE FIRMWARE VERSION 1.0.1.40.....	33
<i>ENHANCEMENT</i> .....	33
<i>BUG FIX</i> .....	33
<b>FIRMWARE VERSION 1.0.1.40 .....</b>	<b>35</b>
PRODUCT NAME.....	35
DATE .....	35
CHANGES SINCE FIRMWARE VERSION 1.0.1.39.....	35
<i>ENHANCEMENT</i> .....	35
<i>BUG FIX</i> .....	35
<b>FIRMWARE VERSION 1.0.1.39 .....</b>	<b>36</b>

PRODUCT NAME.....	36
DATE .....	36
CHANGES SINCE FIRMWARE VERSION 1.0.1.37 .....	36
<i>ENHANCEMENT</i> .....	36
<b>FIRMWARE VERSION 1.0.1.37 .....</b>	<b>37</b>
PRODUCT NAME.....	37
DATE .....	37
CHANGES SINCE FIRMWARE VERSION 1.0.1.27 .....	37
<i>ENHANCEMENT</i> .....	37
<i>BUG FIX</i> .....	37

## FIRMWARE VERSION 1.0.3.131

### PRODUCT NAME

GXV3240, GXV3275

### DATE

08/24/2016

### CHANGES SINCE FIRMWARE VERSION 1.0.3.92

#### ENHANCEMENT

- Added Prefix MPK supported on GXV32xx.
- Removed Lync Setup application. This application is used for Lync configuration on GXV32xx.
- Supported “Call Detail” for RTCP info report.
- Added options “Enable Video FEC”, “Video FEC Mode”, and “FEC Payload Type” under web UI -> Account -> Codec Settings. When enabled, the phone will start Video FEC feature during video call. For “Video FEC Mode”, 0 represents FEC is not sent by separate port while 1 does. The “FEC Payload Type” is 120 as default. New P values:  
For Account 1: P2393/P26022/P2394  
For Account 2: P2493/P26122/P2494  
For Account 3: P2593/P26222/P2594  
For Account 4: P2693/P26322/P2694  
For Account 5: P2793/P26422/P2794  
For Account 6: P2893/P26522/P2894  
The default settings for “Enable Video FEC” is 1, which is “Enabled”. The default setting for “Video FEC Mode” is “0” mode. The default settings for “FEC Payload Type” is “120”.
- Added an option to mute the touch screen clicks only. Users could go to LCD Menu -> Settings -> Sound, and switch “Touch Sounds” option to “OFF”. Then, touch sounds are muted as expected without affecting other sound settings.
- Added an option “Enable MPK Auto Arrangement” under web UI -> Advanced Settings -> MPK General Settings. If it is set to “Yes”, the phone will make smart arrangement according to the amount of extension board and MPK, firstly arrange the first page of all extension boards, then the second page; If set to “No”, make arrangement according to the sequence of the extension boards. New P value:  
P22118  
0 – No, 1 – Yes. The default value is 1.
- Added to support IPv6 on GXV32xx. Added options “IPv6 Address”, “Static IPv6 Address”, “IPv6 Prefix Length”, “IPv6 DNS Server 1”, “IPv6 DNS Server 2”, and “IPv6 Preferred DNS Server”. The options

are under web UI -> Maintenance -> Network Settings. Users could configure the IPv6 network on GXV32xx. Net P values:

IPv6 Address - P1419

Static IPv6 Address - P1420

IPv6 Prefix Length - P1421

IPv6 DNS Server 1 - P1424

IPv6 DNS Server 2 - P1425

IPv6 Preferred DNS Server - P1423

- Added an option “Enable 3.5mm Headset Control” under web UI -> Maintenance -> Device Manager. If it is set to "Yes", users can control the on-hook and off-hook on the headset. New P value:  
P22113  
0 – No, 1 – Yes. The default value is 0.
- Added ability to configure the provisioning/firmware URL with variable. When the phone initiates the provisioning or firmware request, the device should automatically replace the variable between “%” with the actual value.
- Added to support headsets via USB port on GXV32xx.
- Added to support IPv6 address format for “Direct IP Call”.
- Added ability to configure timeout on phone LCD for on-hook dialing.
- Added an option “Enable CDP” under web UI -> Maintenance -> Network Settings. This option is used to configure whether to enable CDP to receive and/or transmit information from/to CDP-enabled devices. New P value:  
P22119  
0 – No, 1 – Yes. The default value is 0.
- Added options “GUI Customization File Download Mode”, “GUI Customization File URL”, “GUI Customization File HTTP/HTTPS Username”, “GUI Customization File HTTP/HTTPS Password”, and “Use Configuration of Config File Server” under web UI -> Maintenance -> Upgrade. The options are used to configure the GUI Customization File download mode, path, and the authentication of the server. New P values:  
GUI Customization File Download Mode - P6775  
GUI Customization File URL - P6774  
GUI Customization File HTTP/HTTPS Username - P6776  
GUI Customization File HTTP/HTTPS Password - P6777  
Use Configurations of Config File Server - P6778
- Added GXV32xx has the ability to connect to the nearest Wi-Fi Access Point.
- Added the ability to show the call-in-progress status on GXV32xx panel, and users could click to go back to call screen on GXV32xx screen.
- Added an option “Disable Web GUI” under web UI -> Maintenance -> Web/SSH Access. If it is set to "Yes", the phone will not allow any web access to the phone. New P value:  
P29065  
0 – No, 1 – Yes. The default value is 0.
- Added ability for “Users” to check/edit the MPK Extension page if users login the phone as “User”.

- Added ability to configure the screensaver network images path as a folder path.
- Added to support RFC3605 on GXV32xx. This is used for RTP port NAT Travel.
- Added options “Show Dial DTMF Softkey” and “CID to Show Dial DTMF Softkey” under web UI -> Account -> Call Settings. The options are used to configure whether the DTMF button display on incoming call interface or outgoing call interface, and configure the display name when the accounts being configured as MPK. New P values:  
For Account 1: P26052/P26053  
For Account 2: P26152/P26153  
For Account 3: P26252/P26253  
For Account 4: P26352/P26353  
For Account 5: P26452/P26453  
For Account 6: P26552/P26553  
For “Show Dial DTMF Softkey” option, 0 - Incoming/Outgoing Call, 1 - Incoming Call Only, 2 - Outgoing Call Only, 3 - Matched Incoming Call CID. Default value is 0.
- Added validation check for Multicast Address.
- Added to support for DHCP Option 132 and 133 tunneled through DHCP Option 43.
- Added ability to launch 3<sup>rd</sup> party application upon handset off-hook and dialer app.
- Added ability to access to the Bluetooth and Wi-Fi Settings menu through quick buttons on taskbar. Using the quick buttons on taskbar, users only can enable/disable these options. If users want to set a new Wi-Fi network, or pair a new Bluetooth device, users have to go to the System Settings main menu.
- Added an option “Auto Unhold When Press the Line Key” under web UI -> Advanced Settings -> Call Features. The option is used to configure when there are multiple lines, whether to unhold the line automatically when click the line being held, and hold the line in the primary call. New P value: P29067  
0 – No, 1 – Yes. The default value is 0.  
Note: The hold situation which is set manually will not be unheld automatically.
- Added Storage Settings for phone recording. This will only display on the phone when users have USB disk or SD card plugged in the phone.

## BUG FIX

- Fixed the bug that Call History in Dial Page do not sync LDAP name.
- Fixed GXV32xx should not clear up the name displayed in Call History page when users hang up the call before LDAP query completely.
- Fixed login web page and reboot page product info not change to OEM issue.
- Fixed GXV32xx abnormal restart issue when the user establishes a 3-way conference on the phone.
- Fixed the incoming calls without “+”/Country Code are not matched the local contacts stored with “+”/Country Code format. For example, if the incoming call is “123456”, and the contact on GXV32xx is stored as “+86123456” (“86” is the Country Code of China), the incoming call number can be recognized by GXV32xx.

- Fixed GXV32xx will use sips in From/To/Contacts header when users enable TLS transportation on GXV32xx.
- Fixed ES File Explorer application crash issue on GXV32xx.
- Fixed crash issue when GXV32xx receives messages via TLS.
- Fixed GXV32xx cannot get VOIP when users enable two VLANs and LLDP on the phone.
- Fixed Conference method causing audio distortion issue on Neox PBX when users are using GXV32xx.
- Fixed GXV3275 does not ring dial tone with USB/RJ9 earphone after clicking headset mode button the phone panel.
- Fixed GXV32xx should not open the headset channel when users insert headsets and click to go to dialer panel from Account Widget.
- Fixed GXV32xx crash issue when users try to register a SIP account via TLS.
- Fixed GXV32xx does not use the public IP discovered via STUN or NAT-IP for Direct IP Calls.
- Fixed GXV32xx does not send LLDP data when users enable CDP before starting LLDP.
- Fixed GXV32xx does not show IPv6 address when users login the phone via SSH.
- Fixed GXV32xx does not ring issue when receiving a call during on-hook dialing process.
- Fixed Radio FM application does not work correctly on GXV32xx.
- Fixed GXV32xx cannot switch to RJ9 headset channel issue during a call.
- Fixed the contact name in Blacklist should be deleted/changed when users delete/change the contact name in Contacts.
- Fixed GXV32xx will always show “Gallery has stopped running” issue when users set the camera parameters.
- Fixed the Email Widget does not update in time on GXV32xx.
- Fixed “Clear the Old List” and “Replace Duplicate Items” options under Contacts cannot be implemented on GXV32xx.
- Fixed GXV32xx display two tones at the same time when there is an incoming call on the phone.
- Fixed Plantronics Savi headset on GXV32xx requires users to press the headset button twice to pick up the call and get audio.
- Fixed HDMI has no audio output issue on GXV32xx.
- Fixed the video does not show up on GXV32xx when users configure H.264 codec and FEC.
- Fixed the BLF status should be updated correctly on GXV32xx.
- Fixed GXV32xx is failed to get the network address when users unplug the cable, disable the Wi-Fi network, and plug back the cable.
- Fixed issue that the IPv6 address cannot be saved as HTTP/HTTPS Proxy Hostname.
- Fixed the video screen frozen issue when users make the video call via H.263 codec.
- Fixed the call details always show video info when users switch the video call to audio call.
- Fixed GS Market download number on the list is different from the download number on phone notification bar.
- Fixed the programmable key name should be restricted to the number of allowed characters on the LCD.
- Fixed the crash issue when users try to factory reset the phone when the handset is off-hook.



- Fixed issue when GXV32xx has an incoming call, the End icon in conference call will be invalid.
- Fixed GXV32xx will show the wrong tips when users call the number twice which is not existed in Emergency Contacts.
- Fixed GXV32xx message reject feature is invalid when the phone is in a Direct IP Call.
- Fixed GXV32xx LCD shows black blocks if users hold a call on GXV32xx, and click on the “Options” softkey.
- Fixed GXV32xx only can invite the 3<sup>rd</sup> participant in audio in the conference, only if the 1<sup>st</sup> and 2<sup>nd</sup> participants are invited into the conference in video call. Otherwise, the 3<sup>rd</sup> participant could be invited into the conference in video.
- Fixed rescue not match GXV3240 issue.
- Fixed GXV32xx crash issue when users quickly click “Back” button on the “Add Account” page on phone LCD.
- Fixed GXV32xx crash issue when unplug SD card in recording.
- Fixed users cannot hear ring tone from RJ9/USB headset when users enable the headset mode and uncheck “Always Ring Speaker”.
- Fixed the issue when users set call forward based on time condition, it will cause keep registering and syslog/stun log flush.
- Fixed GXV32xx cannot establish any call if the phone sends SUBSCRIBE REGISTER without response.
- Fixed GXV32xx exits Conference interface when users remove a participant in the conference page.
- Fixed GXV32xx should not display video call button when users disable Video Call Feature on GXV32xx.
- Fixed GXV32xx still displays ringtone when incoming call mute is active on the phone.
- Fixed the Recorder and Enable Video feature softkey cannot be used when users end a conference call on GXV32xx.
- Fixed GXV32xx crash issue when users download the contacts and the HTTP/HTTPS Proxy Hostname is set with IPv6 format.

## FIRMWARE VERSION 1.0.3.92

### PRODUCT NAME

GXV3240, GXV3275

### DATE

03/30/2016

### CHANGES SINCE FIRMWARE VERSION 1.0.3.75

#### ENHANCEMENT

- Changed default config file update method to HTTPS for security purpose.
- Added H.263 support and RTCP packets loss tolerance.
- Supported GXV3275 V2.0 camera
- Added option “Use First Matching Vocoder in 200OK SDP” under web UI->Account->Codec settings. When enabled, the phone will use the first matching codec in the 200OK message. New P values:  
For Account 1: P2348  
For Account 2: P2448  
For Account 3: P2548  
For Account 4: P2648  
For Account 5: P2748  
For Account 6: P2848  
0 – No, 1 – Yes. The default value is 0.
- Added option “Authentication Type” to select authentication type for Broadsoft XSI feature. This option is under web UI->Maintenance->Broadsoft Directories. Users could select “SIP Credentials” or “Login Credentials”. New P value:  
P22054: 0 – SIP Credentials, 1 – Login Credentials. The default value is 0.
- Added IEEE-48-addr and IEEE-EUI-64 support in PEI (P-Emergency-Info) header.
- Added option “Permission to Install/Uninstall Apps” to allow users to set permission to install/uninstall apps via web browser, SD card and GS Market. New P value:  
P29064: 0 – Allow, 1 – Require admin password, 2 – Require admin password if the app source is unknown. The default value is 0.
- Added notification icon on LCD top status bar when option “Enable PNP Feature” under web UI -> Maintenance->Upgrade is turned on. This option takes effect after reboot.
- Added Google-class AEC implementation and improved TX/RX.
- Modified dial plan logic so that phone will dial out directly when there is only one rule perfectly matched.

## BUG FIX

- Fixed Admin password validation issue when users login as End User
- Fixed Phone will filter out “+” when dialing a contact number starting with “+”
- Fixed IP msg is not updated in time (etc, LLDP change) when the IP is changed
- Fixed DUT keeps sending SUBSCRIBE after receiving NOTIFY with “reason=noresource”
- Fixed Call cannot be established on BroadSoft platform when there is “unknown” in Accept header
- Fixed Phone cannot parse extension number from eventlist BLF
- Fixed GXV32xx Broadsoft Xsi is using wrong P-value under Login Credentials mode
- Fixed If all the phone settings in GUI Customization Tool are disabled, the users cannot access the settings through Android system menu

## FIRMWARE VERSION 1.0.3.75

### PRODUCT NAME

GXV3240, GXV3275

### DATE

02/25/2016

### CHANGES SINCE FIRMWARE VERSION 1.0.3.62

#### ENHANCEMENT

- Added ability to download phonebook from Broadsoft server. To download phonebook from Broadsoft server, please log in GXV3240/GXV3275 web UI and go to Maintenance->Contacts->Download section. The tags in the URL should be replaced with actual value.
- Updated GUIConfigTool Widget Settings to enable the ability to edit softkeys on main Home bar. To use this feature:
  1. Download the latest GUI Config Tool from <http://grandstream.com/support/tools>.
  2. Open the tool and choose GXV3240/GXV3275 to configure.
  3. Go to the Widget Settings panel and configure "soft key type". If set to "none", the device will not display 5 soft keys or drop-down panel; if set to "only one", the device will only have one Call softkey; if set to "both", the device will display 5 softkeys and drop-down panel.
- Added ability to display contacts instead of searching contacts when adding member via Contact button into conference. To use this, click on "Add Member" when initiating a conference. Then click on "Contact" to bring up all local contacts to be displayed for selection.
- Updated DHCP Option 2 default value from disabled to enabled. This setting is under web UI->Maintenance->Time Settings.
- Added ability to allow dialing special characters when dial plan is disabled and allow configuring special characters in MPK User ID.
  1. To allow dialing special characters (e.g., ";", "/", "?", ":", "@", "&", "=", "+", "\$", ",", and etc.), please log in GXV3240/GXV3275 web UI and log to Account->Call Settings and select "MPK & Click2Dial" for option "Disable DialPlan".
  2. When configuring "Speed Dial" in MPK, please use a URL encoding tool to encode the string if the User ID contains special characters. Then fill in the User ID that has special characters encoded.
  3. When pressing "Speed Dial" MPK that has special characters encoded in User ID, the phone will decode the string and dial out.
- Updated LDAP Contact to display the contact from active accounts only. Log in GXV3240/GXV3275 web UI and go to Maintenance->LDAP Book, configure option "LDAP Dialing Default Account". If set to "Default", when the user opens Contact app->LDAP Contacts and search for contact to dial out, the

user can select from one of the registered accounts on the phone; If set to a specific account, the selected contact will be dialed when this account is registered.

- Added ability to select default phonebook to display. To use this feature, please configure option “Phonebook Key Function” under GXV3240/GXV3275 web UI->Maintenance->Contacts.
- Added ability to have pre-configured programmable keys on the call screen. To use this feature:
  1. In GXV3240/GXV3275 web UI->Account page, choose an account that is not registered and go to Call Settings page.
  2. Navigate to option “Programmable Keys” and configure Key Mode, Account, Name and User ID. Please save and apply the change.
  3. When opening the call screen, the Programmable Key configured from unregistered account page will be displayed on the account panel.
- Improved video call display delay issue.
- Updated the settings display order in web UI->Maintenance->Upgrade page.

#### **BUG FIX**

- Fixed compatible issue with Alcatel-Lucent that when DUT INVITE has no SDP but ACK has, DUT does not negotiate and reply with default setting
- Fixed Music app would stop when adding a song from Recent Added page
- Fixed DUT Broadsoft Directory encoding error
- Fixed conference participants videos get stuck when host DUT clicks Home button to leave conference interface
- Fixed DUT would crash when answering the first video call after reboot
- Fixed sometimes DUT gets stuck on video when frequently switching images in a video call
- Fixed DUT fails to import contact file when contact file is small
- Fixed DUT audio distortion in an incoming video call when “Enable Function for Incoming Call” is set to “Preview”
- Updated Newfoundland time zone P-value
- Fixed DUT handset audio level drops when pickup range is more than 3cm
- Fixed DUT is disconnected with forwarded party after the forwarded call is established around 30 seconds
- Fixed DUT sends frame length 0 and crashes if it does not negotiate any codec
- Updated the tooltip for “Use NAT IP” under web UI->Advanced settings->General settings
- Fixed Vidyomobile app cannot use the front camera of the phone
- Fixed DUT joining and quitting UCM conference frequently would cause bad fluency
- Fixed DUT doesn't update the CID when performing auto-attended transfer
- Fixed Android API doesn't update the correct P value for outbound proxy
- Fixed BLF keys not showing correct status for monitored extension with multiple registrations

## FIRMWARE VERSION 1.0.3.62

### PRODUCT NAME

GXV3240, GXV3275

### DATE

11/23/2015

### CHANGES SINCE FIRMWARE VERSION 1.0.3.55

#### ENHANCEMENT

- Added ability to have pre-configured DTMF key on the call screen
- Added P Value for MPK Icon size. New P value: P22090 MPK icon mode
- Hide dial pad video call softkey. New P value: P22091 - disable video call feature
- Added ability to use an external HTTP/HTTPS/TFTP URL on the <PhotoUrl> tag in XML phonebook for contact's photo
- Improvement of Ukrainian language

#### BUG FIX

- Fixed when sending photo albums via Bluetooth, rejecting the file from the recipient causes DUT show "Bluetooth sharing has stopped running"
- Fixed Missing GMT+11 Time Zone
- Fixed Phone behaves abnormally for the processing of "481 Call Leg/transaction does not exist"
- Fixed Phone handles incorrectly for the receiving INVITE with correct Replaces header when the phone is ringing
- Fixed Backup failure when using USB flash drive to back up contacts
- Fixed Cannot use Conf app to search LDAP book
- Fixed Missing GMT+11 Time Zone
- Fixed Contact app stops when searching contacts
- Fixed Phone doesn't load cust file when being provisioned a second time

## FIRMWARE VERSION 1.0.3.55

### PRODUCT NAME

GXV3240, GXV3275

### DATE

10/20/2015

### CHANGES SINCE FIRMWARE VERSION 1.0.3.46

#### ENHANCEMENT

- Added End call button during attended transfer
- Added support to select Broadsoft XSI authentication type
- Added CEI (Conference Event Indicator) support to work with UCM
- Added option "Disable Active MPK Page" option under web UI->Advanced Settings->Call Features->Disable Active MPK
- Improved display order of contacts' name when language is English
- Added support for predictive dialing from contacts/call history entries
- Added AEC improvement
- Added LDAPS support client side auth
- Added "Attended Transfer Only" option under web UI->Advanced Settings->Call Features
- Added ability to configure user agent display for all SIP messages

#### BUG FIX

- Fixed Show call failed status when receiving 484 response and disabled early dial
- Fixed Change video SRTP set error and can't display GVC3200 presentation
- Fixed Zipato app isn't displayed correctly
- Fixed Display Bluetooth Contacts in Bluetooth Phonebook
- Fixed Contacts can be downloaded via web UI HTTP mode bypass the http proxy server even it is configured
- Fixed Phone does not respect DNS mode to resolve XMPP FQDN
- Fixed Need support Second dial tone and add "," as a valid dial plan character
- Fixed Missing GMT+11 Time Zone
- Fixed Phones do not send a BYE to the first call when they receive INVITE with REPLACE header
- Fixed Provisioning phone with non-number value for Guest login timeout P value P22016 will cause crash
- Fixed Contact widget for using active account can't call out
- Fixed Phone doesn't renew the Bluetooth connection automatically after returning from out of range status

- Fixed Phone logs in to wrong IM&P Server when leaving Broadsoft IM&P server field empty
- Fixed Losing audio when timestamp and seq jump suddenly
- Fixed Reject calls from "Known Server" when option "Only Accept SIP Requests from Known Servers" is enabled
- Fixed DHCP Option 242 parse wrong when changing index of HTTPSEVR
- Fixed Setting PC Port mode to "Mirrored" won't take effect
- Fixed Contacts sort result by first name and last name are inverted
- Fixed The phone keeps rebooting when leaving P281 empty and provisioning via http/ftp server
- Fixed LLDP won't take effect in first boot after factory reset or upgrade
- Fixed P values are not provisioned correctly when P279, P280 are left empty
- Fixed Firmware upgrade will fail if using LLDP to discover VLAN
- Fixed Crash when incoming INVITE has call-info header
- Fixed Phone shouldn't unregister all after choosing "instance" for option Unregister Before New Registration
- Fixed Account stops running after selecting UCM Pick account and connecting to the manually configured server



## **FIRMWARE VERSION 1.0.3.46**

### **PRODUCT NAME**

GXV3240, GXV3275

### **DATE**

07/27/2015

### **CHANGES SINCE FIRMWARE VERSION 1.0.3.37**

#### **ENHANCEMENT**

- Added End call button during attended transfer
- Added DHCP Option 132 for 802.1Q VLAN ID and Option 133 for QoS priority level
- Added auto detection for authentication mode of Broadsoft Xsi Feature
- Added security improvement
- Added verification for Opus payload type values
- Changed “Enable DHCP VLAN” P value to P8300 from P8038

#### **BUG FIX**

- Fixed Factory reset cannot restore the change by cust file
- Fixed Wi-Fi 802.1X policy modify failed
- Fixed SRTP is in SDP while incoming INVITE has no SDP or SRTP is disabled
- Fixed Payload type 98 and 99 for audio codec can be configured in web UI while audio becomes abnormal when DTMF is received using those Payload type values
- Fixed issues related to attended transfer Refer header

## FIRMWARE VERSION 1.0.3.37

### PRODUCT NAME

GXV3240, GXV3275

### DATE

07/10/2015

### CHANGES SINCE FIRMWARE VERSION 1.0.3.30

#### ENHANCEMENT

- Added support for unsolicited REFER message
- Added option to configure GXP2200EXT LCD timeout. It requires GXP2200EXT board to be upgraded to 1.0.0.26 which is available when upgrading GXV32xx to 1.0.3.37
- Added ability to download and upload .txt configuration file via web UI
- Added Opus payload type setting under web UI->Account x->Codec settings. The new P values are:
  - For Account 1 - P2385
  - For Account 2 - P2485
  - For Account 3 - P2585
  - For Account 4 - P2685
  - For Account 5 - P2785
  - For Account 6 - P2885
- Added Speech Alarm special behavior for elderly people based on Call-Info header in the INVITE
- Added support for not interrupt dialing number process when there is an incoming call
- Separated VLAN settings for Ethernet and Wi-Fi. The options are added on both LCD and web UI
- Added support for 3<sup>rd</sup> party app to adjust call volume, e.g, Google Hangouts
- Added support to reset the phone via SIP NOTIFY message and new option "Enable SIP Reset". The new P values are:
  - For Account 1 - P26015
  - For Account 2 - P26115
  - For Account 3 - P26215
  - For Account 4 - P26315
  - For Account 5 - P26415
  - For Account 6 - P26515
- Added support to reject incoming call and reply a message. The reply message can be selected in LCD->SMS settings

#### BUG FIX

- Fixed Radius authentication not working

- Fixed DUT carries a wrong domain to send REGISTER
- Fixed Custom Music On Hold is invalid if SRTP is enabled
- Fixed Third party app "Mitel Micollab" cannot be installed on GXV32xx
- Fixed DHCP Option 12 Host name is not applied
- Fixed Transfer will fail when SRTP Key Length is different
- Hid passwords in GET request from SSH access
- Fixed Bluetooth call line cannot be muted in conference
- Fixed Adding Bluetooth call in conference causes gs\_phone crash
- Fixed A yellow band is displayed on the bottom when decoding video stream from Horizon TV application
- Fixed Phone rings default ring tone after selecting silent ringtone
- Fixed Call Park pick-up with Replace header

## FIRMWARE VERSION 1.0.3.30

### PRODUCT NAME

GXV3240, GXV3275

### DATE

05/06/2015

### CHANGES SINCE FIRMWARE VERSION 1.0.3.22

#### ENHANCEMENT

- Added Action URL support
- Added Multiple SIP User IDs in door system
- Added LDAP search by the very first part of the string
- Added Default account option to dial in LDAP search
- Added Allow numbers only for phone screen lock
- Added Specify the LDAP Search to use \* in the pattern
- Added Option to not play dial tone for onhook dialing
- Added Caller ID update from the Contact header in the UPDATE packets
- Added G726.32 dynamic payload type support for Avaya IOT
- Added Call Park pick-up with replace header
- Added Option to hide IP address display on the screen
- Added Easy access to transfer button
- Added Support to establish network-based conference under Huawei mode
- Added Replace header in SIP message during call park retrieving
- Added Support to select Call Pickup mode
- Added Support to provision call progress tone attributes by IP location
- Added Support to display the call parking state on extension board
- Added Handset RX/TX gain options
- Added Call Forwarding feature applied locally when the Feature Key Synchronization is enabled
- Added Validate Certification Chain feature
- Added Option to disable Call Park Subscription
- Added Support to upload cfg file from web UI

#### BUG FIX

- Fixed MPK entries can't be deleted from MPK list
- Fixed The sounds effects keys do not work
- Fixed The phone will not pop up the box for user name and password inputting when it receives HTTP 401 Unauthorized response

- Fixed The cursor will move to wrong place in MPK eventlist interface
- Fixed The MPK app can't update the display name after the extension display name has been updated
- Fixed BLF indicator doesn't light up on initial configuration when registering to PoraOne soft switch
- Fixed Audio volume difference between left and right receivers
- Fixed The record saving failure after off hook
- Fixed The phone can't download customization file whose name includes space
- Fixed The phone's contacts download interval keeps displaying "none"
- Fixed The phone can't download contact files via TFTP protocol
- Fixed The phone will pop up the delete box if the end user long press MPK blacklist icon
- Fixed The phone's headset icon will display grey after the Headset Key Mode is set to Toggle Headset/Speaker
- Fixed The phone can't play audio after the camera app is being used
- Fixed The phone can't connect VPN type PPTP
- Fixed The phone can't establish on Avaya Aura server by G726-32 codec
- Fixed The phone can't prompt "can't find account" after deleting two email accounts
- Fixed The phone pasts the pictures into the contact box instead content box in the Message app
- Fixed The phone can't end the video call during the call when remote end enables SRTP feature
- Fixed The phone can't press transfer key while incoming call rings
- Fixed Single uncheck contacts will lead to uncheck all contacts
- Fixed The phone will force stop the recorder app if the file name contains Chinese Unicode characters
- Fixed The phone matches wrong contact names when the contacts have same names
- Fixed The phone will play the call waiting tone via speaker channel when the Bluetooth headset connected
- Fixed The phone will auto return to Call Forwarding Busy mode from the Call Forwarding Always mode
- Fixed The phone displays different logout intervals between web and LCD
- Fixed The phone can't adjust the audio volume if an incoming call is rejected
- Fixed The phone can't display the Remote Party ID during BLF pickup
- Fixed The phone can't send audio after receiving SDP including "video sendonly"
- Fixed The phone can't do attend transfer when using target contact for refer-to
- Fixed The phone can't download the third party apps from Google Play store
- Fixed The phone can't update the feature synchronization with server after the IP network recovering

## **FIRMWARE VERSION 1.0.3.22**

### **PRODUCT NAME**

GXV3240, GXV3275

### **DATE**

03/06/2015

### **CHANGES SINCE FIRMWARE VERSION 1.0.3.20**

#### **BUG FIX**

- Fixed Phone system will auto dial the existed DTMF digits again if the remote side holds and resumes the call
- Fixed BLF key indicator still keeps off after the MPK key is removed from Blacklist
- Fixed BLF entries in the Blacklist can't be deleted
- Fixed BLF entries will cause phone crash randomly

## FIRMWARE VERSION 1.0.3.20

### PRODUCT NAME

GXV3240, GXV3275

### DATE

02/27/2015

### CHANGES SINCE FIRMWARE VERSION 1.0.3.15

#### ENHANCEMENT

- Added PNP features that allows to provision other phones
- Simplified conferencing steps to add the 1st call to the conference room
- Added timer for the video conference room
- Added feature to allow directly entering voicemail account by pressing the voicemail key if only one account is registered on the phone
- Added Broadsoft IM&P feature
- Improved Broadsoft Xsi authentication feature
- Added call forwarding option to support all the accounts in the same virtual account group
- Added support to allow saving call forwarding number on the screen page after the feature is disabled
- Moved MPK App P Values shared with EXT Board P Values. Previous P values for MPK softkeys in MPK app are not used anymore. Please refer to updated config template

#### BUG FIX

- Fixed Email attachment file name in Chinese is unrecognizable
- Fixed Incorrect confirmation information when deleting music file
- Fixed Current noise issue on RJ9 channel
- Fixed Music app stop issue
- Fixed Phone can dial DTMF during call holding status
- Fixed Anonymous call history can be added to contact
- Fixed Picture file can't be attached in the Email app
- Fixed Soft keyboard will not be hidden in the conference room if there is an incoming call
- Fixed Need to press headset key twice to change the audio channel to the headset
- Fixed Call history process can't be stopped
- Fixed Recording file can't be played after searching invalid recording file
- Fixed Blacklist app can't block message
- Fixed Local music on hold packet can't be sent
- Fixed LCD display "sized line timeout" in dialer page when user dials number from MPK app
- Fixed Baidu input method can't trigger soft keyboard in the dialer page

- Fixed Interval between ACK and first RTP message is too long
- Fixed Request-line is malformed when Tel URI is used under Conference URI for N-way calling
- Fixed Phone will not go to home page from MPK page after the call is ended
- Fixed SIP TLS certification and private key can't be provisioned to the phone
- Fixed Phone does not allow adding multicast paging MPK key in the MPK app
- Fixed Phone will prompt the MPK has stopped message when parking a call



# FIRMWARE VERSION 1.0.3.15

## PRODUCT NAME

GXV3240, GXV3275

## DATE

02/6/2015

## CHANGES SINCE FIRMWARE VERSION 1.0.3.6

### ENHANCEMENT

- Added LDAPS feature
- Added WiFi 802.1x feature
- Added French and Spanish language on web UI
- Added the feature that allows to use empty slots in Phone Dialer as MPK
- Added the feature that Broadsoft Event-list BLF entries can be auto-populated to extension board
- Added the feature to allow to insert picture information in SIP header
- Added the option of "Caller ID From" for each account
- Added option to enable permanent mute
- Added SIP NOTIFY Authentication improvement
- Added Warm line feature
- Added phone book HTTPS downloading feature
- Added options of Silence and Divert for incoming calls
- Added LCD prompt support for HTTP digest challenge
- Added Multicast paging call feature
- Added the Broadworks IM&P feature
- Added the option of Only Display Remote Screen for GXV3240
- Added the first name and last name sorting option in the phonebook
- Added special mode for Baudish IOT requirement
- Added the feature for RingCentral to utilize its LED API
- Added the feature to support DHCP option 242
- Added the feature for the response to SIP 3xx in Avaya mode

### BUG FIX

- Fixed the Lync setup feature
- Fixed the MUTE key mode won't exist after reboot
- Fixed the HOLD or TRANSFER failure if the SRTP mode is set as Enabled and Forced
- Fixed the system processing stop issue triggered by rebooting
- Fixed the issue that the group message only can send via Account 1

- Fixed the issue that the cursor will move to the latest message after selecting the previous one
- Fixed the issue of the wrong notification “contact has stopped”
- Fixed the issue of the wrong notification of “music has stopped”
- Fixed the wrong NNS naptr query
- Fixed the issue that the firmware server address with header can't be saved on LCD
- Fixed the issue of the Auto-answer and Transfer setting displaying de-synchronization on LCD and web GUI
- Fixed the issue of the incorrect time length display of session recording file
- Fixed the issue of unauthenticated user being able to view logcat.txt from web browser.
- Fixed the issue of session recording reaching the maximum storage without notification
- Fixed the issue that the recording file's playing time length is longer than its real length
- Fixed the issue of the same password of Sound Recorder could be saved
- Fixed the issue that the changed Ethernet settings does not take effect after reboot if the network cable is not connected
- Fixed the issue that it takes a long time to import the contact file with card format
- Fixed the issue that the first call can't be ended by BT headset hard key in Bluetooth headset mode
- Fixed the issue that there is one way audio in Bluetooth channel if the conference put in mute
- Fixed the issue that No Answer call forwarding will not take effect if the Ring timeout set to 0
- Fixed the issue that the call forwarding status will be delay to display on the status bar and notification dropdown list
- Fixed the issue that the Call Forward widget does not synchronize with the web GUI settings
- Fixed the issue that the phone does not the email sent notification
- Added the missing rebooting tips of 802.1x password
- Fixed the issue of video call can't recover if end user return the video call from other apps.
- Fixed the issue that the auto backup is invalid after rebooting
- Fixed the issue that the phone can't set the year before 1970
- Fixed the video call's non-proportional image issue
- Fixed the issue that the HDMI image size does not meet the HDMI display setting for incoming video calls
- Fixed the issue that the Phone app does not match the contact with the format id+@IP+port
- Fixed the issue that DTMF will always be displayed on conference interface
- Fixed the issue that blank P value 76 can reboot the phone
- Fixed the issue that the audio plays on the phone if HDMI device is connected
- Fixed the issue that the WiFi setting on LCD is not synchronized with web GUI
- Fixed the issue that the upgrading interface displays abnormal
- Fixed the issue that the Chinese translation error in LDAP settings

## FIRMWARE VERSION 1.0.3.6

### PRODUCT NAME

GXV3240, GXV3275

### DATE

12/17/2014

### CHANGES SINCE FIRMWARE VERSION 1.0.3.3

#### ENHANCEMENT

- Adjusted Handset TX performance
- Enlarged the headset mode icon on the status bar
- Optimized the audio performance
- Added the Headset Key Mode feature on the web UI
- Added DHCP Option 160 feature
- Updated the Extension Board firmware version to 1.0.0.23

#### BUG FIX

- Fixed the second incoming call affects the first session under EHS headset mode
- Fixed AEC Queue Empty issue and improved AEC
- Fixed the issue that the ringtone will route from HDMI channel to the local speaker channel when it is timeout
- Removed the settings “Accept Call and Speaker Dial in RJ9 Headset Automatically”, “Handset Gain” from web UI
- Fixed the issue of no ringing through EHS headset on incoming call
- Fixed one-way audio issue if the RJ9 headset gain settings changed several times

## FIRMWARE VERSION 1.0.3.3

### PRODUCT NAME

GXV3240, GXV3275

### DATE

11/21/2014

### CHANGES SINCE FIRMWARE VERSION 1.0.2.15

#### ENHANCEMENT

- Added “Dialer Interface Priority Display” option in web UI
- Added “Dialer Interface Display Interval” option in web UI
- Added support to allow special characters to be used in recorder file name
- Added support to display forwarded call information from the Diversion header in INVITE
- Added SIP Registration status display via SSH session
- Added support to modify the note field in the blacklist
- Added setting to omit the session timer in the SIP header

#### BUG FIX

- Fixed Incorrect notification when the input numbers do not match the dial plan
- Fixed Soft keyboard doesn't respond after tapping the Enter key in some third party applications
- Fixed Cannot copy contacts from.csv file
- Fixed Incorrect notification when clicking contact virtual key
- Fixed Incorrect no answer timeout notification
- Fixed No response if tapping on DONE key in the soft keyboard during transfer or conference
- Fixed Contact stop notification still shows when importing incorrect files
- Fixed The user has to press BACK key twice to return to the calling page from MPK app page
- Fixed Can save wrong value for layer 2 QoS parameter
- Fixed Phone enters the wrong page if tapping Contact Full icon in the Contact application
- Fixed The Broadsoft contact prompts “call history has stop” when tapping the Group Directory under HTTPs mode
- Fixed Phone cannot send RTP and H264 packets in an outbound video call randomly
- Fixed Preview and Answer keys are invalid when receiving an attended transfer call
- Fixed The video media attribute remains inactive after unholding a video call
- Fixed The video feature failure after transfer is failed
- Fixed There is no ringback tone during an attended transfer
- Fixed GXV3275 cannot display some options under MORE option in the calling interface
- Fixed + and 0 characters can't be carried if redialing by pressing the # key

- Fixed Link speed is not being displayed correctly from SSH session
- Fixed Broadsoft call log deleting failure if XSI server URI is in digital IP format
- Fixed Broadsoft contact and call history pages freezes when updating from server
- Fixed The video feature will be disabled if performing attend transfer on a video session
- Fixed Stuck in call transferring page if the numbers typed do not match the dial plan
- Fixed No prompt after backup the third party application successfully
- Fixed The LED light turns red if the number of contact is no more than 1000 entries
- Fixed Phone displays user's own profile as a contact entry in the calendar synchronized with Google account
- Changed the button name from End to Reject in the preview mode
- Fixed Phone displays prompt "FileManager has stopped running" randomly when searching files
- Fixed Network setting page in LCD has no response randomly
- Fixed The web page theme is changed after reboot
- Fixed The phone enters to the wrong page when tapping Return key in contact details page
- Fixed The music app will not stop if the phone enters the dialing page
- Fixed Message app can't filter the special characters when sending messages to one contact
- Fixed The audio quality is abnormal when invoking handsfree TX gain
- Fixed The phone will not set local time zone, language and weather after factory reset
- Fixed No notification if wrong value is saved for layer 2 QoS parameter
- Fixed The Domain Certificate box overlaps other options in the web page
- Fixed Bad audio quality when receiving calls from cellphone via Bluetooth under WiFi
- Fixed Same entry content in the MPK app can be saved
- Fixed The message app can't recognize web site URI
- Fixed The File Manager app will omit the Search key after mounting USB drive
- Fixed Broadsoft N-way video conference feature not working
- Fixed Can't switch to SRTP
- Fixed Account can't register via UCM ZeroConfig in closed network
- Fixed Cannot play audio when there is a gap in timestamp

## FIRMWARE VERSION 1.0.2.15

### PRODUCT NAME

GXV3240, GXV3275

### DATE

10/10/2014

### CHANGES SINCE FIRMWARE VERSION 1.0.1.54

#### ENHANCEMENT

- Added Broadsoft Flexible Seating feature
- Updated and improved tooltips for web UI options
- Added upgrade notification on phone screen
- Added ability to re-order the type of contacts in Contacts App
- Added ability to auto-search in Contacts App->Broadsoft contacts
- Added ability to update message according to actual status of contacts instead of “No contacts to show”
- Added option to configure Wake Up Phone Interval to automatically show phone Dialer app when the screen wakes up
- Added option to configure the number of contacts to download from Broadsoft XSI server
- Added alphanumeric keyboard support in the dialer
- Added MPK shortcut in dialer interface during call
- Added Notification volume adjustment option in LCD
- Added More gain levels for RJ9 headset TX
- Updated lighttpd for cgi security
- Added TLS CA root settings to verify certificate for every SIP account
- Added G.729 support (1 channel allowed)
- Added GUI Config Tool customization support
- Added audio improvement

#### BUG FIX

- Fixed Contacts full icon is missing after reboot
- Fixed Blind transfer function is abnormal after video off in a video call
- Fixed HOLD SDP in INVITE is wrong
- Fixed Transfer should not be allowed when there is a video request after transfer is failed
- Fixed Memory is not released on registration or un-registration if IP is 0.0.0.0
- Fixed BYE request is sent to the wrong proxy/IP based on the route set
- Fixed Phone will pop up “Call has stopped” after SRTP failed

- Fixed Can't recover wallpaper from backup file
- Fixed Blacklist stops running if off hook the handset while deleting 1000 blacklist records
- Fixed Backup has stopped when unplug the USB during backup
- Fixed Music will stop during certain operations
- Fixed Can't remove contacts from favorites
- Fixed Canceling the second call causing calling interface disappear temporarily during Bluetooth headset mode
- Fixed Broadsoft XSI: when the XSI server domain is incorrectly analyzed, the XSI application shows exception
- Fixed Broadsoft XSI: the web XSI parameters should be enabled by default
- Fixed Phone should not allow to enter PPP folder via web browser without login
- Fixed Phone cannot register when there is no EXPIRE header
- Fixed Cannot skip to next interface until the second call is answered in Bluetooth headset using iPhone 4S
- Fixed Phone doesn't display MPK configuration via provisioning if no reboot
- Fixed New account can't be registered via provisioning if no reboot
- Fixed Message app shows wrong error prompt when entering special characters in sender field
- Fixed Phone doesn't send MDNS request after enabling MDNS settings
- Fixed Long names in Contacts app are hidden automatically
- Fixed Video from Mobotix not shows on the phone using 3CX SIP server
- Fixed GXV3240 compatibility issue with GXP2200EXT board during provisioning
- Fixed Cannot establish 3-way conference with NEC PBX by adding NEC special mode
- Fixed There is no incoming call displayed when the third call comes in headset mode
- Fixed Music and Record file can be played simultaneously
- Fixed Phone requires reboot after changing Broadsoft XSI configuration
- Fixed Should hide BS Calllog and BS Contacts when user hasn't typed any username, password or server address
- Fixed Call log app only shows outbound calls from Broadsoft XSI instead of the complete call log
- Fixed Local call log still shows up on the phone as an option to select when all local logs on line 1 to line 6 are disabled

## **FIRMWARE VERSION 1.0.1.54**

### **PRODUCT NAME**

GXV3240, GXV3275

### **DATE**

08/29/2014

### **CHANGES SINCE FIRMWARE VERSION 1.0.1.50**

#### **ENHANCEMENT**

- Updated camera electric current for the built-in camera support



## FIRMWARE VERSION 1.0.1.50

### PRODUCT NAME

GXV3240, GXV3275

### DATE

08/08/2014

### CHANGES SINCE FIRMWARE VERSION 1.0.1.40

#### ENHANCEMENT

- Added support for Broadsoft XSI features
- Added option to select AES crypto length for SRTP. The option is under web UI->Account X->Codec Settings page
- Changed the iLBC P parameter value from 97 to 98 to be consistent with GXP phones
- Added option to allow using phone's speaker for audio output when HDMI is plugged in. The option is under LCD->Settings->Sound->General->HDMI
- Improved 3.5mm headset TX audio
- Added option "Enable Function for Incoming Call" setting to allow video preview feature. The option is under web UI->Advanced Settings->Call Features
- Improved Lync Setup guide application. Lync Setup guide application is in LCD menu

#### BUG FIX

- Fixed transfer function will be disabled after video off in a video call
- Fixed HDMI display still shows video screen after video off during video call
- Fixed the call interface cannot switch to updated status after answering the second call
- Fixed the video call will be ended in 10 seconds after switching to remote party display
- Fixed HDMI display shows black screen after establishing a second call and switching HDMI display to remote party video
- Fixed missing tool tips for web UI options
- Fixed BLF Call-pickup Prefix value will become null after factory reset
- Fixed if the original call is put hold and the phone attempts to do attended transfer by dialing another party's number, only one call remains on the phone after cancelling from attended transfer
- Fixed Lync guide app still shows "Download and Install" after starting downloading
- Fixed handset is not disabled after reboot even though the system setting shows disabled
- Fixed the call is not answered with video automatically displayed even though "Remote Video Request" is set to "Accept" on the phone
- Fixed the time displayed in the FileManager app is not changed when the system updates the time display format to 24hour or 12 hour

- Fixed cannot dial out using Lync account from phone's dialer after reboot
- Fixed when using phone dialer, the phone cannot redial the previous number dialed by Lync account

## **FIRMWARE VERSION 1.0.1.40**

### **PRODUCT NAME**

GXV3240, GXV3275

### **DATE**

07/16/2014

### **CHANGES SINCE FIRMWARE VERSION 1.0.1.39**

#### **ENHANCEMENT**

- Added support to configure ring timeout with no limit. If set ring timeout value to 0, the phone will keep ringing with no limit

#### **BUG FIX**

- Fixed FileManager sometimes stopped running during copy/paste operations
- Remove Jabra EHS headset option from web UI. Jabra EHS headset is currently not supported
- Fixed the LED light still flash after clearing the notification in status bar
- Fixed a black box pops up after deleting contact
- Fixed dial plan prefix applies to the phone number when dialing out from call history
- Fixed phone cannot display backup file after upgrading
- Fixed phone cannot display backup file after unplugging and plugging back SD card/Flash drive, or under certain automatic backup scenarios
- Fixed the first invalid 0 in Alternate DNS Server Address setting cannot be cleared
- Fixed failed to set automatic backup for third party application

## **FIRMWARE VERSION 1.0.1.39**

### **PRODUCT NAME**

GXV3240, GXV3275

### **DATE**

06/30/2014

### **CHANGES SINCE FIRMWARE VERSION 1.0.1.37**

#### **ENHANCEMENT**

- Added support to accept special character + for SIP User ID
- Added support to allow alphabet letters to be dialed out when the dial plan is disabled
- Added support to allow MPK and contact to dial out alphabet letters

## FIRMWARE VERSION 1.0.1.37

### PRODUCT NAME

GXV3240, GXV3275

### DATE

06/25/2014

### CHANGES SINCE FIRMWARE VERSION 1.0.1.27

#### ENHANCEMENT

- Added support for SRTP
- Added support for 6-way conference
- Improved performance for DTMF delay issue in video call
- Added web UI option to delete captured trace from Maintenance->Debug page
- Added PC port VLAN setting support
- Added support to accept special characters for SIP User ID  
Please note users might need clear browser cache when using certain web browsers
- Changed P values for Extension board MPKs from P10000-P10799 to P23000-P23799. The previous P values P10000-P10799 are still working if P23000-P23799 are not used. It is recommended to use P23000-P23799 starting from firmware version 1.0.1.37

#### BUG FIX

- Fixed sometimes cannot move App downloaded from GS market to desktop
- Fixed phone can't download phonebook XML file from TFTP server using domain name
- Removed wifi test and btttest command from SSH console. It's for internal debug only and it doesn't affect normal usage
- Fixed the remote party can hear "pu" sound when the user switches between speaker and handset on the phone
- Fixed the screensaver will not work after closing the miss call tip on LCD
- Fixed when the phone is configured to use Spanish language, during installation of an application from market, the phone displays the application has been uninstalled while the application is installed correctly
- Fixed phone becomes abnormal in long time repeated video conference
- Fixed phone crash on hard reboot/power cycle
- Fixed account widget displays NO IP after hard reboot or unplug/plug network
- Fixed switching idle screens is not smooth if adding too many folders in the desktop
- Fixed no error notification if recording or capturing screenshot after the memory is full

- Fixed wrong mute icon in subsequent conference call if using mute after inviting party to conference fails
- Fixed switching connections between different Bluetooth devices results in Bluetooth abnormal
- Fixed NTP server address will not update instantly on LCD
- Fixed when using Broadsoft SCA and placing the call with private hold, "Private Unhold" softkey displays at wrong place in the call screen
- Fixed Search button is invalid in LDAP book or contacts
- Fixed default value for search timeout in LDAP is 0
- Fixed conference screen shows conference member overlapped with the request box in audio mode
- Fixed LCD always displays "connecting the server..." when connecting to openvpn with wrong information
- Fixed LDAP search result can't display without pressing "BACK" button
- Fixed Broadsoft IOT: phone fails to display Host or Guest account after association or disassociation
- Fixed Broadsoft IOT: phone sends wrong DTMF signal
- Fixed Broadsoft IOT: phone does not play distinctive ring tone in call waiting tone
- Fixed in attended transfer, if the 3rd party answers and turns on video, the call will appear silence after 2 minutes
- Fixed invalid IMAP server domain name will cause the server option name change to POP3 in Email app
- Fixed Bluetooth: call history in cell phone cannot sync with GXV3240 call interface after turning on/off headset mode several times
- Fixed option "Alarm" doesn't show up under Menu->Settings->Sound->Volumes if using Italian as the display language
- Fixed phone shows "Audio Call" on the upper left of the LCD on incoming video call ringing screen
- Fixed phone prompts "can't open camera" when ending video call
- Fixed phone doesn't show headset icon in audio loopback headset test using Diagnosis app
- Fixed DND mode doesn't sync up correctly when configuring between top status bar->system settings and blacklist
- Fixed hidden folder will display when accessing phone's FTP server on PC
- Fixed phone shows "FileManager has stopped running" when searching in FileManager app after flash drive is inserted
- Fixed Bluetooth: BT hands-free account does not display correct call history when accessing it from the account widget. It only shows after switching to SIP account and then switching back to BT hands-free account.
- Fixed some string translation for Spanish language
- Fixed can only save the contact to the phone's memory. The phone should allow users to select which account to save the contact.
- Fixed Bluetooth: the call cannot be ended using Speaker button if initiating a call using the BT hands-free account using speaker mode
- Fixed EHS headset: the phone shows "phone has stopped" after switching channel on the EHS headset many times

- Fixed it will not clear missed call notice after accessing call history
- Fixed auto backup app can't backup 3rd party app
- Fixed when the phone receives a call from a server providing caller name and caller number, both caller name and caller number will be displayed in ringing screen, but in the call history only the caller number is displayed
- Fixed phone allows setting local RTP port to odd number but phone doesn't send RTP packets to odd number local RTP port
- Fixed Bluetooth: there is no audio on incoming/outgoing calls from the phone if receiving a SIP call during a hands-free Bluetooth call
- Fixed the phone should allow alphanumeric, - and \_ only for SIP user ID and Offhook Auto Dial option via web UI or LCD
- Fixed when a contact is created on the phonebook and the user adds a note that exceeds 60 characters, the user cannot view the full note on the contact view page
- Fixed after inserting flash drive and pressing contacts->export->selecting the folder as flash drive, if the user unplugs the flash drive and proceeds exporting, the phone prompts error message and then prompts export successful message. It shouldn't export and shouldn't display export successful message
- Fixed if the local contact is empty and "Replace duplicate entries" is turned on for import, the phone shows removing duplicate entries progress before importing the contacts. It shouldn't display removing duplicate entries progress if the local contact is empty
- Fixed Bluetooth: the call history doesn't match the account after switching accounts between SIP account and BT hands-free account
- Fixed Bluetooth: when using hands-free mode with a cell phone, if answering the call from cell phone and then pressing Speaker button to end the call, the phone returns to idle screen but the status bar still shows one call in the background
- Fixed Bluetooth: when using hands-free mode with a cell phone, sometimes the phone doesn't show incoming call while the cell phone rings
- Fixed Bluetooth: when using hands-free mode with a cell phone and there is a new incoming call during active call, the call will be silent after ending the first call and answering the second call
- Fixed when dialing from the phone and using the backspace hard key, the timer for the no key entry timeout doesn't reset to 4 for subsequently entered digits
- Fixed Recorder app: the maximum value for the recording space has no upper limit
- Fixed Backup: there is no tips about invalid path when the path doesn't exist
- Fixed Backup: the memory size shows different when backing up the same app on internal SD and Flash drive respectively
- Fixed Backup: there is no error message when the storage is about full
- Fixed there is no restriction when entering invalid VLAN tag information from web UI. This causes the phone has no IP
- Fixed formatting the SD card in the storage has wrong prompt
- Fixed Recorder app: recorder stopped after hard reboot
- Fixed Broadsoft: enabling SCA on account 5 will go to Pickup interface when there is no park info

- Fixed Broadsoft: Park info displays incorrectly using SCA
- Fixed SIP NOTIFY with resync event should not reboot the phone
- Fixed replacing duplicate entries doesn't work when importing phonebook with format vcf
- Fixed HDMI: the audio output from phone is using phone's speaker channel when connected with HDMI device
- Fixed when using Broadsoft SCA, Call Pickup (for Call Park) fails after the account stays on public hold for about 25s
- Fixed sometimes GSMarket app stops running
- When using Broadsoft SCA and placing the call with private hold, "Private Unhold" softkey displays at wrong place in the call screen
- In message application main screen, after pressing Menu key, the first tap on the LCD cannot take effect
- Fixed symmetric RTP option doesn't take effect
- Fixed Broadsoft: DUT fails to display the complete calling name
- Fixed Conference: the snapshot photo shows black-and-white when captured in 3-way video conference
- Fixed when using Broadsoft SCA and there is a call parked against the account, Call Park information will be displayed on the wrong account.
- Fixed adjusted display method for MPK button so the text can be scrolled if too long to display
- Fixed phone will not ring ringtone when there is a failed line in conference call
- Fixed there is no hands-free icon if pressing SEND button when the phone is in idle