

GXW450X Firmware Release Notes

Table of Content

FIRMWARE VERSION 1.0.0.22	1
PRODUCT NAME.....	1
DATE	1
FIRMWARE FILE INFORMATION	1
CHANGES/ENHANCEMENT	1
KNOWN ISSUE	1
FIRMWARE VERSION 1.0.0.20	2
PRODUCT NAME.....	2
DATE	2
FIRMWARE FILE INFORMATION	2
CHANGES/ENHANCEMENT	2
KNOWN ISSUE	2
FIRMWARE VERSION 1.0.0.18	3
PRODUCT NAME.....	3
DATE	3
FIRMWARE FILE INFORMATION	3
IMPORTANT UPGRADING NOTE.....	3
KNOWN ISSUE	3

FIRMWARE VERSION 1.0.0.22

PRODUCT NAME

GXW4501/GXW4502/GXW4504

DATE

04/26/2019

FIRMWARE FILE INFORMATION

- GXW450X firmware file name: gxw4500fw.bin

MD5 checksum: 8988e06dd7730439d1a0623438e5dc45

CHANGES/ENHANCEMENT

- Fixed issue that E1 option "PRI Indication" can't take effect
- Fixed issue that enabled static route may turn to disabled in few circumstances, including upgrading firmware, changing router/switch mode, or rebooting unit.
- Internal bug fixes

KNOWN ISSUE

- Static IPv6 configuration page has no default gateway option. Need to manually add static route with destination ::/0 as default route.

FIRMWARE VERSION 1.0.0.20

PRODUCT NAME

GXW4501/GXW4502/GXW4504

DATE

04/04/2019

FIRMWARE FILE INFORMATION

- GXW450X firmware file name: gxw4500fw.bin

MD5 checksum: 46b423b21550e9043bbc042026618669

CHANGES/ENHANCEMENT

- Fixed issue that Dynamic IPv6 WAN mode will need manually adding default gateway into static route. Now Dynamic IPv6 on WAN should work without need of manual configuration of static route.
- Fixed issue that importing inbound report csv file will fail if no existing inbound route configured.
- Fixed issue that Router model with PPPoE WAN setting will cause LAN device fail to connect internet.
- Internal bug fixes

KNOWN ISSUE

- Static IPv6 configuration page has no default gateway option. Need to manually add static route with destination ::/0 as default route.
- Enabled static route may turn to disabled in few circumstances, including upgrading firmware, changing router/switch mode, or rebooting unit. However, the static route still functioning as enabled, and reboot will fix the display issue.
- E1 option "PRI Indication" can't take effect

FIRMWARE VERSION 1.0.0.18

PRODUCT NAME

GXW4501/GXW4502/GXW4504

DATE

03/22/2019

FIRMWARE FILE INFORMATION

- GXW450X firmware file name: gxw4500fw.bin
- MD5 checksum: f62de1499dbec183cd779a052f321459

IMPORTANT UPGRADING NOTE

- This is first release of GXW450X

KNOWN ISSUE

- Router model with PPPoE WAN setting will cause LAN device fail to connect internet.
- After upgrade from older firmware version to 1.0.0.18. Enabled static route may turn to disabled. However, it's still functioning as enabled. Reboot will fix the display issue.
- Import inbound report csv file will fail if no existing inbound route configured. Manually add one inbound route will fix the issue.
- Dynamic IPv6 WAN mode will need manually adding default gateway into static route.