

GDS3710 Firmware Release Notes

Table of Content

Table of Content	1
FIRMWARE VERSION 1.0.7.7	q
PRODUCT NAME	
DATE	
SUMMARY OF UPDATE	
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	
ENHANCEMENT	
BUG FIX	
KNOWN ISSUES	_
NEW P-VALUE	
MODIFIED P-VALUE	
NEW HTTP API	
NEW FEATURES OVERVIEW	
SUPPORT FAILOVER MECHANISM ON DNS SRV	
SIREN ALARMING WHEN DOOR OPENED ABNORMALLY (SPECIAL WIRING REQU	IRED) 14
ONLY ACCEPT INCOMING SIP CALL FROM PROXY/SERVER	•
SUPPORT HOLIDAYS IN KEEP DOOR OPEN SCHEDULE	19
RESET FACTORY PASSWORD VIA SPECIAL KEY COMBINATION OPERATION	20
FIRMWARE VERSION 1.0.7.4	22
PRODUCT NAME	22
DATE	
SUMMARY OF UPDATE	
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	
ENHANCEMENT	23
BUG FIX	24
KNOWN ISSUES	24
NEW P-VALUE	25
MODIFIED P-VALUE	26
NEW HTTP API	26
NEW FEATURES OVERVIEW	29
SUPPORT DNS SRV	29
SUPPORT SPECIAL FEATURE - TELEFONICA	30



SEPARATE CREDENTIALS FOR GDSMANAGER	31
G.729 AND MULTIPLE AUDIO CODECS SIMULTANEOUSLY WITH PRIORITY	33
SCHEDULE FOR FIRMWARE UPGRADE AND PROVISIONING, DHCP OPTIO	N 12034
REREGISTER BEFORE EXPIRATION AND VOICE FRAME PER TX	35
KEYPAD BLUE LIGHT ON/OFF ON SCHEDULE	36
ADJUST SYTEM DEFAULT VOLUME TO LEVER 2	37
SUPPORT ANONYMOUSE RTSP LIVE VIEW	38
FIRMWARE VERSION 1.0.5.6	40
PRODUCT NAME	40
DATE	40
SUMMARY OF UPDATE	40
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	40
ENHANCEMENT	41
BUG FIX	42
KNOWN ISSUES	43
NEW P-VALUE	44
MODIFIED P-VALUE	46
NEW HTTP API	46
NEW FEATURES OVERVIEW	47
SUPPORT 4 SIP ACCOUNTS	47
CONFIGURE H.264, DTMF PAYLOAD AND PROXY ROUTE VALUE	49
ADD OR DELETE CUSTOMIZED DOORBELL TONE	50
SYSTEM HEALTH ALERTS VIA EMAIL	51
SET SCHEDULE FOR LOCAL PIN TO OPEN DOOR	52
SUPPORT PACKKETIZATION MODE 0	53
SUPPORT CSV FORMAT WHEN IMPORT/EXPORT CARD DATA FILE	54
SUPPORT ANONYMOUSE SNAPSHOT	55
NORMAL OPEN/CLOSE IN ALARM_OUT1 (COM1) OPEN DOOR CONTROL	56
ADDED BOOT VERSION IN "STATUS" PAGE	57
FIRMWARE VERSION 1.0.5.2	58
PRODUCT NAME	58
DATE	58
SUMMARY OF UPDATE	58
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	58
ENHANCEMENT	59
BUG FIX	60
KNOWN ISSUES	61
NEW P-VALUE	62
NEW HTTP API	63



CONTROL DOOR2 VIA ALARM_OUT (COM1) INTERFACE	NEW FEATURES OVERVIEW	65
DEFINE NUMBER OF SNAPSHOT UPLOADED WHEN OPEN DOOR 70 DEFINE DIGIT INPUT INTERFACE TO BE NORMAL OPEN OR CLOSE 71 SET SCHEDULE FOR ALARM IN OPEN DOOR 72 OPEN DOOR VIA DIGIT ONLY PRIVATE PIN 73 SET "NO KEY ENTRY TIMEOUT" 74 EMAIL SNAPSHOTS WHEN DOOR OPENED 75 ALLOW ANONYMOUS VIEWING 76 DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN 77 EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN) 78 CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 SUMMARY OF UPDATE 85 WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 NEW HYTP API 86 NEW HYTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME	CONTROL DOOR2 VIA ALARM_OUT (COM1) INTERFACE	65
DEFINE DIGIT INPUT INTERFACE TO BE NORMAL OPEN OR CLOSE 71 SET SCHEDULE FOR ALARM IN OPEN DOOR 72 OPEN DOOR VIA DIGIT ONLY PRIVATE PIN 73 SET "NO KEY ENTRY TIMEOUT" 74 EMAIL SNAPSHOTS WHEN DOOR OPENED 75 ALLOW ANONYMOUS VIEWING 76 DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN 77 EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN) 78 CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 SUMMARY OF UPDATE 85 WARNING: 86 ENHANCEMENT 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 NEW HTTP API 86 FIRMWARE VERSION 1	ENABLE / DISABLE WEB UI ACCESS	69
SET SCHEDULE FOR ALARM IN OPEN DOOR 72 OPEN DOOR VIA DIGIT ONLY PRIVATE PIN 73 SET "NO KEY ENTRY TIMEOUT" 74 EMAIL SNAPSHOTS WHEN DOOR OPENED 75 ALLOW ANONYMOUS VIEWING 76 DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN 77 EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN) 78 CHECKUPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 SUMMARY OF UPDATE 87 SUMMARY OF UPDATE 87 SUMMARY OF UPDATE 87 SUMMARY OF	DEFINE NUMBER OF SNAPSHOT UPLOADED WHEN OPEN DOOR	70
OPEN DOOR VIA DIGIT ONLY PRIVATE PIN 73 SET "NO KEY ENTRY TIMEOUT" 74 EMAIL SNAPSHOTS WHEN DOOR OPENED 75 ALLOW ANONYMOUS VIEWING 76 DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN 77 EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN) 78 CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 SUMMARY OF UPDATE 85 WARNING: 86 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 SUMMARY OF UPDATE 87 SUMMARY OF UPDATE 87 WARNING: 87	DEFINE DIGIT INPUT INTERFACE TO BE NORMAL OPEN OR CLOSE	71
SET "NO KEY ENTRY TIMEOUT" 74 EMAIL SNAPSHOTS WHEN DOOR OPENED 75 ALLOW ANONYMOUS VIEWING 76 DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN 77 EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN) 78 CHECKUPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 85 WARNING: 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	SET SCHEDULE FOR ALARM IN OPEN DOOR	72
EMAIL SNAPSHOTS WHEN DOOR OPENED 75 ALLOW ANONYMOUS VIEWING 76 DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN 77 EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN) 78 CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 85 WARNING: 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	OPEN DOOR VIA DIGIT ONLY PRIVATE PIN	73
ALLOW ANONYMOUS VIEWING	SET "NO KEY ENTRY TIMEOUT"	74
DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN	EMAIL SNAPSHOTS WHEN DOOR OPENED	75
EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN) 78 CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 85 WARNING: 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE. 79 SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE. 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG. 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH. 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME. 85 DATE. 85 SUMMARY OF UPDATE. 85 WARNING: 86 ENHANCEMENT. 86 BUG FIX. 86 KNOWN ISSUES. 86 NEW P-VALUE. 86 NEW HTTP API. 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME. 87 DATE. 87 SUMMARY OF UPDATE. 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN	77
SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE 81 DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 85 WARNING: 86 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN)	78
DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG. 82 CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH. 83 FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME. 85 DATE. 85 SUMMARY OF UPDATE. 85 WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT. 86 BUG FIX. 86 KNOWN ISSUES. 86 NEW P-VALUE. 86 NEW HTTP API. 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME. 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE	79
CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH		
FIRMWARE VERSION 1.0.4.9 85 PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 85 WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG	82
PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 85 WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA	SSH83
PRODUCT NAME 85 DATE 85 SUMMARY OF UPDATE 85 WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	FIRMWARE VERSION 1 0 4 9	85
DATE 85 SUMMARY OF UPDATE 85 WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
SUMMARY OF UPDATE 85 WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
WARNING: 85 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
FIRMWARE APPLIES TO BELOW HW VERSION ONLY 86 ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
ENHANCEMENT 86 BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
BUG FIX 86 KNOWN ISSUES 86 NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
KNOWN ISSUES		
NEW P-VALUE 86 NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
NEW HTTP API 86 FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME 87 DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88		
FIRMWARE VERSION 1.0.4.5 (REMOVED) 87 PRODUCT NAME		
PRODUCT NAME	NEW HTTP API	86
DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	FIRMWARE VERSION 1.0.4.5 (REMOVED)	87
DATE 87 SUMMARY OF UPDATE 87 WARNING: 87 FIRMWARE APPLIES TO BELOW HW VERSION ONLY 88	PRODUCT NAME	87
SUMMARY OF UPDATE		
WARNING:		
FIRMWARE APPLIES TO BELOW HW VERSION ONLY88		
ENHANCEMENT88		
BUG FIX		
KNOWN ISSUES		
NEW P-VALUE		
NEW HTTP API		
NEW FEATURES OVERVIEW 90		



PARELLEL HUNTING/SIMUTANEOUS RINGING WHEN DOORBELL PRESSED EVENT NOTIFICATION	
FIRMWARE VERSION 1.0.3.35	93
PRODUCT NAME	93
DATE	
SUMMARY OF UPDATE	
IMPORTANT UPGRADING NOTE	
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	93
ENHANCEMENT	94
BUG FIX	94
KNOWN ISSUES	94
NEW FUNCTIONS	95
NEW P-VALUE	95
NEW HTTP API	95
NEW FEATURES OVERVIEW	96
ASSIGN SCHEDULE TO DOOR BELL	96
MAXIMUM NUMBER OF DIGIT DIALED	97
FIRMWARE VERSION 1.0.3.34	98
PRODUCT NAME	
DATE	
SUMMARY OF UPDATE	
IMPORTANT UPGRADING NOTE	
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	
ENHANCEMENT	
BUG FIX	
KNOWN ISSUES	
NEW FUNCTIONS	
NEW P-VALUE	_
NEW HTTP API NEW FEATURES OVERVIEW	
CHROME/FIREFOX NO PLUGIN REQUIRED FOR VIDEO LIVEVIEW	
BASIC AUTHENTICATION of MJPEG VIDEO OR SNAPSHOT VIA HTTP API	
OPEN DOOR BY CONFIGURED SCHEDULE OR TIME WINDOW	
ALARM NOTIFICATION OF ACCESS BY USERS OUT OF SCHEDULE	
SEND SNAPSHOT VIA EMAIL WHEN DOORBELL PRESSED	
RTCP/RTCP-XR SIP CALL FOR ITSP/CLOUD SOLUTION	
IMPROVED EVENT LOG UI LAYOUT	
FIRMWARE VERSION 1.0.3.32	110



PRODUCT NAME	110
DATE	110
SUMMARY OF UPDATE	110
IMPORTANT UPGRADING NOTE	110
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	110
ENHANCEMENT	111
BUG FIX	112
KNOWN ISSUES	112
NEW FUNCTIONS	113
NEW P-VALUE	113
NEW HTTP API	114
NEW FEATURES OVERVIEW	115
HTTP OPEN DOOR	115
SELF-DEFIND EVENT NOTIFICATION MESSAGE	116
FIRMWARE VERSION 1.0.3.31	117
PRODUCT NAME	117
DATE	
SUMMARY OF UPDATE	117
IMPORTANT UPGRADING NOTE	117
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	
ENHANCEMENT	117
BUG FIX	118
KNOWN ISSUES	118
NEW FUNCTIONS	119
NEW P-VALUE	119
NEW HTTP API	120
NEW FEATURES OVERVIEW	120
DOOR SYSTEM SETTINGS	120
MULTI-CHANNEL CALL MODE	121
FIRMWARE VERSION 1.0.3.23	122
PRODUCT NAME	
DATE	
SUMMARY OF UPDATE	
IMPORTANT UPGRADING NOTE	
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	
ENHANCEMENT	
BUG FIX	
KNOWN ISSUES	
NEW P-VALUE	



NEW HTTP API	124
NEW FEATURES OVERVIEW	125
CENTRAL MODE	125
BROADSOFT MODE	125
CLICK TO DIAL	126
FIRMWARE VERSION 1.0.3.13	128
PRODUCT NAME	128
DATE	128
SUMMARY OF UPDATE	128
IMPORTANT UPGRADING NOTE	128
FIRMWARE APPLIES TO BELOW HW VERSION ONLY	128
NEW P-VALUE	128
ENHANCEMENT	129
BUG FIX	129
KNOWN ISSUES	130
NEW FEATURES OVERVIEW	
CENTRAL MODE	131
DISABLE ALARM SOUND AT PHONE SIDE FOR TRIGERED SIP CALL	131
CAPTURE IMAGE WHEN DOOR BELL PRESSED	
DISABLE KEYPAD	132
ENABLE REMOTE UNLOCK TO ON HOOK	
DISABLE AUTO ANSWER	
ENABLE DOORBELL BUTTON TO HANG UP CALL	
CARD ISSUING STATE EXPIRED TIME	
LIGHT SETTINGS	
ENABLE DOORBELL BLUE LIGHT PER SETTINGS	
ENABLE LOG REPORT	136
FIRMWARE VERSION 1.0.2.25	138
PRODUCT NAME	138
DATE	138
SUMMARY OF UPDATE	138
IMPORTANT UPGRADING NOTE	138
NEW P-VALUE	138
ENHANCEMENT	138
BUG FIX	139
FIRMWARE VERSION 1.0.2.22	140
PRODUCT NAME	140
DATE	4.40



SUMMARY OF UPDATE	140
IMPORTANT UPGRADING NOTE	140
BUG FIX	140
FIRMWARE VERSION 1.0.2.21	141
PRODUCT NAME	141
DATE	141
SUMMARY OF UPDATE	141
IMPORTANT UPGRADING NOTE	141
ENHANCEMENT	
BUG FIX	142
FIRMWARE VERSION 1.0.2.13	143
PRODUCT NAME	143
DATE	143
SUMMARY OF UPDATE	
IMPORTANT UPGRADING NOTE	
ENHANCEMENT	
BUG FIX	144
FIRMWARE VERSION 1.0.2.9	145
PRODUCT NAME	145
DATE	145
SUMMARY OF UPDATE	145
IMPORTANT UPGRADING NOTE	
ENHANCEMENT	
BUG FIX	145
FIRMWARE VERSION 1.0.2.5	146
PRODUCT NAME	146
DATE	146
SUMMARY OF UPDATE	
IMPORTANT UPGRADING NOTE	
ENHANCEMENT	
BUG FIX	147
FIRMWARE VERSION 1.0.1.19	148
PRODUCT NAME	148
DATE	148
SUMMARY OF UPDATE	148
ENHANCEMENT	148



BUG FIX	149	9
DOO 1 1/	17	J



FIRMWARE VERSION 1.0.7.7

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

10/31/2019

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and features enhancement. Main security enhancement added to alarm the tampering of GDS37xx.

<u>Factory Reset is recommended</u> once upgraded to this version due to major feature enhancement. If upgrading from very old firmware, or experiencing abnormal webUI or missing parameters in the GUI, factory reset is mandatory. Please backup the configuration and data before factory reset and import back after reset.

This firmware would not be able to downgrade to version 1.0.3.X or below.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.2A	YES	Only support HTTP upgrade image
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	



ENHANCEMENT

- Added support for failover mechanism based on DNS SRV
- Added siren alarming function when door opened abnormally (special wiring required)
- Optimized debug output information
- Added option to only accept incoming SIP call from Proxy/Server
- Added including Holidays at Keep Door Open schedule
- Added reset/restore factory default password via special keypad combination operations

BUG FIX

- Fixed device sending out IPv6 packets.
- Fixed impossible to call virtual number at IP Peering (w/o SIP server) between GDS and IP phones.
- Fixed Speaker not playing audio message from server when calling a non-exist number
- Fixed device still send RTCP packets when RTCP is set to disable
- Fixed using G.729 device cannot communicate with DP7xx and GXP21xx SIP Phones
- Fixed device will not request to upgrade and download the configuration file if using TFTP mode with format like: IP_Address:Port/Path or IP_Address/Path

KNOWN ISSUES

- INVITE to an ICMP address, the doorbell still rings as normal.
- The panel lights might off during the call sometimes.
- Remote device can hear custom doorbell ringtone about 1~2 seconds when answering the call.
- GDS3710 as Callee will not do stream negotiation.
- When SIP account is logged out, pressing the keyboard is abnormal.
- When SIP transport mode is TLS/TCP, remote door opening might fail occasionally.



NEW P-VALUE

P15508	Alarm_Settings.Alarm_Events_Config.Digit_Input.Digit_Input_1_Abnormal_Door_Control_Options (value: 0/1)
P15509	Alarm_Settings.Alarm_Events_Config.Digit_Input.Digit_Input_2_Abnormal_Door_Control_Options (value: 0/1)

MODIFIED P-VALUE

P14320	Alarm_Settings.Alarm_Events_Config.Digit_Input.Digit_Input_1 (value: 0/1/2/3)
P14325	Alarm_Settings.Alarm_Events_Config.Digit_Input.Digit_Input_2 (value: 0/1/2/3)

NEW HTTP API

• P15508 -- Alarm_Settings.Alarm_Events_Config.Digit_Input.Digit_Input_1_Abnormal_Door_Control_Options (value: 0/1)

GET: http://ip:port/goform/config?cmd=get&type=event

SET: http://ip:port/goform/config?cmd=set&P15508=<value> (value: 0/1)

• P15509 -- Alarm_Settings.Alarm_Events_Config.Digit_Input.Digit_Input_1_Abnormal_Door_Control_Options (value: 0/1)

GET: http://ip:port/goform/config?cmd=get&type=event

SET: http://ip:port/goform/config?cmd=set&P15509=<value> (value: 0/1)

Released HTTP API documentation can be downloaded from here:

http://www.grandstream.com/sites/default/files/Resources/gds37xx_http_api.pdf




NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

SUPPORT FAILOVER MECHANISM ON DNS SRV

Web Configuration


This option can be found under device web UI \rightarrow Account X (X=1, 2, 3, and 4):

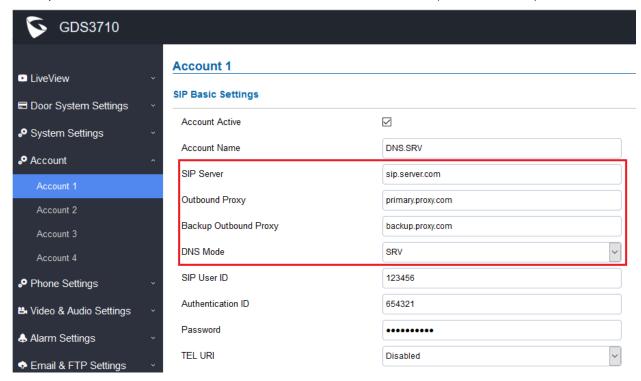

Functionality

This is a major feature enhancement for Service Provider, via DNS SRV (mainly for BroadSoft certified soft switch for major Internet Telephony service providers). Service providers can use this feature to provider smooth service transition backup in case service down.



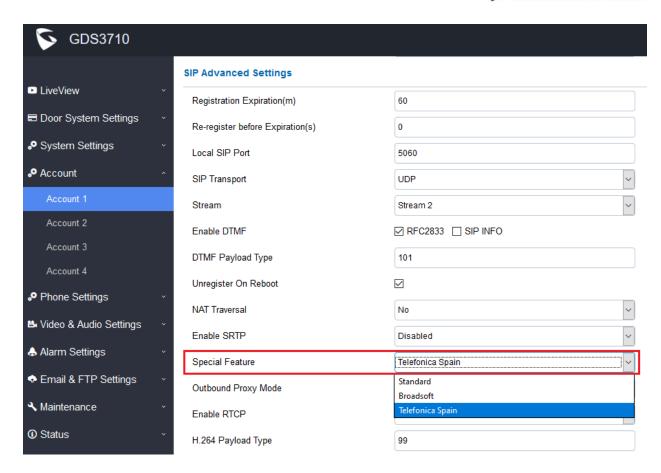


In the device web UI \rightarrow Account X (X=1, 2, 3, and 4) \rightarrow SIP Advanced Settings \rightarrow Special Feature: There is a new feature specially designed for Telefonica Spain to match the service provided by Telefonica to their customers. Just need to enable this feature via either WebUI or Provisioning.



SIREN ALARMING WHEN DOOR OPENED ABNORMALLY (SPECIAL WIRING REQUIRED)

Web Configuration

This option can be found under device web UI → Alarm Settings → Alarm Events Config → Digit Input:

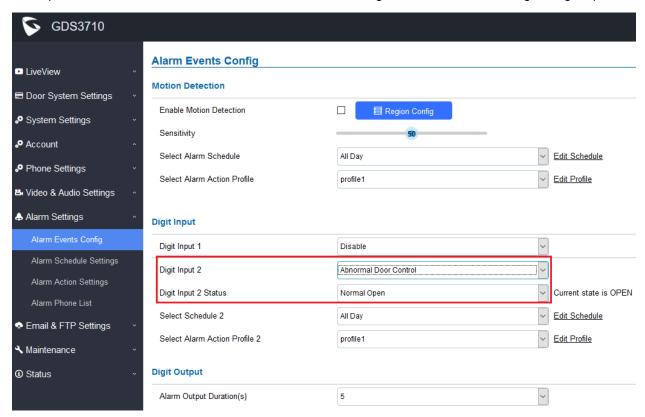

Functionality

This is a major security enhancement for GDS37xx when device be tampered to open the door abnormally.

When this feature enabled (special wiring required, see below wiring diagram), abnormal open door will be detected by DI port (Alarm_In2 or IN2 in below diagram showed) if wired correctly (connecting the COMx port to DIx port) therefore trigger siren alarm. Once abnormal open door alarm triggered, the siren will sound non-stop, until manually override by related person.

There are several ways to stop and disable the alarm:

- 1) Power cycle the GDS37xx
- 2) Pick up the Alarm Phone Call (if configured)
- 3) Open Door using PIN (either public PIN or private PIN)


Once alarm triggered, the GDS3710 will **take snapshots** when the abnormal open door happened, email and upload the snapshots to FTP or Central Server (when configured); call the configured alarm SIP phone, send the alarm output (if connected). User will only be able to disable the siren using the 3 methods mentioned above.

Detailed action information please refer to GDS37xx User Manual, "Alarm Action Settings" configuration.




Below are some diagrams showing the correct wiring to enable this new security enhancement feature:

GDS3710 Connection & Wiring Diagrams ---- "Fail Safe" Electric Strike, 3rd Party Power Supply

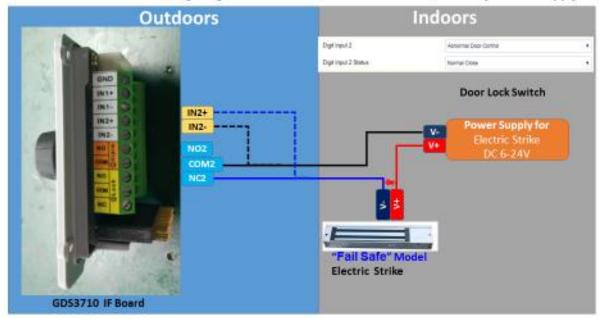


GDS3710 Connection & Wiring Diagrams ---- "Fail Safe" Electric Strike, 3rd Party Power Supply

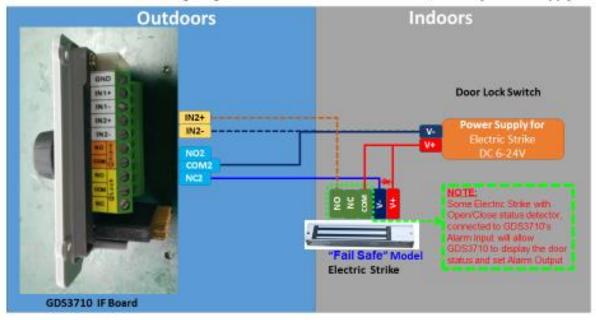




GDS3710 Connection & Wiring Diagrams ---- "Fail Secure" Electric Strike, 3rd Party Power Supply

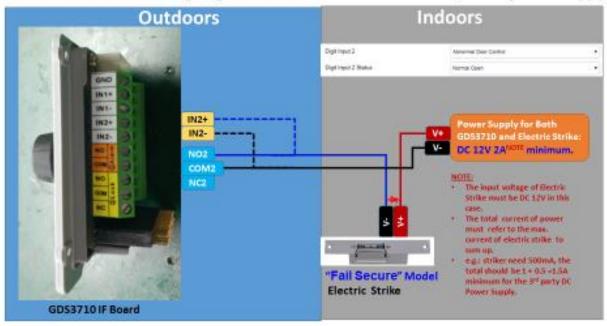


GDS3710 Connection & Wiring Diagrams ---- "Fail Secure" Electric Strike, 3rd Party Power Supply

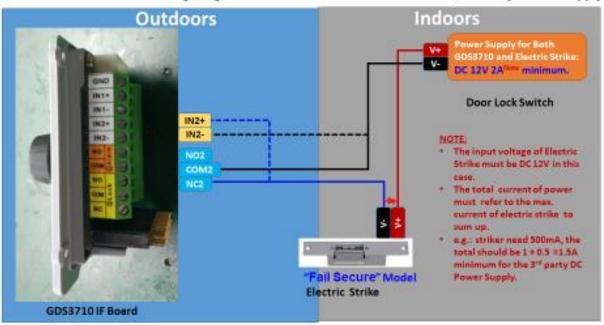



If 3rd party door sensor installed, customer can wire the door sensor signal directly into the DI port (DI2 in below example) to trigger the alarm if the door opened abnormal. See below diagram:

GDS3710 Connection & Wiring Diagrams ---- "Fail Secure" Electric Strike, 3rd Party Power Supply

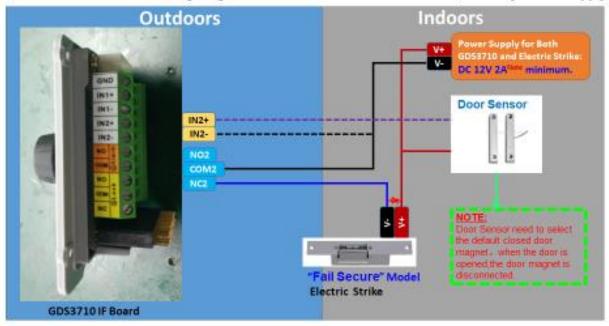

For detailed information, please refer to User Manual and Resource Center:


- GDS3710 User Manual: http://www.grandstream.com/sites/default/files/Resources/GDS3710_UserManual_0.pdf
- HOW-TO Guide http://www.grandstream.com/support/resources/?title=GDS3710



ONLY ACCEPT INCOMING SIP CALL FROM PROXY/SERVER

Web Configuration

This option can be found under device web UI \rightarrow Account X (X=1, 2, 3, and 4):

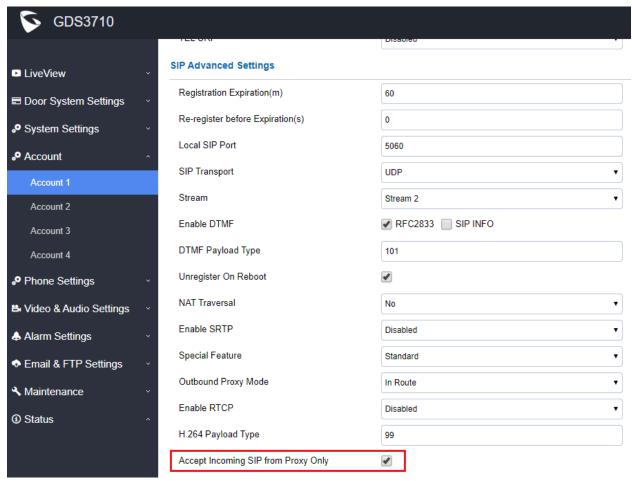

Functionality

This feature is implemented based on field customer feedback.


This is also security enhancement for SIP phone calls. When this feature enabled, the GDS37xx will ONLY accept calls from authorized proxy/server. This will prevent SIP hacking or 'ghost' calls.



SUPPORT HOLIDAYS IN KEEP DOOR OPEN SCHEDULE

• Web Configuration

This option can be found under device web UI → Door System Settings → Keep Door Open:

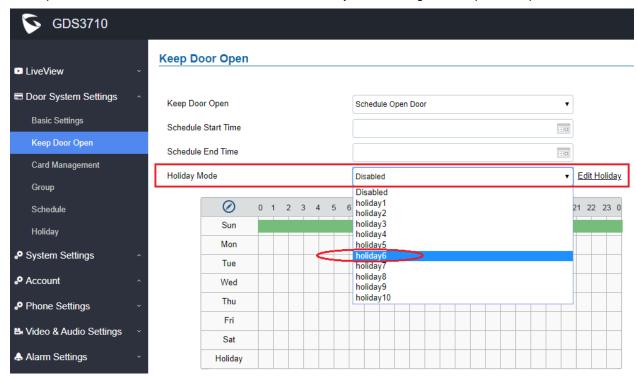

Functionality

This feature is implemented based on field customer feedback either.

When configure Keep Door Open schedule, customers now can also specify which Holiday Schedule to be included into the Keep Door Open schedule, therefore make the GDS37xx more user friendly in such application scene configuration.



RESET FACTORY PASSWORD VIA SPECIAL KEY COMBINATION OPERATION

Functionality

This is a new enhancement feature requested by ITSP service providers as well as lots of system integrators from Forum. This feature allows customers to reset the device administrator password to factory default via keypad operation through some special key combination.

When performing this operation, ONLY password will be reset back to factory default. All other setting or parameters will NOT be changed and will remain the same. This feature is specially designed for field engineers or technicians when dispatched in field but for some reason the administrator password is not available therefore not able to access the GDS37xx device to do the related maintenance.

Here are the steps to do such password reset operation via keypad:

Encoding Rules:

Alphabet A – Z mapping to digit 1 – 26 respectively, no difference in lower or up case.

Α	В	С	D	E	F	G	Н	- 1	J	K	L	M	N	0	P	Q	R	S	Т	U	V	w	X	Υ	Z
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26

NOTE:

Suggest decoding the MAC and Password and write on paper before doing the reset operation.

Prerequisite condition:

- 1) MAC address of the GDS37xx (check the sticker at back of the device)
- 2) Default password of the GDS37xx (check the sticker at the back of the device)
- 3) Correct decoding the last 6 MAC address into digits (refer to encoding rule)
- 4) Correct decoding the default password into digits (refer to encoding rule)
- 5) Finish keypad input within 1 minute



Operation Steps:

- 1) When device is idle, input the special keypad combination with format: ***last_6_MAC**#
- 2) Device will reach restore mode after correct digits in <u>Step 1</u>) entered. The backlight of keypad will flash quickly to tell operator the device is now in password reset/restore mode.
- 3) Operator will enter the correct decoded default password ending with # with format: default_password_code# via the keypad within 60 seconds.
- 4) If wrong code combination entered, the GDS37xx will beep with error sound (three short beeps) then exit the password reset mode, and the backlight will stop flashing.
- 5) If the correct default password decode entered within 60 seconds, GDS37xx will play a long beep sound (advising correct operation), the device will reboot itself automatically.
- 6) If keypad entry time out (not finish the input within 60 seconds), the device will exit this password reset mode automatically and stop the backlight flashing.

After successful password reset, operator will then be able to log into the GDS37xx webUI with default password, all the configuration inside the device will be the same and will NOT be changed.

For example:

Decoding the string into digits and write to paper before doing the operation:

Device with last 6 MAC address:

Decoding the last 6 MAC to digits would be:

334444

Default password is:

xwpxz6AA

Decoding the default password to digits would be:

2423162426611

- 1) Enter ***334444**# via keypad, get into the password reset mode, the keypad backlight will flash quickly.
- 2) Within 60 seconds, enter 2423162426611#, the device will play one long beep then reboot itself.
- 3) Wait the device finishing boot up, log in the webUI using the default password, xwpxz6AA



FIRMWARE VERSION 1.0.7.4

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

07/23/2019

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and features enhancement. Main enhancement like added Service Provider (e.g.: Telefonica) feature support, etc.

<u>Factory Reset is recommended</u> once upgraded to this version due to major feature enhancement. If upgrading from very old firmware, or experiencing abnormal webUI or missing parameters in the GUI, factory reset is mandatory. Please backup the configuration and data before factory reset and import back after reset.

This firmware would not be able to downgrade to version 1.0.3.X or below.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.2A	YES	Only support HTTP upgrade image
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	



ENHANCEMENT

- Added support for failover mechanism based on DNS SRV.
- Added ability to separate webUI credentials from GDSManager credentials (via added P values).
- Added G.729 audio codec support.
- Optimized the DI alarm mechanism (reset required to enjoy this optimization feature).
- Added ability to enable multiple audio codecs simultaneously and specify priority of codecs.
- Added "Schedule" for firmware upgrade and provisioning.
- Added support for Voice Frame per TX in the audio settings.
- Added option to keep keypad blue light ON/OFF based on schedule.
- Added support for DHCP Option 120
- Added support for reregister before expiration option.
- Added support for anonymous RTSP Live View
- Adjusted system volume default value from 4 to 2.



BUG FIX

- Fixed noise audio issue when using GDSManager Intercom function.
- Fixed "http(s)://IP_GDS3710:Port/snapshot/view0.jpg" does not return instant snapshot.
- Fixed and prevented two identical time durations could be configured.
- Fixed the device firmware cannot be downgraded after importing the P value file.
- Fixed device not contacting the NTP Server provided via DHCP Option 42.
- Fixed device not apply Config File when P value for Alarm Schedule/Profile are empty.
- Fixed modifying time zone or DST by configuration file the DST does not take effect.
- Fixed instant snapshot and live stream not retrievable when using MJPEG live snapshot and live stream URLs respectively:

Snapshot: http(s)://admin:password@IP_Address_GDS:Port/jpeg/view.html
MJPEG Stream: http(s)://admin:password@IP_Address_GDS:Port/jpeg/mjpeg.html

- Fixed GDS3710 calling out to any number can open door via DTMF (Security Enhancement: Only numbers inside RFID cards, White List and DoorBell will be able to remotely open door via DTMF).
- Fixed flooding registration packets cause webUI access stalled.
- Fixed error code 406 not acceptable for Door 2 and disabled the Events in GXV/GDS combination use.
- Fixed issue with decoding DNS (mDNS) answers from GDS3710.

KNOWN ISSUES

- INVITE to an ICMP address, the doorbell still rings as normal.
- The panel lights might off during the call sometimes.
- Remote device can hear custom doorbell ringtone about 1~2 seconds when answering the call.
- GDS3710 as Callee will not do stream negotiation.
- When SIP account is logged out, pressing the keyboard is abnormal.
- When SIP transport mode is TLS/TCP, remote door opening might fail occasionally.



NEW P-VALUE

P15505	Access_Settings.GDSManager_Configuration_Password (Value: String. Maximum length is 32)		
P14560	Basic Settings.Enable Doorbell Blue Light.Start Time		
P14561	Basic Settings.Enable Doorbell Blue Light.End Time		
P14562	Basic Settings.Enable Doorbell Blue Light (Value 0: Disable 1: Enable)		
P144	Date & Time.Allow DHCP Option 42 to override NTP server (Value 0: Disable 1: Enable)		
P37	Account 1.Voice Frames Per TX (1 64, default 2)		
P486	Account 2.Voice Frames Per TX (1 64, default 2)		
P586	Account 3.Voice Frames Per TX (1 64, default 2)		
P686	Account 4.Voice Frames Per TX (1 64, default 2)		
P2330	Account 1.Re-register before Expiration(s) (0 64800, default 0)		
P2430	Account 2.Re-register before Expiration(s) (0 64800, default 0)		
P2530	Account 3.Re-register before Expiration(s) (0 64800, default 0)		
P2630	Account 4.Re-register before Expiration(s) (0 64800, default 0)		
P57	Account 1.Preferred Vocoder 1 (<0 8 9>, default 0)		
P58	Account 1.Preferred Vocoder 2 (<0 8 9>, default 8)		
P59	Account 1.Preferred Vocoder 3 (<0 8 9>, default 9)		
P451	Account 2.Preferred Vocoder 1 (<0 8 9>, default 0)		
P452	Account 2.Preferred Vocoder 2 (<0 8 9>, default 8)		
P453	Account 2.Preferred Vocoder 3 (<0 8 9>, default 9)		
P551	Account 3.Preferred Vocoder 1 (<0 8 9>, default 0)		
P552	Account 3.Preferred Vocoder 2 (<0 8 9>, default 8)		
P553	Account 3.Preferred Vocoder 3 (<0 8 9>, default 9)		
P651	Account 4.Preferred Vocoder 1 (<0 8 9>, default 0)		
P652	Account 4.Preferred Vocoder 2 (<0 8 9>, default 8)		
P653	Account 4.Preferred Vocoder 3 (<0 8 9>, default 9)		
P285	Maintenance.Upgrade.Randomized Automatic Upgrade (0 23)		
P8459	Maintenance.Upgrade.Hour of the Day (0 23)		
P286	Maintenance.Upgrade.Day of the Week (0 6)		



MODIFIED P-VALUE

P14000	Video_Audio_Settings, Audio_Settings, Preferred_Audio_Codec (Value:1, 2, 4)		
P198	Account_1.Special Feature (Value 100: Standard 102: Broadsoft 129: Telefonica Spain)		
P424	Account_2.Special Feature (value: 100: Standard 102: Broadsoft 129: Telefonica Spain)		
P524	Account_3.Special Feature (value: 100: Standard 102: Broadsoft 129: Telefonica Spain)		
P624	Account_4.Special Feature (value: 100: Standard 102: Broadsoft 129: Telefonica Spain)		
P14003	System Volume. Default value: change from level 4 to lever 2.		

NEW HTTP API

- P15505 -- Access_Settings.GDSManager_Configuration_Password (value: String, MAX Length is 32)
 - GET: http://ip:port/goform/config?cmd=get&type=access
 - SET: http://ip:port/goform/config?cmd=set&P15505=<value> (value: String, MAX Length is 32)
- P14562 -- Basic Settings -> Enable Doorbell Blue Light (0:Disable 1:Enable)
 - GET: http://ip:port/goform/config?cmd=get&type=door
 - SET: http://ip:port/goform/config?cmd=set&P14562=<value> (0:Disable 1:Enable)
- P14560 -- Basic Settings -> Enable Doorbell Blue Light -> Start Time
 - GET: http://ip:port/goform/config?cmd=get&type=door
 - SET: http://ip:port/goform/config?cmd=set&P14560=<value> (value: string)
- P14561 -- Basic Settings -> Enable Doorbell Blue Light -> End Time
 - GET: http://ip:port/goform/config?cmd=get&type=door
 - SET: http://ip:port/goform/config?cmd=set&P14561=<value> (value: string)
- P144 -- Date & Time -> Allow DHCP Option 42 to override NTP server (0:Disable 1:Enable)
 - GET: http://ip:port/goform/config?cmd=get&type=date
 - SET: http://ip:port/goform/config?cmd=set&P144=<value> (0:Disable 1:Enable)
- P37 -- Account 1 -> Voice Frames Per TX (1 -- 64)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P37=<value> (1 -- 64)
- P486 -- Account 1 -> Voice Frames Per TX (1 -- 64)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P486=<value> (1 -- 64)
- P586 -- Account 1 -> Voice Frames Per TX (1 -- 64)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P586=<value> (1 -- 64)
- P686 -- Account 1 -> Voice Frames Per TX (1 -- 64)
 - $\label{eq:GET:http://ip:port/goform/config?cmd=get&type=sip} GET: \quad http://ip:port/goform/config?cmd=get&type=sip$
 - SET: http://ip:port/goform/config?cmd=set&P686=<value> (1 -- 64)



- P2330 -- Account 1 -> Re-register before Expiration(s) (0 -- 64800, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P2330=<value> (0 -- 64800)
- P2430 -- Account 2 -> Re-register before Expiration(s) (0 -- 64800, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P2430=<value> (0 -- 64800)
- P2530 -- Account 3 -> Re-register before Expiration(s) (0 -- 64800, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P2530=<value> (0 -- 64800)
- P2630 -- Account 4 -> Re-register before Expiration(s) (0 -- 64800, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P2630=<value> (0 -- 64800)
- P57 -- Account 1 -> Preferred Vocoder 1 (<0|8|9>, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P57=<value> (<0|8|9>)
- P58 -- Account 1 -> Preferred Vocoder 2 (<0|8|9>, default 8)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P58=<value> (<0|8|9>)
- P59 -- Account 1 -> Preferred Vocoder 3 (<0|8|9>, default 9)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P59=<value> (<0|8|9>)
- P451 -- Account 2 -> Preferred Vocoder 1 (<0|8|9>, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P451=<value> (<0|8|9>)
- P452 -- Account 2 -> Preferred Vocoder 2 (<0|8|9>, default 8)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P452=<value> (<0|8|9>)
- P453 -- Account 2 -> Preferred Vocoder 3 (<0|8|9>, default 9)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P453=<value> (<0|8|9>)
- P551 -- Account 3 -> Preferred Vocoder 1 (<0|8|9>, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P551=<value> (<0|8|9>)
- P552 -- Account 3 -> Preferred Vocoder 2 (<0|8|9>, default 8)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P552=<value> (<0|8|9>)
- P553 -- Account 3 -> Preferred Vocoder 3 (<0|8|9>, default 9)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P553=<value> (<0|8|9>)



- P651 -- Account 4 -> Preferred Vocoder 1 (<0|8|9>, default 0)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P651=<value> (<0|8|9>)
- P652 -- Account 4 -> Preferred Vocoder 2 (<0|8|9>, default 8)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P652=<value> (<0|8|9>)
- P653 -- Account 4 -> Preferred Vocoder 3 (<0|8|9>, default 9)
 - GET: http://ip:port/goform/config?cmd=get&type=sip
 - SET: http://ip:port/goform/config?cmd=set&P653=<value> (<0|8|9>)
- P285 -- Maintenance -> Upgrade -> Randomized Automatic Upgrade (0 -- 23)
 - GET: http://ip:port/goform/config?cmd=get&type=upgrade
 - SET: http://ip:port/goform/config?cmd=set&P285=<value> (0 -- 23)
- P8459 -- Maintenance -> Upgrade -> Hour of the Day (0-23)
 - GET: http://ip:port/goform/config?cmd=get&type=upgrade
 - SET: http://ip:port/goform/config?cmd=set&P8459=<value> (0 -- 23)
- P286 -- Maintenance -> Upgrade -> Day of the Week (0-6)
 - GET: http://ip:port/goform/config?cmd=get&type=upgrade
 - SET: http://ip:port/goform/config?cmd=set&P286=<value> (0 -- 6)

Released HTTP API documentation can be downloaded from here:

http://www.grandstream.com/sites/default/files/Resources/gds37xx_http_api.pdf




NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

SUPPORT DNS SRV

• Web Configuration

This option can be found under device web UI \rightarrow Account \rightarrow Account X (X=1, 2, 3, and 4):

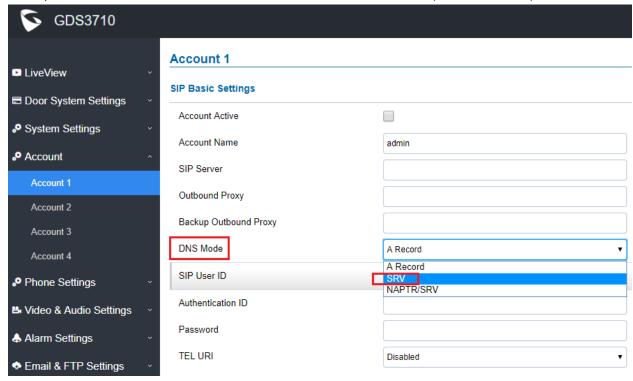

Functionality


This is a major feature enhancement for Service Provider, via DNS SRV, service providers can provider smooth service transition backup in case service down.



SUPPORT SPECIAL FEATURE - TELEFONICA

Web Configuration

This option can be found under device web UI \rightarrow Account \rightarrow Account X (X=1, 2, 3, and 4):

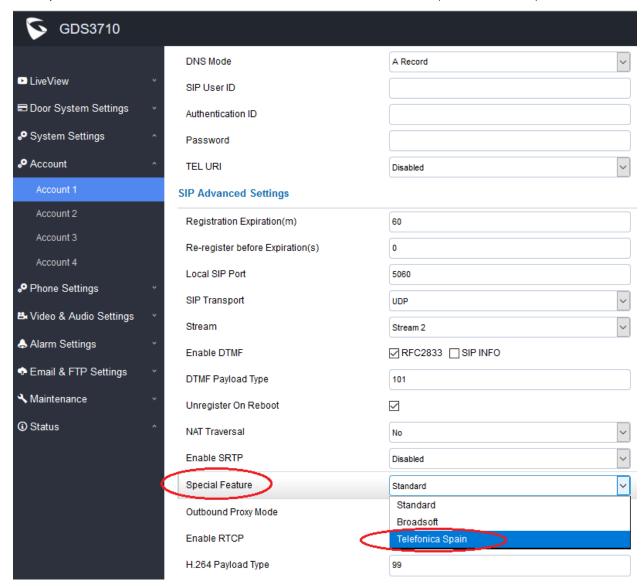

Functionality


This is a major feature enhancement for Service Provider. Special feature or Special Mode can be provisioned to match the Proxy of Service Provider like Telefonica, or Broadsoft. This is implemented for ITSP Service Provider. Normal customers just use "Standard" feature.



SEPARATE CREDENTIALS FOR GDSMANAGER

• Web Configuration

This option can be found under device web UI \rightarrow System Settings \rightarrow Access Settings:

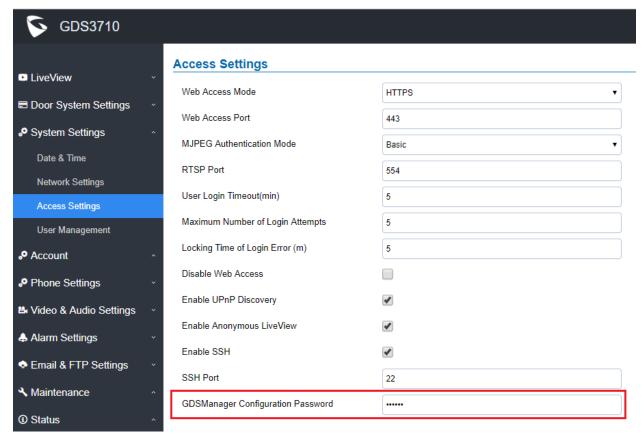


Functionality

This feature is implemented based on field customer feedback. Now separate credentials can be configured and used in GDSManager to communicate with GDS3710, instead of using GDS3710 webUI administrator's credentials. System administrators keep the admin password and use another password for GDSManager where usually operated by HR or other company staffs.



NOTE:

Make sure the correspondent password is configured in GDSManager like below:

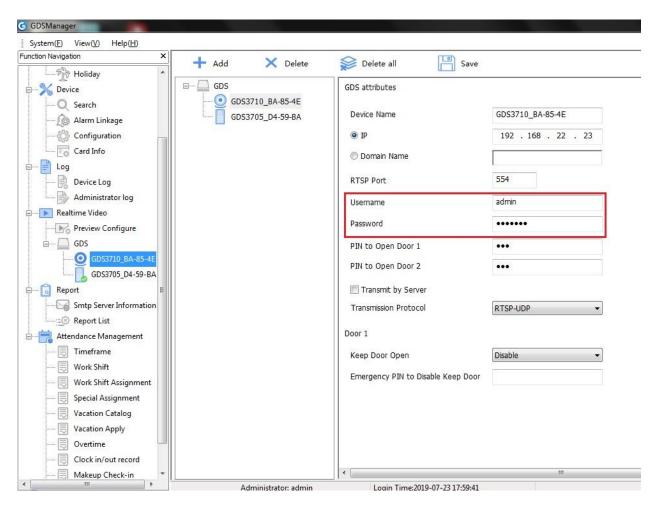


The password must match the password configured in the GDS3710 at above screenshot.
.



G.729 AND MULTIPLE AUDIO CODECS SIMULTANEOUSLY WITH PRIORITY

• Web Configuration

This option can be found under device web UI \rightarrow Account \rightarrow Account X (X=1, 2, 3, and 4):

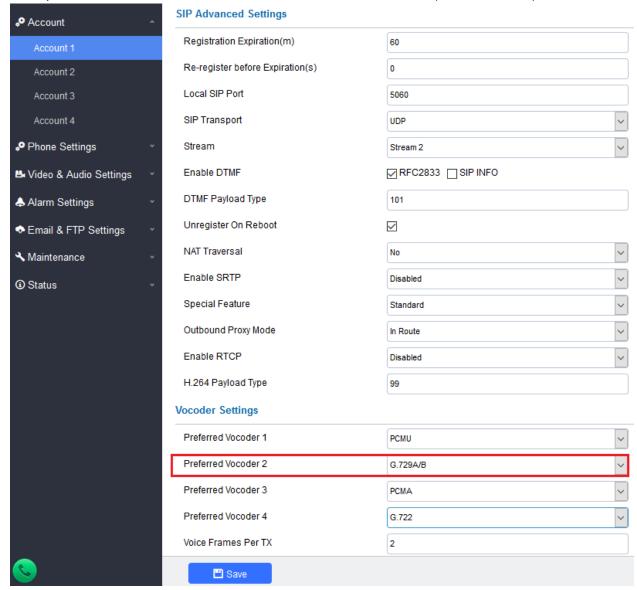

Functionality


This is an enhancement to allow ITSP Service Provider to use G.729 audio codec in their networks. Multiple audio codecs supported with specified priority be selected.



SCHEDULE FOR FIRMWARE UPGRADE AND PROVISIONING, DHCP OPTION 120

Web Configuration

This option can be found under device web UI \rightarrow Maintenance \rightarrow Upgrade:

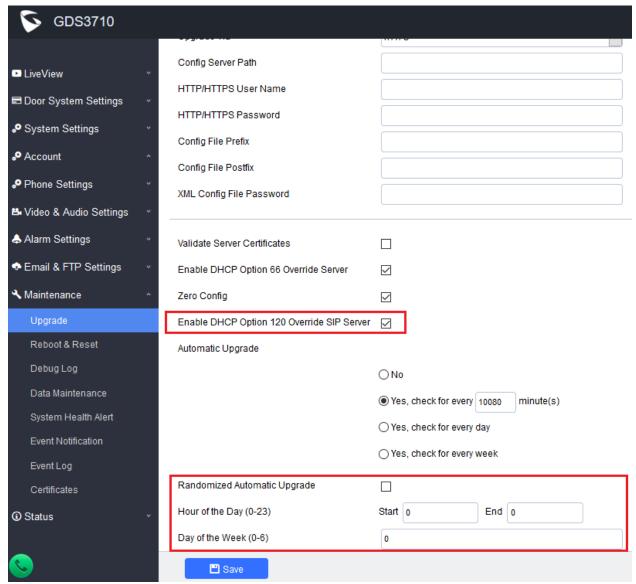

Functionality


This is an enhancement requested by ITSP service providers as well as lots of system integrators from Forum. This feature allows them to use DHCP Option 120 to override SIP Server; and let the GDS3710 either randomly check upgrade/provisioning server, or at configured schedule.



REREGISTER BEFORE EXPIRATION AND VOICE FRAME PER TX

Web Configuration

This option can be found under device web UI \rightarrow Account \times Account X (X=1, 2, 3, and 4):

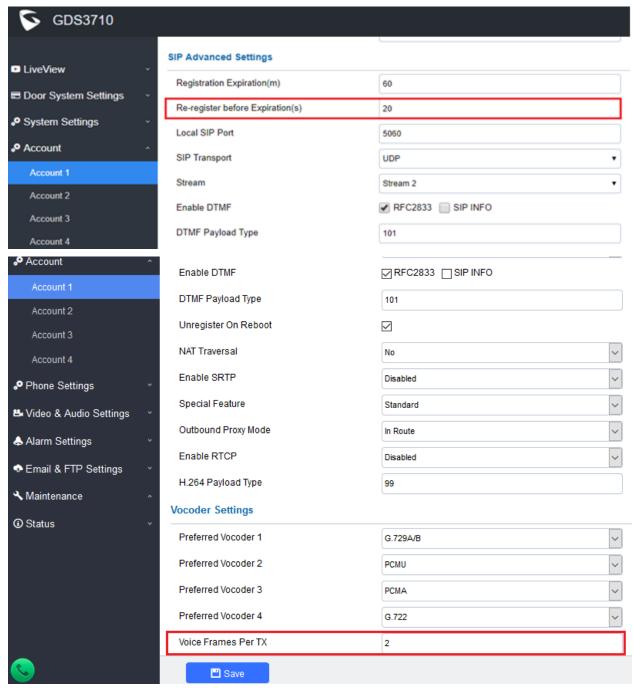

Functionality


These parameters are mostly used by ITSP Service Provider. Normal users please do not touch those parameters because that could cause audio issue if parameters are incorrect.



KEYPAD BLUE LIGHT ON/OFF ON SCHEDULE

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

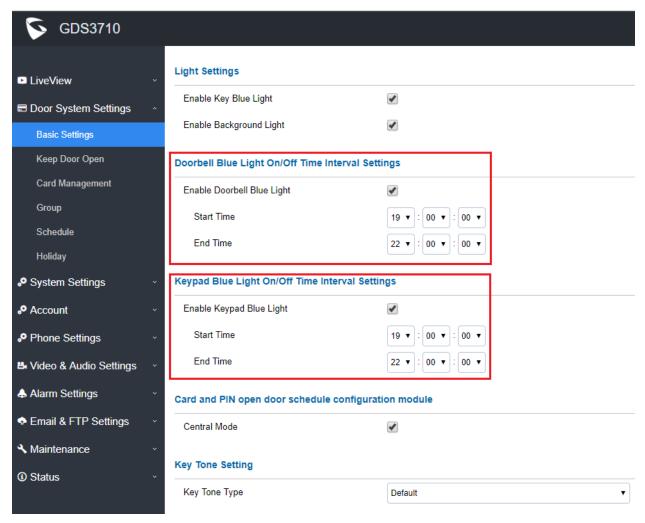

Functionality

This is an enhancement for an existing features based on customer feedback from field.


By configure the keypad blue light and/or doorbell blue light ON/OFF based on schedule, GDS3710 will provide users easy access and operation to keypad during night time when ambient environment is dark.



ADJUST SYTEM DEFAULT VOLUME TO LEVER 2

Web Configuration

This option can be found under device web UI → Video & Audio Settings → Audio Settings:

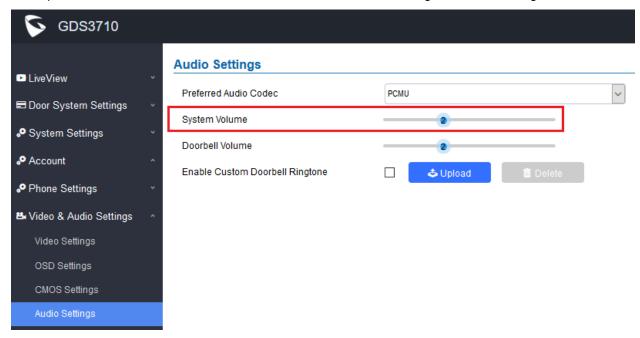

Functionality

This is an enhancement based on customer feedback from field.

The previous default value is 4, the new default value is 2. Factory reset the new value 2 will take place.


Customer can adjust this value based on field or installation environment to meet the requirement.



SUPPORT ANONYMOUSE RTSP LIVE VIEW

Web Configuration

This option can be found under device web UI → System Settings: → Access Settings:

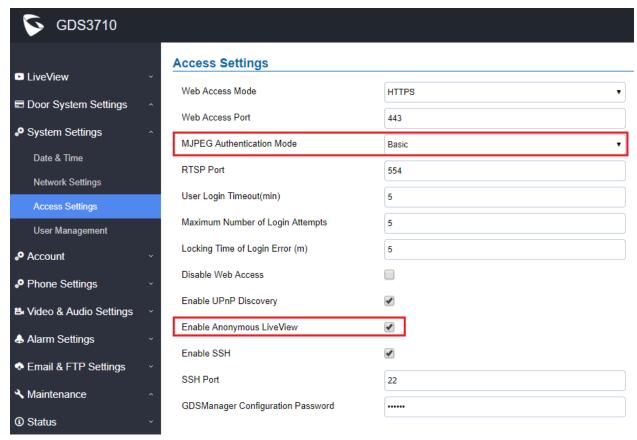

Functionality

This is a further enhancement for the already supported anonymous MJPEG LiveView streaming, request by customers like Service Provider and System Integrators or Installers. This feature allows system integrators to retrieve snapshots from GDS3710 directly without credentials, similar to fetch the live MJPEG streaming previously. This is good for system re-development.

When enabled this feature, **Special Access URL** required to retrieve the snapshot (frame by frame if refreshed) or live MJEPG video streaming:

HTTP(S)://IP_GDS3710:Port/anonymous/snapshot/view.jpg (Snapshot)


OR: HTTP(S)://IP_GDS3710:Port/anonymous/snapshot/view.html (Snapshot)

HTTP(S)://IP_GDS3710:Port/videoview.html (Live MJPEG streaming)



For customers using VLC MediaPlayer or similar software program, previous firmware still requiring credentials. Now the issue is fixed and customers can view the live video using VLC or other 3rd party RTSP retriever to do re-development.

Using VLC Media Player for example:

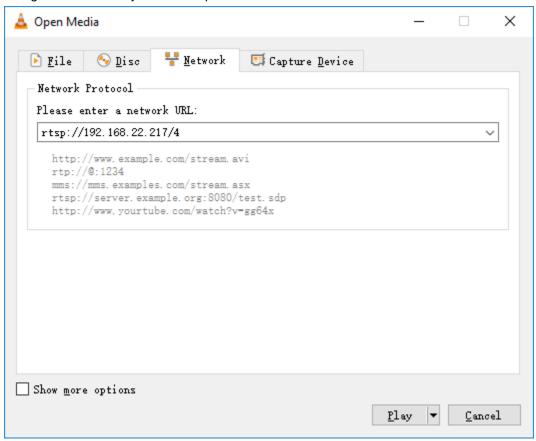

FORMET:

 $RTSP://IP_GDS3710:Port/X$ (X = 0, 4, 8 correspondent to Stream 1, 2, 3)

No credential is required in such implementation.

The live video and audio will play out with some delay based on the computer processing power and network conditions.

NOTE:

- Please make sure the environment is secure before enable this feature.
- Please reminder user the privacy when using this feature.



FIRMWARE VERSION 1.0.5.6

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

04/08/2019

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement since firmware 1.0.5.2. Main enhancement like added support for 4 SIP Accounts, DTMF payload, etc.

<u>Factory Reset is recommended</u> due to 4 SIP accounts added (to sort out all the internal registers and P value added). If upgrading from very old firmware, or experiencing abnormal webUI or missing parameters in the GUI, factory reset is mandatory. Please backup the configuration and data before factory reset and import back after reset.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.2A	YES	Only support HTTP upgrade image
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	



ENHANCEMENT

- Added support for 4 SIP accounts.
- Added option to configure DTMF Payload value.
- Added and optimized number handling algorithm to work with GXV3370 open two doors.
- Added prompt reminder if H.264 payload type conflict with RTP payload type.
- Added feature support to upload customized doorbell so user can upload own voice prompt or music.
- Added clear button to delete unwanted uploaded audio file for doorbell ringtone. Optimized the uploading of customized ringtone.
- Added prevention mechanism to avoid unwanted alarm pulse spikes triggering alarm event.
- Added ITSP requested feature: Configure Keep Door Open actions from GDSManager.
- Added ITSP requested feature: GDSManager will synchronize with GDS3710 when changing the settings of Keep Door Open.
- Added management feature: Send out System Health Alerts via Email.
- Added feature to set "Schedule" for "Local PIN to Open Door".
- Added support for Packetization Mode 0
- Added option to disable outbound proxy route header.
- Added feature support for CSV format when Import/Export data.
- Added feature support for Anonymous Snapshot.
- Enhanced security and limited the GDS3710 as Caller to open door via DTMF: Only numbers exist in Doorbell, Whitelist or RFID Card Management will be able to enter DTMF PIN to open door remotely.
- Added AlarmOut1 (COM1) to support "Normal Open" or "Normal Close" setting.
- Added Boot Version information into "Status" page.



BUG FIX

- Fixed pressing doorbell called SIP number using failed registration account.
- Fixed after factory reset if the first account is empty, parallel hunting in IP peering call would fail.
- Fixed alarm email failure when non-scheduled access alarm triggered.
- Fixed Emergency PIN to Disable Keep Door Open failed to be saved if Door1 and Door2 save together.
- Fixed "Allow Reset via SIP Notify" option showed "Disable" even configured "Enable".
- Fixed "Emergency PIN to Disable Keep Door Open" in GDS3710 will not be synchronized with GDSManager.
- Fixed Wiegand Output mode when choosing "Relay and Local Authentication" the output signal is distorted and failed to work with 3rd party Door Controller.
- Fixed security issue where ALMOUT1 port with spike pulse could cause some model of strikes to open door during device reboot or restore lost power.
- Fixed Data imported might be partially failure sometimes.
- Fixed System Health Alert email will not send out if email title is empty.
- Fixed "Save" button will be unavailable if pressing "Test" button first in the "Event Notification" page.
- Fixed if HTTP port changed (not default port 80) Google Chrome will not play Live Video.
- Fixed uploading custom doorbell ringtone would uncheck the related choice box in UI automatically.
- Fixed device would reboot after receiving from UCM the zero configuration command to change the configuration file path.
- Fixed ALMOUT1 status would change from Normal Close to Normal Open after rebooting.
- Fixed device would not play default doorbell ringtone if enable "Custom Doorbell Ringtone Upload" without actually uploading any working audio file as ringtone.
- Fixed configure Door1 and Door2 remote PIN at the same time the Alarm_Out (COM1) port will not
 operate correctly.
- Fixed issue Wiegand Input to Open Door not consistent when using Guest PIN, Private PIN or Card and Private PIN.
- Fixed snapshots sending via email or uploaded to FTP not consistent with number configured.
- Fixed SIP account will off line after importing the P value.
- Fixed issue the keypad and card scanner will randomly stall and not response for a while (reported by ITSP customers).
- Fixed after Zero Config provisioning requires manually reboot to take effect.
- Fixed device will not start upgrading process when unchecked "Automatic Upgrade" option.
- Fixed the default value inconsistent between device and the imported file, as well as partial data failure for imported file.
- Fixed without confliction reminding prompt when configure local SIP port and local RTP port to be same value (which is not allowed).
- Fixed Zero Config not enabled by default in firmware 1.0.5.2
- Fixed "Automatic Upgrade" fail to happen at configured time window.
- Fixed DI as "Open Door" the "Digit Input 1 Status" and "Select Alarm Schedule" should be greyed out.
- Fixed Privacy Mask incorrectly editing operation would crash the browser.
- Fixed DI feature would fail or be blocked if without network connection.



- Fixed external alarm/doorbell device connected to COM1 only act once when configured Doorbell Mode as "Doorbell Output Control (Digital Output) 1" or "Both Above". The duration now is the same as "Alarm Output Duration(s)" of "Digit Output" in "Alarm Settings".
- Fixed only Account 1 can answer peered IP Call normally while this feature should work via port used.
- Fixed the "Reboot" event not reported in the "System Health Alert".
- Fixed "LiveView" not working stably with latest Chrome (version 71.0.3578.98)
- Fixed Email Test returning Error but actual email working good due to the testing function not supporting special characters inside the email password.
- Fixed HTTP security issue in "Anonymous LiveView" (trace will show user information).

KNOWN ISSUES

- INVITE to an ICMP address, the doorbell still rings as normal.
- The panel lights might off during the call sometimes.
- Remote device can hear custom doorbell ringtone about 1~2 seconds when answering the call.
- GDS3710 as Callee will not do stream negotiation.
- When SIP account is logged out, pressing the keyboard is abnormal.
- When SIP transport mode is TLS/TCP, remote door opening might fail occasionally.



NEW P-VALUE

INE VV I - V.	ALOL
P78	Phone_Settings.User_Random_Port
P79	Account_1 DTMF Payload
P496	Account_2 DTMF Payload
P596	Account_3 DTMF Payload
P696	Account_4 DTMF Payload
P10470	Basic_Settings.Doorbell_Call_Out Account
P10471	Basic_Settings.Alarm_Call_Out_Account
P15498	Basic_Settings.Local_PIN_to_Open_Door_Schedule
P15490	System_Health_Alert.Enable_System_Health_Alert
P15491	System_Health_Alert.Delivery_Method
P15492	System_Health_Alert.Alert_Interval
P15493	System_Health_Alert.SIP_Registration_Status
P15494	System_Health_Alert.System_Reboot
P15495	System_Health_Alert.System_Temperature
P15496	System_Health_Alert.Email_Title
P957	Phone_Settings.SIP_Packetization_Compatible Mode
P271	Account.Account_1.Account_Active
P3	Account.Account_1.Account_Name
P32	Account.Account_1.Registration_Expiration(m)
P34	Account.Account_1.Password
P35	Account.Account_1.SIP_User_ID
P36	Account.Account_1.Authentication_ID
P40	Account.Account_1.Local_SIP_Port
P47	Account.Account_1.SIP_Server
P48	Account.Account_1.Outbound_Proxy
P52	Account.Account_1.NAT_Traversal
P63	Account.Account_1.TEL_URI
P81	Account.Account_1.Unregister_On_Reboot
P100	Account.Account_1.Special_Feature
P103	Account.Account_1.DNS_Mode
P130	Account.Account_1.SIP_Transport
P183	Account.Account_1.Enable_SRTP
P293	Account.Account_1.H.264_Payload_Type



P490	Account.Account_1.Enable_Keep_Alive
P2302	Account.Account_1.Enable_DTMF_RFC2833
P2303	Account.Account_1.Enable_DTMF_SIP-INFO
P2305	Account.Account_1.Outbound_Proxy_Mode
P2333	Account.Account_1.Backup_Outbound_Proxy
P2492	Account.Account_1.Enable_RTCP
P15480	Account.Account_1.Stream
P501	Account.Account_3.Account_Active
P502	Account.Account_3.SIP_Server
P503	Account.Account_3.Outbound_Proxy
P504	Account.Account_3.SIP_User_ID
P505	Account.Account_3.Authentication_ID
P506	Account.Account_3.Password
P507	Account.Account_3.Account_Name
P508	Account.Account_3.DNS_Mode
P509	Account.Account_3.TEL_URI
P511	Account.Account_3.Unregister_On_Reboot
P512	Account.Account_3.Registration_Expiration (m)
P513	Account.Account_3.Local_SIP_Port
P514	Account.Account_3.NAT_Traversal
P524	Account.Account_3.Special_Feature
P543	Account.Account_3.Enable_SRTP
P548	Account.Account_3.SIP_Transport
P562	Account.Account_3.H.264_Payload_Type
P590	Account.Account_3.Enable_Keep_Alive
P2502	Account.Account_3.Enable_DTMF_RFC2833
P2503	Account.Account_3.Enable_DTMF_SIP-INFO
P2505	Account.Account_3.Outbound_Proxy_Mode
P2533	Account.Account_3.Backup_Outbound_Proxy
P2592	Account.Account_3.Enable_RTCP
P15481	Account.Account_3.Stream
P601	Account_Account_Active
P602	Account.Account_4.SIP_Server
P603	Account.Account_4.Outbound_Proxy



P604	Account_Account_4.SIP_User_ID
P605	Account_Account_4.Authentication_ID
P606	Account_Account_4.Password
P607	Account_Account_A.Account_Name
P608	Account_Account_4.DNS_Mode
P609	Account.Account_4.TEL_URI
P611	Account.Account_4.Unregister_On_Reboot
P612	Account.Account_4.Registration_Expiration (m)
P613	Account.Account_4.Local_SIP_Port
P614	Account.Account_4.NAT_Traversal
P624	Account.Account_4.Special_Feature
P643	Account_Account_4.Enable_SRTP
P648	Account_Account_4.SIP_Transport
P662	Account.Account_4.H.264_Payload_Type
P690	Account_Account_4.Enable_Keep_Alive
P2602	Account.Account_4.Enable_DTMF_RFC2833
P2603	Account_Account_4.Enable_DTMF_SIP-INFO
P2605	Account_Account_4.Outbound_Proxy_Mode
P2633	Account.Account_4.Backup_Outbound_Proxy
P2692	Account_Account_4.Enable_RTCP
P15482	Account.Account_4.Stream

MODIFIED P-VALUE

• Upgrade Zero_Config Default Value 0 → 1

NEW HTTP API

N/A

Released HTTP API documentation can be downloaded from here:

http://www.grandstream.com/sites/default/files/Resources/gds37xx_http_api.pdf




NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

SUPPORT 4 SIP ACCOUNTS

• Web Configuration

This option can be found under device web UI \rightarrow Account \rightarrow Account X (X=1, 2, 3, and 4):

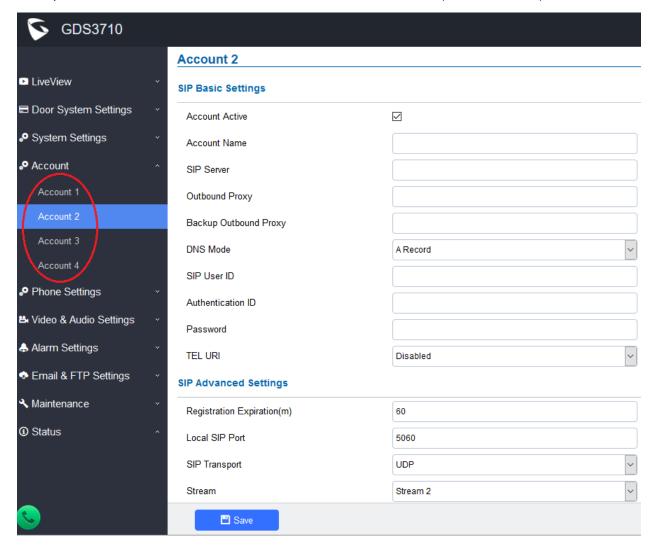

Functionality


This is a major feature enhancement. Now GDS3710 can be registered to up to 4 different SIP Proxy or IPPBX to make calls and open doors.

Both "SIP Basic Settings" and "SIP Advanced Settings" are now located in the same UI page. See the above webUI screenshot for reference.



This feature is good for a building leased to different companies with own IPPBX but only one entrance or door. Now the doorbell can be programed to call different extensions of different IPPBX to allow guests or visitors to get into the building by different companies.

The number belongs to which SIP Proxy or IPPBX can be selected in the "Call Out Account" setting under "Card Management" page. Also which door the Card/PIN can be granted access also configured here. SIP number or the Virtual Number can be assigned here either. Please refer to below screenshot:

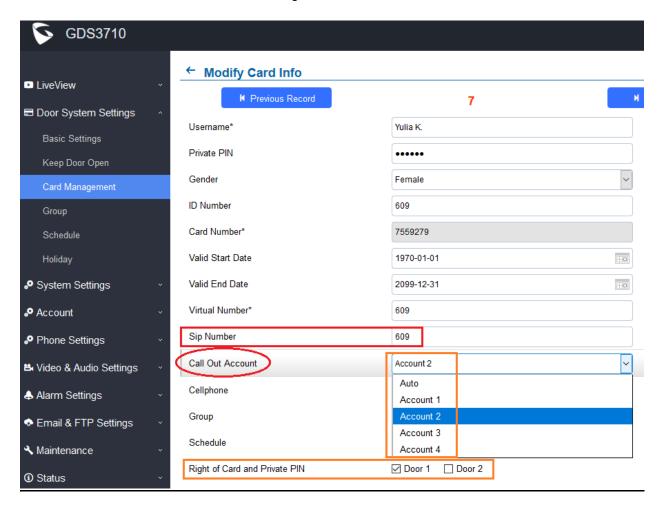


For special situation where no RFID card is assigned, system administrators can manually create a fake non-duplicable random number as "Card Number" (this is the database index, cannot be empty) but associate it with created PIN or SIP number or Virtual Number, as well as the Schedule or Group to control the door access privilege. Like for example, create these for guests, temporary or seasonal employees, cleaning ladies, contractors or UPS/FedEx person or postman.



CONFIGURE H.264, DTMF PAYLOAD AND PROXY ROUTE VALUE

• Web Configuration

This option can be found under device web UI \rightarrow Account \rightarrow Access X \rightarrow SIP Advanced Settings:

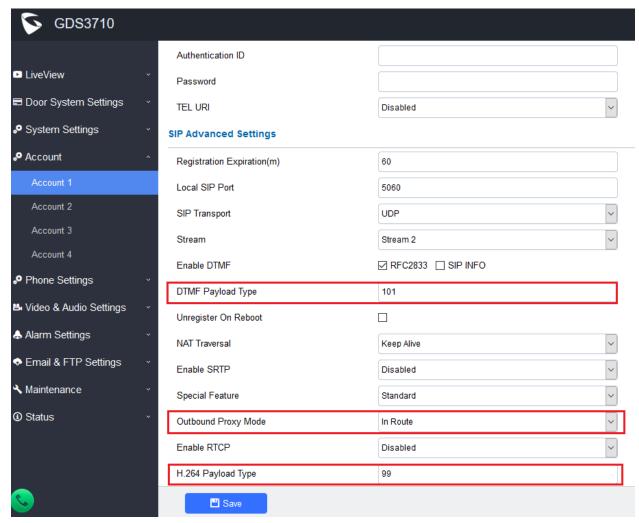

Functionality

These parameters are designed for more compatibility with 3rd parties SIP Proxy or IPPBX and good for ITSP service providers as well as System Integrators. The parameters can be adjusted by just fill in the corrected value.

NOTE:


- Make sure correct value are filled in. Otherwise DTMF open door will fail, there will be no video and sometimes the call will just fail to establish.
- If don't know the meaning of the value adjusted, please just use the default value.



ADD OR DELETE CUSTOMIZED DOORBELL TONE

Web Configuration


This option can be found under device web UI → Video & Audio Settings:

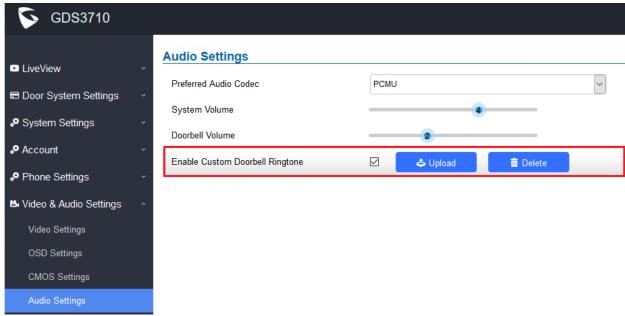

Functionality

This is an enhancement to allow user to upload own customized doorbell tones to meet the application scene requirement.

Please strictly follow below file requirement to upload working files:

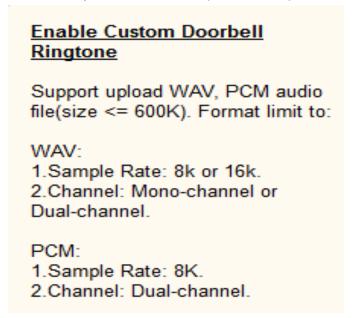




SYSTEM HEALTH ALERTS VIA EMAIL

Web Configuration

This option can be found under device web UI → Maintenance → System Health Alert:

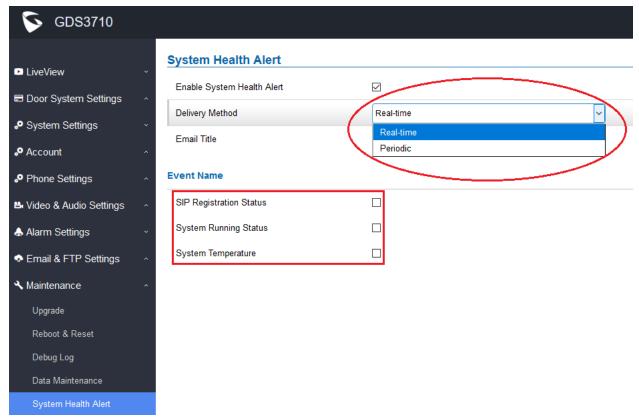

Functionality

This is an enhancement requested by ITSP service providers as well as lots of system integrators from Forum. This feature allows them to get updated System Health Alert via email either in real time or in a period of time when configured.


The events name can be selected during the configuration. For all this to be working, the SMTP has to be configured and proof working otherwise email not working all in vain.



SET SCHEDULE FOR LOCAL PIN TO OPEN DOOR

Web Configuration


This option can be found under device web UI → Door System Settings → Basic Settings:

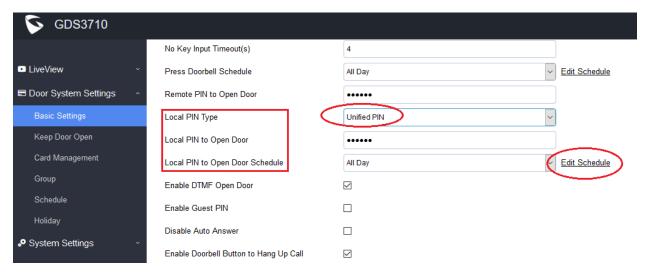

Functionality

This is an enhancement for an existing features after feedbacks from customers. Currently, using Private PIN or RFID card, user can configure schedule in the "Card Management" database to control the time door can be accessed. But there is no schedule in the "Unified PIN".

With this enhancement, users can now configure the "Schedule" to the "Unified PIN" so that the universal PIN also can be controlled by the Schedule therefore control the door access accordingly in the preconfigured time schedule.

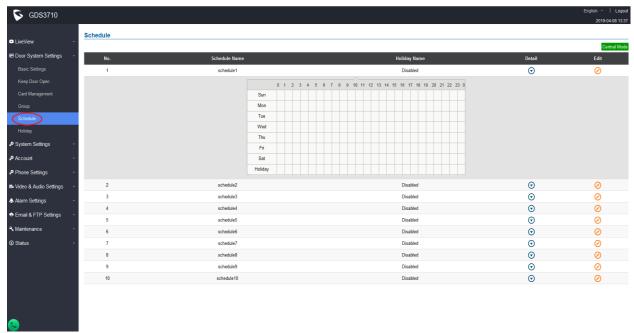




SUPPORT PACKKETIZATION MODE 0

Web Configuration

This option can be found under device web UI → Phone Settings:

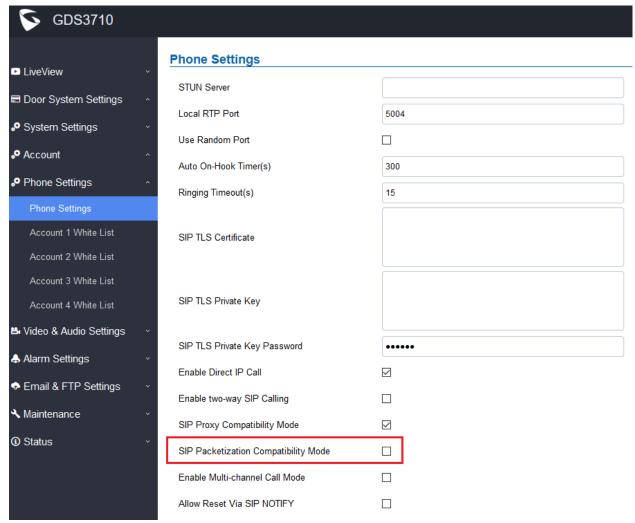

Functionality

This is an enhancement for an existing features to be more compatible with 3rd party video phone devices like Cisco and Polycom.


This setting if enabled will allow GDS3710 using "Packetization Mode 0" to interact with legacy video products from Cisco or Polycom. The video from GDS3710 will be displayed in those 3rd party device.



SUPPORT CSV FORMAT WHEN IMPORT/EXPORT CARD DATA FILE

Web Configuration

This option can be found under device web UI → Door System Settings → Card Management:

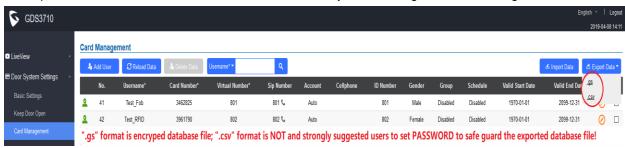

Functionality

This is an enhancement for an existing features after feedbacks from customers.

This setting allows user to import and export the Card Management Database using ".csv" format, in addition to the default encrypted ".gs" format. This will help system administrators using popular Excel to edit and revise the Card Information, then important back to the system in a batch mode.

NOTE:


- ".gs" format is encrypted database file, it can NOT be edited and the password or PIN inside also can NOT be viewed.
- ".csv" format is NOT encrypted therefore all the content are viewable and editable. System
 Administrator should be VERY careful when export database in such file format, as convenience is
 provided in the cost of security.
- It is **STRONLY** suggested system administrator to set PASSWORD to Safe Guard the exported CSV format database file when edit or revise the file using Excel.



SUPPORT ANONYMOUSE SNAPSHOT

Web Configuration

This option can be found under device web UI → System Settings → Access Settings:

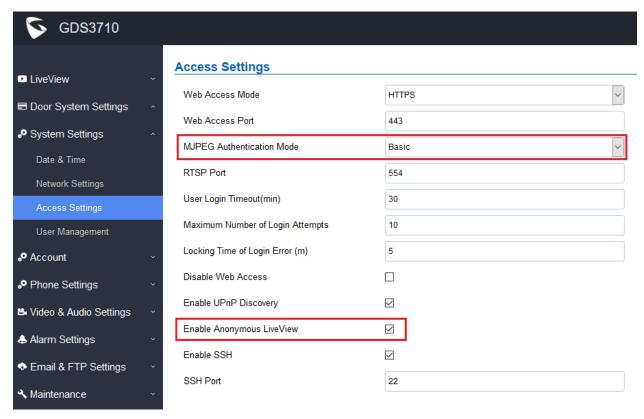

Functionality

This is a further enhancement for the already supported anonymous MJPEG LiveView streaming, request by customers like Service Provider and System Integrators or Installers. This feature allows system integrators to retrieve snapshots from GDS3710 directly without credentials, similar to fetch the live MJPEG streaming previously. This is good for system re-development.

When enabled this feature, **Special Access URL** required to retrieve the snapshot (frame by frame if refreshed) or live MJEPG video streaming:

HTTP(S)://IP_GDS3710:Port/anonymous/snapshot/view.jpg (Snapshot)
OR: HTTP(S)://IP_GDS3710:Port/anonymous/snapshot/view.html (Snapshot)

HTTP(S)://IP_GDS3710:Port/videoview.html (Live MJPEG streaming)

NOTE:


- Please make sure the environment is secure before enable this feature.
- Please reminder user the privacy when using this feature.



NORMAL OPEN/CLOSE IN ALARM_OUT1 (COM1) OPEN DOOR CONTROL

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

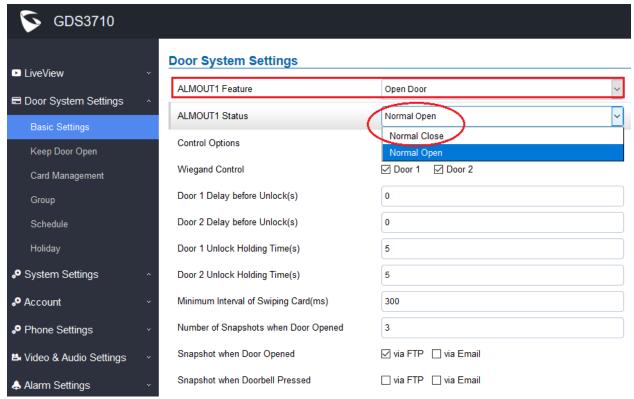

Functionality

This is an enhancement for an existing features after feedbacks from customers.

When re-using **ALMOUT1 (COM1)** interface to "Open Door" (controlling **DOOR2**) instead of "Alarm Output" (this is mutual exclusive, ONLY one choice will work), customers can choose "Normal Open" or "Normal Close" based on the electrical locker or striker used.


Please choose correctly based on the electrical locker or striker installed to avoid wrong operation.



ADDED BOOT VERSION IN "STATUS" PAGE

Web Configuration

This option can be found under device web UI → Status → System Info:

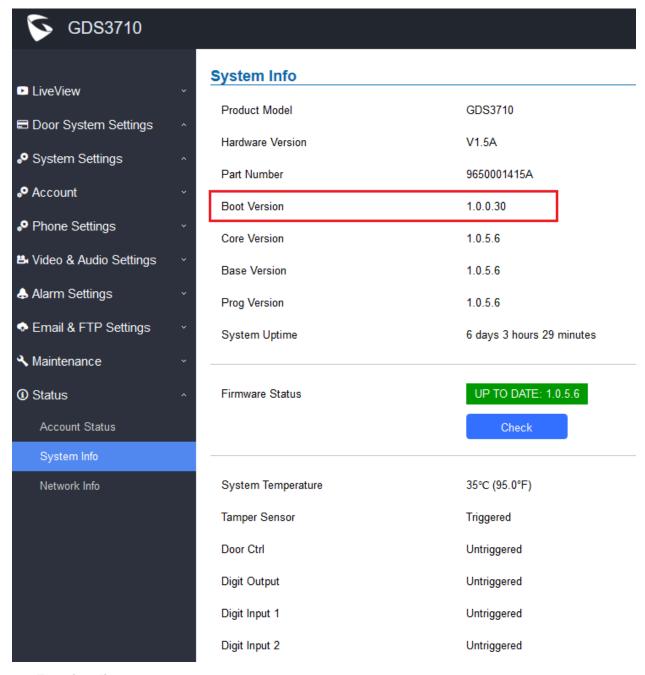

Functionality

This is an enhancement to display more technical information of GDS3710 in the "Status" page to help supporting users or customers when doing troubleshooting.



FIRMWARE VERSION 1.0.5.2

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

12/26/2018

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement since firmware 1.0.4.9. Added lots of features and bug fixes. This firmware can NOT be downgraded to below 1.0.4.9.

Factory Reset is recommended if upgrading from very old firmware, or experiencing abnormal webUI or missing parameters in the GUI. Please backup the configuration and data before factory reset and import back after reset.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	



ENHANCEMENT

- Added Alarm_Out port (COM1 interface) be used as Open Door 2. This mutual-exclusive function
 allows this port to be either as additional Open Door interface (together with COM2 interface now
 GDS3710 can control two doors) or normal Alarm_Out interface for 3rd party device. The two doors can
 be controlled by RFID, local and remote PINs respectively. This is a major enhancement, please refer
 User Manual for more details and how to use.
- Added option to Enable/Disable WebUI access.
- Added option to define number of snapshots to be uploaded when opening door
- · Added option to specify digital input to be normal Open or normal Close
- Added ability to set schedule for Alarm In door opening
- Added support for using Digit Only as Private PIN
- Added option to configure "No Key Entry Timeout"
- · Added ability to email snapshot when door opened
- Added option to allow anonymous viewing
- Added ability to display Motion Detection Region Configuration via popular browsers (Firefox, Chrome) without installing plugin, same as LiveView.
- Added option to configure payload type for H.264 (default value 99, adjusted to be more compatible)
- Extended VLAN tag range from 0 ~ 255 to 0 ~4094
- · Added option to use Emergency PIN to overwrite "Keep Door Open" schedule and lockdown
- Enhanced debug logs and tagged with product model, MAC address
- Enhanced syslog messages by removing unnecessary details from the logs
- Added check and upgrade firmware feature in the "Status → System Info → Firmware Status" page
- Added ability to configure device with custom certificate signed by custom CA certificate
- Added device temperature to be displayed in Fahrenheit as well as Celsius
- Added support for special character "@" in the SIP User ID
- Added support of strong password including special characters for the GDS3710
- Added support of SIP NOTIFY to factory reset
- Added event log showing who opened the door using private PIN
- Added CONFIG for firmware and configure server path and type via SSH.
- Added PING function in the CLI interface SSH.



BUG FIX

- Fixed keypad no response issue.
- Fixed One Key Open Door feature failed in preview (early media) mode via parallel hunting
- Fixed IP peering call will fail if outbound proxy configured
- Fixed the open door delay when using DTMF method
- Fixed any key press will turn off the door bell blue light when "enable doorbell blue light" configured
- Fixed randomly no audio issue on GDS3710 side
- Fixed video from GDS3710 frozen when hold/unhold twice by the video phone
- Fixed cannot set time zone 'P64' value via provisioning when DST 'P10004' enabled
- Fixed SIP password visible in the webUI
- Fixed incorrect warning message in event log
- Fixed STUN will not resolve when FQDN configured as STUN server
- · Fixed pressing doorbell button would hang up the alarm call
- · Fixed doorbell 'Ding Dong' sound non-stop if SIP account unregistered
- Fixed keypad no response issue
- Fixed security vulnerability to compromise root access via SSH
- Fixed GDS3710 ringback tone stops after 15 seconds when calling with GXV3370
- Fixed only the 1st extension or IP will be called if clicking the phone icon at webUI of "Basic Settings"
 → "Number Called When Door Bell Pressed" field
- Fixed GDS3710 falling into reboot cycle when provisioning with Broadsoft platform
- Fixed syslog with wrong timestamp issue
- Fixed failure to import/export setting of "Enable Anonymous LiveView"
- Fixed webUI access in some situation appearing close_wait issue
- Fixed error prompt when click retrieve lost/forgot password at logon home page
- Fixed GDS3710 always send H.264 RTP with lever 3.0 not adjust to 2000K SDP negotiation
- Fixed device during firmware upgrade keep on request for upgrade therefor into reboot loop
- Fixed alarm no sound when doorbell set volume level 0 and system set volume lever 6



KNOWN ISSUES

- LiveView page, the page may crash if click the "Local Configuration Function"
- INVITE to an ICMP address, the doorbell still rings as normal.
- The panel lights might off during the call.
- Doorbell pressed when multiple extensions configured in parallel hunting open door, if no answer and the call over time, the last call channel mapped LED indicator won't light off until manual intervene
- Open Door and Alarm snapshots, the file names are inconsistent when using Email, FTP, Central Storage, they should be synchronized.



NEW P-VALUE

P-Value	Values	Default Value	Comments
P8475	Type : string	NULL	Custom Certificate
	MAX length = 4096		
P15476	0: Disable	0	Enable / Disable Reset via
	1: Enable		SIP NOTIFY

P15450	0: Alarm Output 1: Open Door		
P15470	0: Normal Close 1: Normal Open		
P15467	0: Door 1 1: Door 2 2: Door 1 & Door 2 3: None		
P15468	0: Door 1 1: Door 2 2: Door 1 & Door 2 3: None		
P15465	0 20		
P15466	1 20		
P15436	0 60		
P15474	0 – 20 and no more than 'Unlock Action Holding Time' value		
P15475	0 – 20 and no more than 'Door 2 Unlock Action Holding Time' value		
P14103	0: No 1: Yes		
P15471	0: No 1: Yes		
P15460	Max. length = 8		
P15435	Max. length = 8		
P15455	0: Disable 1: Immediate Open Door 2: Schedule Open Door		
P15472	Max. length = 8		
P15456	5 - 480		
P15457			
P15458			
P15459			
P15473	0: Disable 1: Enable		
P15469	0: Disable 1: Enable		
P462	96-127		
P15451	0: Door 1 1: Door 2 2: Door 1 & Door 2 3: None		
P15431	0: Normal Open 1: Normal Close		
P15452	0: Door 1 1: Door 2 2: Door 1 & Door 2 3: None		
P15432	0: Normal Open 1: Normal Close		



NEW HTTP API

P15476	GET:[http https]:// <servername>/goform/config?cmd=get&type=sip SET:[http https]://<servername>/goform/config?cmd=set&P15476=<val ue></val </servername></servername>	0: Disable 1: Enable
P8475	GET: http://ip:port/goform/config?cmd=get&type=trustedca SET: http://ip:port/goform/config?cmd=set&P8475= <value></value>	Value=string, MAX length=4096
Check / Upgrade	SET: https://ip:port/goform/config?cmd=fw_upgrade&type= <value></value>	check available firmware version firmware upgrade
P15450	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15450=<value></value></servername></servername>	0: Alarm Output 1: Open Door
P15470	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15470=<value></value></servername></servername>	0: Normal Close 1: Normal Open
P15467	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15467=<value></value></servername></servername>	0: Door1
P15468	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15468=<value></value></servername></servername>	0: Door1
P15465	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15465=<value></value></servername></servername>	0 ~ 20
P15466	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15466=<value></value></servername></servername>	1 ~ 20
P15436	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15436=<value></value></servername></servername>	0 ~ 60
P15474	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15474=<value></value></servername></servername>	0 ~ 20; No more than the value of "Unlock Action Holding Time"
P15475	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15475=<value></value></servername></servername>	0 ~ 20; No more than the value of "Door2 Unlock Action Holding Time"
P14103	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P14103=<value></value></servername></servername>	0: No 1: Yes
P15471	GET: http:// <servername>/goform/config?cmd=get&type=door SET: http://<servername>/goform/config?cmd=set&P15471=<value></value></servername></servername>	0: No 1: Yes
P15460	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d oor SET: http://<servername>/goform/config?cmd=set&P15460=<value></value></servername></servername>	Max. length = 8



P15435	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d</servername>	Max. length = 8	
	SET: http:// <servername>/goform/config?cmd=set&P15435=<value></value></servername>	a.n. iong	
	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d</servername>	0: Disable	
P15455	oor	1: Immediate Open Door	
	SET: http:// <servername>/goform/config?cmd=set&P15455=<value></value></servername>	2: Schedule Open Door	
	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d</servername>		
P15472	oor	Max. length = 8	
	SET: http:// <servername>/goform/config?cmd=set&P15472=<value></value></servername>		
	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d</servername>		
P15456	oor	5 ~ 480	
	SET: http:// <servername>/goform/config?cmd=set&P15456=<value></value></servername>		
	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d</servername>		
P15457	oor		
	SET: http:// <servername>/goform/config?cmd=set&P15457=<value></value></servername>		
	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d</servername>		
P15458	oor		
	SET: http:// <servername>/goform/config?cmd=set&P15458=<value></value></servername>		
	GET: http:// <servername>/goform/config?cmd=get&type=sch_open_d</servername>		
P15459	oor		
	SET: http:// <servername>/goform/config?cmd=set&P15459=<value></value></servername>		
P15473	GET: http:// <servername>/goform/config?cmd=get&type=access</servername>	0: Disable 1: Enable	
	SET: http:// <servername>/goform/config?cmd=set&P15473=<value></value></servername>	o. Bloade 1. Eliable	
P15469	GET: http:// <servername>/goform/config?cmd=get&type=access</servername>	0: Disable 1: Enable	
1 13409	SET: http:// <servername>/goform/config?cmd=set&P15469=<value></value></servername>	0. Disable 1. Lilable	
P462	GET: http:// <servername>/goform/config?cmd=get&type=sip</servername>	96-127	
1 402	SET: http:// <servername>/goform/config?cmd=set&P462=<value></value></servername>		
D45454	GET: http:// <servername>/goform/config?cmd=get&type=event</servername>	0: Door1 1: Door2	
P15451	SET: http:// <servername>/goform/config?cmd=set&P15451=<value></value></servername>	2: Door1 & Door2 3: None	
P15431	GET: http:// <servername>/goform/config?cmd=get&type=event</servername>	0: Normal Open	
	SET: http:// <servername>/goform/config?cmd=set&P15431=<value></value></servername>	1: Normal Close	
D15450	GET: http:// <servername>/goform/config?cmd=get&type=event</servername>	0: Door1 1: Door2	
P15452	SET: http:// <servername>/goform/config?cmd=set&P15452=<value></value></servername>	2: Door1 & Door2 3: None	
P15432	GET: http:// <servername>/goform/config?cmd=get&type=event</servername>	0: Normal Open	
	SET: http:// <servername>/goform/config?cmd=set&P15432=<value></value></servername>	1: Normal Close	
·	1	ı	

Released HTTP API documentation can be downloaded from here:

http://www.grandstream.com/sites/default/files/Resources/gds37xx_http_api.pdf




NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

CONTROL DOOR2 VIA ALARM_OUT (COM1) INTERFACE

• Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

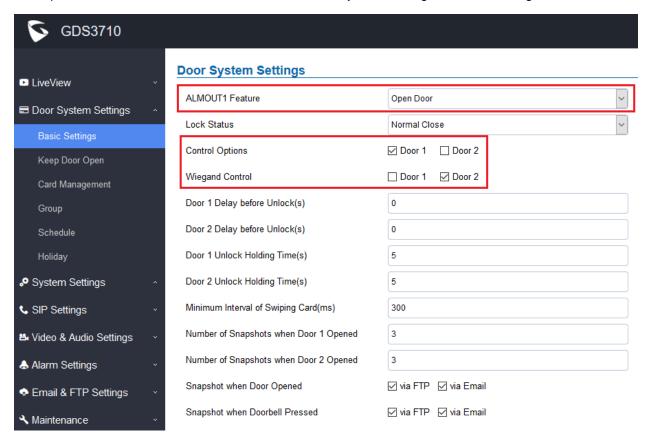

Functionality

This is a major feature enhancement, by re-use Alarm_Out (COM1) interface to be either support per designed normal alarm out with 3rd party device, or control Door2 operation (the two functions are mutual-exclusive).


Customers can now use this Alarm_Out (COM1) interface to control Door2, in additional to the existing Locker/COM2 interface (controlling Door1). This feature when selected, will enable GDS3710 to control the operation of two doors via RFID, local and remote PINs.

For example, a 3rd party Wiegand Input device or GDS37xx can be installed at Door2 with related cable wired into the control GDS3710 installed at Door1. The Door1 and Door2 can be configured to be open by programmed RFID cards, PINs either separately or both.



NOTE:

Interface for Door Control (Which Door can be OPEN):

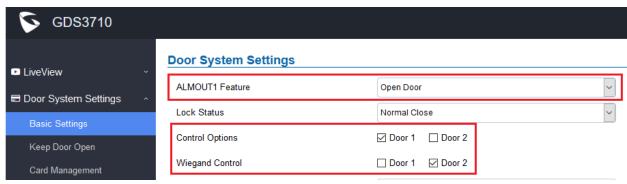


If Alarm_Out (COM1) interface is set to control Door2 opening, "Lock Status" can be configured by choose "Normal Open" or "Normal Close" based on the strike used.

Unlike default COM2 which is designed for strike control and having three connecting sockets, the COM1 only has two connecting sockets. Therefore correct lock mode has to be configured to make the strike working as expected.

For above example, the GDS3710 is configured to control Door1 (wiring to COM2 interface); the 3rd party Wiegand Input is set to control Door2 (wiring to COM1 interface).

• Universal PIN for Operation of Doors:

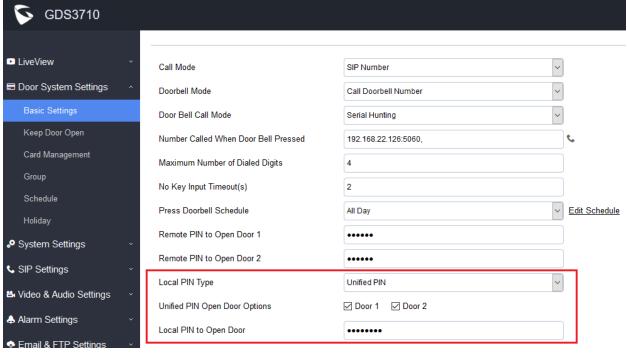


If Unified PIN (Universal PIN) is configured to open door, then which door can be controlled by the PIN is configured in the UI once "Unified PIN" selected.



For example, like above screenshot, if this universal PIN is set to open both Door1 and Door2, but due to previous "Control Option" set to open Door1, and "Wiegand Control" set to open Door2, therefore the final result will be the **INTERSECT** result of both sets with condition qualified.

In above case, The PIN will only work at GDS3710 (Door1) and Wiegand Device (Door2) local input respectively. Meaning input PIN at GDS3710 will only open Door1 and will NOT open Door2.

• Remote PIN to Operation of Doors:

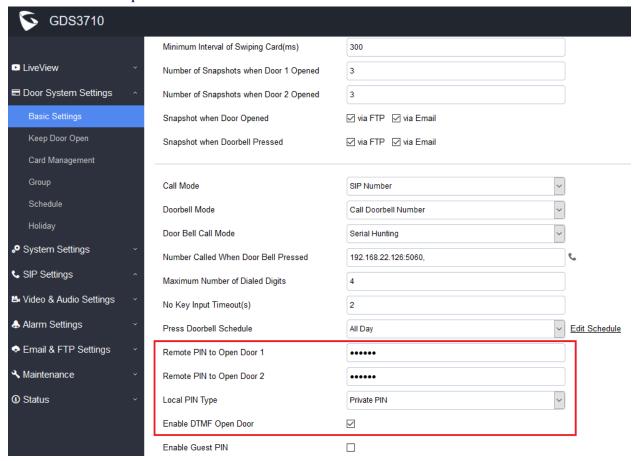


For remote PIN to open door, the PIN can be configured in above setting.

The PIN can be different for Doo1 and Door2 and has to be configured correctly in related IP Phone which will be used to operate "One Key Open Door".

If BOTH doors need to be opened at the same time, then both Door1 and Doo2 has to be configured with exactly SAME password or PIN as DTMP open door.



• Private PIN or Card & Private PIN:

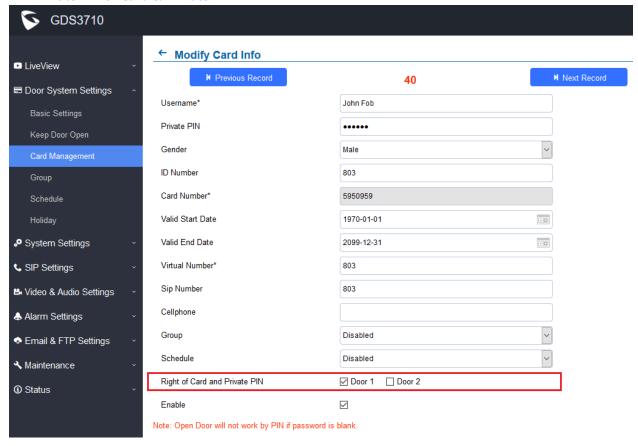

If using RFID card or Private PIN to open door, then which door can be opened by the RFID card or Private PIN is configured via "Card Management", see above screenshot.

NOTE:


- For all the setting, the final result of which door can be opened is the <u>LOGIC INTERSECT</u> <u>OPERATION</u> of ALL the sets of condition qualified.
- Please refer to <u>GDS3710 User Manual</u> for details about how to configure and control the Door1 and Door2 operation respectively.



ENABLE / DISABLE WEB UI ACCESS

Web Configuration

This option can be found under device web UI → System Settings:

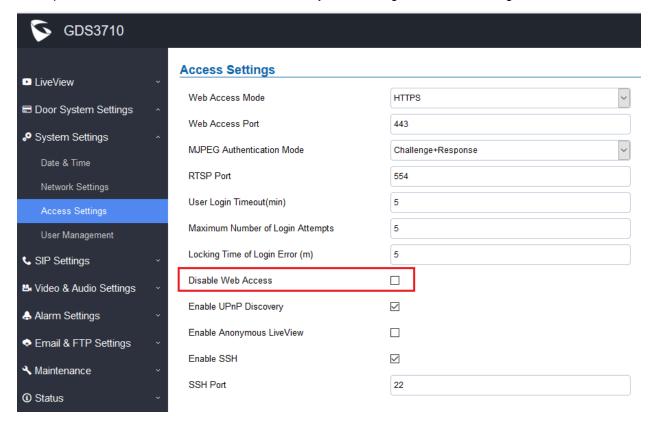

Functionality

This feature is designed for ITSP or service provider to "Disable" the webUI access for security or preventing end users mess up the configuration parameters. Not recommended for normal users. Please be very careful when using this feature.

NOTE:


- If both WebUI and SSH are disabled, GDS3710 will get blocked and not be able to be accessed.
- Only two ways to get it back:
 - 1) Re-provisioned by ITSP or Service Provider (by adjusting the related parameters)
 - 2) Hard Reset (GDS3710 has to be offline and uninstalled to perform this hard reset).



DEFINE NUMBER OF SNAPSHOT UPLOADED WHEN OPEN DOOR

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

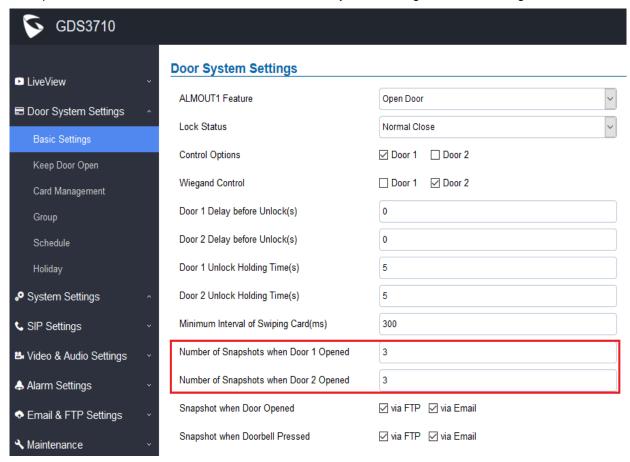

Functionality

This is an enhancement for an existing features after feedbacks from customers.


This setting allows user to get emails with snapshot attachments, or store the snapshots in the FTP server, when door is opened, or the Doorbell is pressed.



DEFINE DIGIT INPUT INTERFACE TO BE NORMAL OPEN OR CLOSE

Web Configuration

This option can be found under device web UI → Alarm Settings → Alarm Events Config:

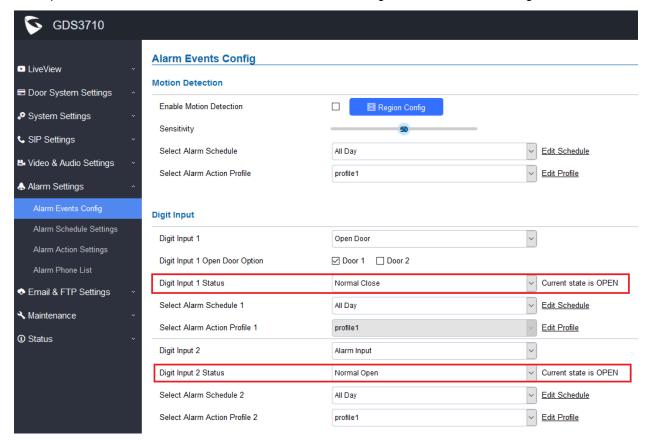

Functionality

This is an enhancement for an existing features after feedbacks from customers.

This setting allows user to select the interface to be normal Open or Close based on the 3rd party device or striker/locker used.


The Digit Input interface can be used for either Open Door or Alarm Input (by 3rd party sensors). Default is Disable therefore not used. Customers have to configure the ports before using them.



SET SCHEDULE FOR ALARM IN OPEN DOOR

Web Configuration


This option can be found under device web UI → Alarm Settings → Alarm Events Config:

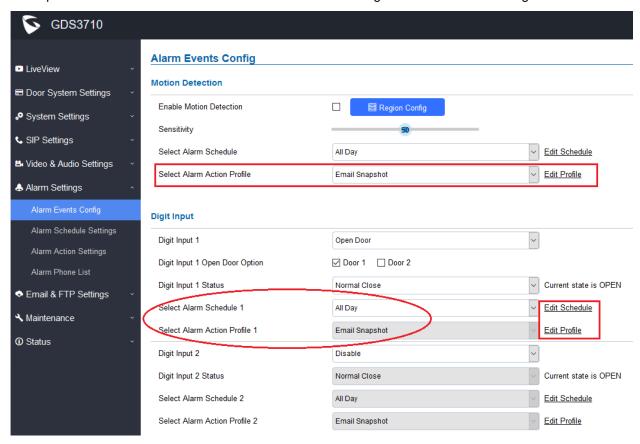

Functionality

This is an enhancement for an existing features after feedbacks from customers. This setting allows user to set schedule and profile for Alarm In interface used as Open Door.

For example, above Alarm_In (COM1) interface configured and used as Open Door, with schedule set to "All Day" and Profile to be "Email Snapshot", meaning this interface used as Open Door for all Days and will email snapshots when door opened.

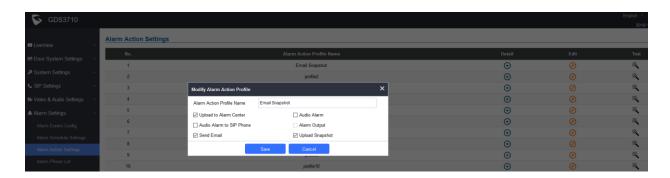




OPEN DOOR VIA DIGIT ONLY PRIVATE PIN

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

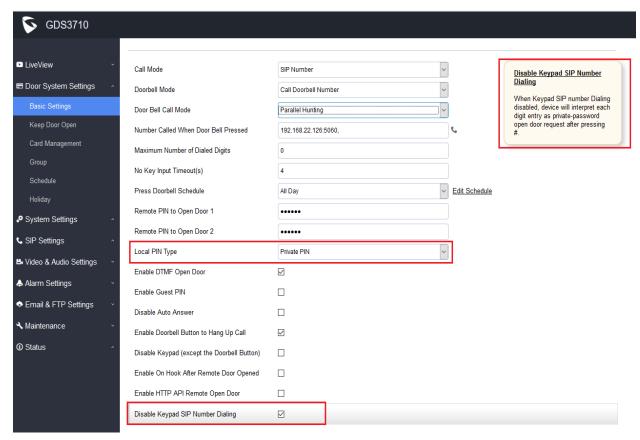

Functionality

This is an enhancement for an existing features after feedbacks from customers and installers.

This setting allows user to use DIGIT ONLY private PIN to open door, with the cost of NOT be able to making any SIP calls (except for doorbell button call). User just input "**PrivatePIN#**" to open door, will NOT input PIN as SIP call enabled mode (with format "*VirtualNumber*PrivatePIN#". This makes the GDS3710 more like traditional access device.

NOTE:

Following settings are required to make this feature working:


- "Disable Keypad SIP Number Calling" should be checked to enable this feature
- "Local PIN Type" should choose "Private PIN"
- Dial keypad to make SIP call will NOT work when above selected.
- PrivatePIN must be <u>UNIQUE</u> among users, otherwise the door will still open but log will NOT tell
 who opened the door due to duplicated PIN and whoever user last matched in the database with
 the PrivatePIN will be shown in the log.



SET "NO KEY ENTRY TIMEOUT"

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

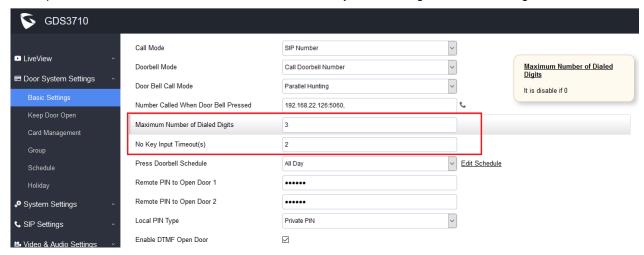

Functionality

This is an enhancement for an existing features after feedbacks from customers.

This setting allows user to configure the timeout (in second) when no key input then sending out the SIP call automatically without press the "#" key. User can customize this parameter based on the environment this door phone installed.

For example in above screenshot:

"Maximum Number of Dialed Digits" is set to be "4":

This is good for an installation allowing the door phone call ONLY the internal extensions to open door. The setting is 4, means user input 4 digit the GDS3710 will immediately dial out (saying the internal extension is using 4 digits)

"No Key Input Timeout(s)" is set to be "2" (second).

This means if user input the digits (less than 4 digit in above example), then wait and not more key strike, after 2 seconds (this can be customized by user or installer in the installation scene), the SIP call will automatically dial out without the "#" pressed.


Same as above screenshot example, if user input less than 4 digits, say input only 1 digit ("0" for example), then followed by the "#" key, then the GDS3710 door phone will immediately dial out "0" to establish the call. ("0" can be Operator or IVR depending on the IPPBX system configured)



EMAIL SNAPSHOTS WHEN DOOR OPENED

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

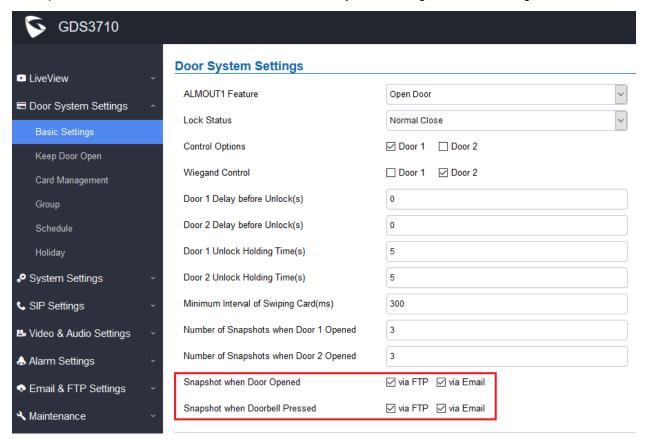

Functionality

This is an enhancement for an existing features after feedbacks from customers. This setting allows user to configure either email or FTP the snapshots when the door opened or the doorbell pressed or both.

For this feature to work, the correct Email (SMTP) settings, FTP settings or GDSManager (Central Storage) have to be configured.

Please refer to User Manual of GDS3710 and GDSManager for detailed configuration.

GDS3710 User Manual:

http://www.grandstream.com/sites/default/files/Resources/GDS3710_UserManual.pdf

GDSManager User Manual:


http://www.grandstream.com/sites/default/files/Resources/GDSManager_User_Guide.pdf



ALLOW ANONYMOUS VIEWING

Web Configuration

This option can be found under device web UI → System Settings → Access Settings:

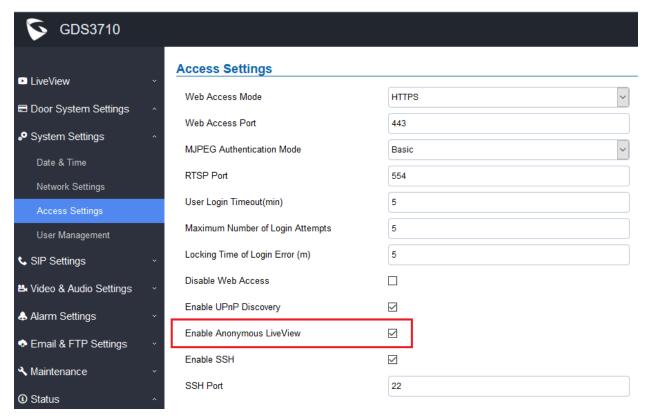

Functionality

This is an enhancement request from customers like Service Provider and Installers. This feature allows system integrators to retrieve video from GDS3710 directly without credentials, good for system redevelopment or scripts running in LAN environment.

When enabled this feature, <u>a special access URL</u> is required to retrieve live video:

https://IP_GDS3710:Port/videoview.html

NOTE:


- Please make sure the environment is secure before enable this feature.
- Please reminder user the privacy when using this feature.



DISPLAY MOTION DETECTION REGION CONFIGURATON WITHOUT PLUGIN

• Web Configuration

This option can be found under device web UI → Alarm Settings → Alarm Events Config:

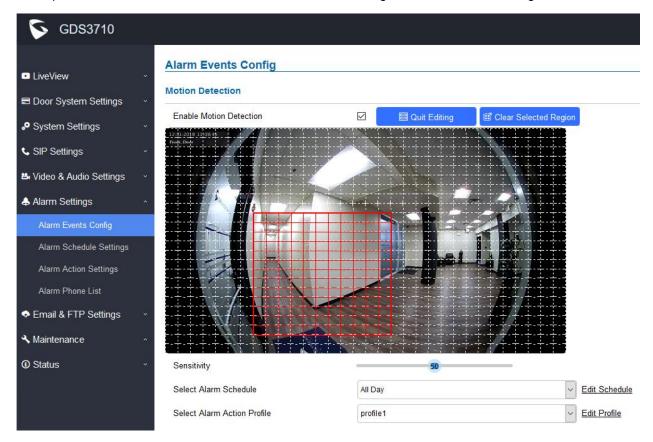

Functionality

This is an enhancement for an existing features, customer can now configure the Motion Detection Region without installing any plugins, same as LiveView.


This feature support most popular browsers like Firefox, Chrome, after NPAPI stopped support by those popular browser for security reason.



EMERGENCY PIN TO OVERWRITE "KEEP DOOR OPEN" (LOCKDOWN)

Web Configuration

This option can be found under device web UI → Door System Settings → Keep Door Open:

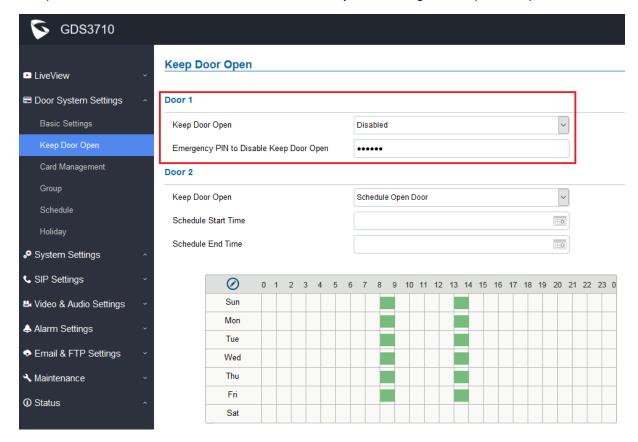

Functionality

This is an enhancement for existing feature from customers. This enhancement is especially good for application scenes or installations like public schools, libraries, city halls, clubs, etc., where at some scheduled time window the door should be opened to public access, but something emergency happened, the door can be lock down by staffs via either webUI or emergency PIN.

There are two ways to apply this emergency lock down:

1) WebUI:

During the emergency, staff can log in to above "Keep Door Open" page and select "Disabled" and click "Save" to immediately lock down the door.

2) Emergency PIN:

The emergency PIN can only be setup from webUI when "Keep Door Open" selected "Disabled", to match that this is a PIN to lock down and "Disable" the open door. The PIN format to enter the PIN from the key pad of GDS3710 is like usual, add "*" and "#" before and after the PIN \rightarrow "***PIN#**".


 When "Keep Door Open" in session and door opened, the white LED of GDS3710 will light up to show the door open status.



CHECK/UPGRADE FIRMWARE AND DISPLAY DEVICE TEMPERATURE

Web Configuration

This enhancement can be found under device web UI → Status → System Info:

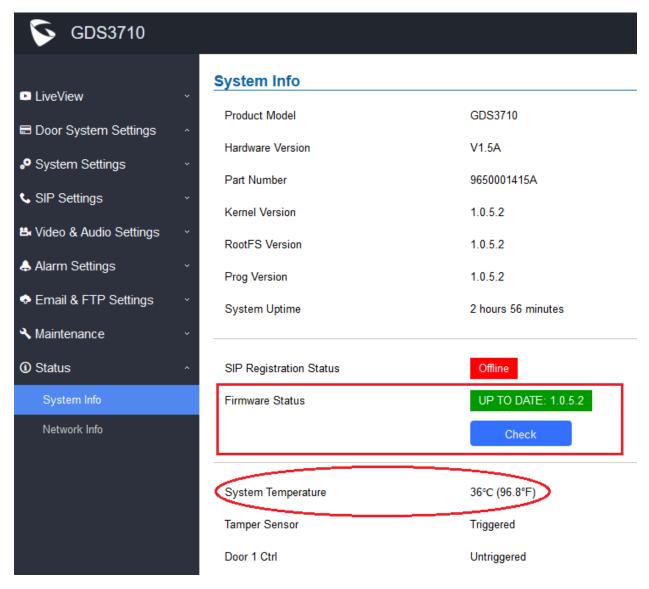

Functionality


This is an enhancement for an existing features after feedbacks from customers.

This feature allows user to click "Check" button to see whether there are "NEW' firmware in the firmware server configured in the firmware server path under UI "Maintenance → Upgrade":

1) If the firmware is the same, it will show "UP TO DATE: X.X.X.X", where the "X.X.X.X" is the current up to date firmware version number.



2) If there are new firmware, the "Firmware Status" will show the available (different) firmware version number. If click "Upgrade" button, the GDS3710 will start download, flash and upgrade the firmware to the one in the server. The key pad blue LED will light up in pattern illustrating the download and burning progress status.

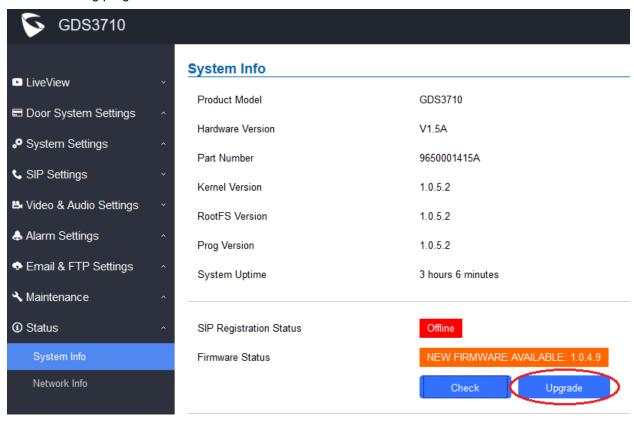

Please do NOT power off the device when firmware burning/upgrade is in processing.

This version also add the device temperature displayed in Fahrenheit to help users using imperial system, like below:


System Temperature	36°C (96.8°F)
Tamper Sensor	Triggered
Door 1 Ctrl	Untriggered
Door 2 Ctrl	Untriggered



SUPPORT SIP NOTIFY AND SET H.264 PAYLOAD TYPE

Web Configuration

This option can be found under device web UI \rightarrow SIP Settings \rightarrow SIP Advanced Settings:

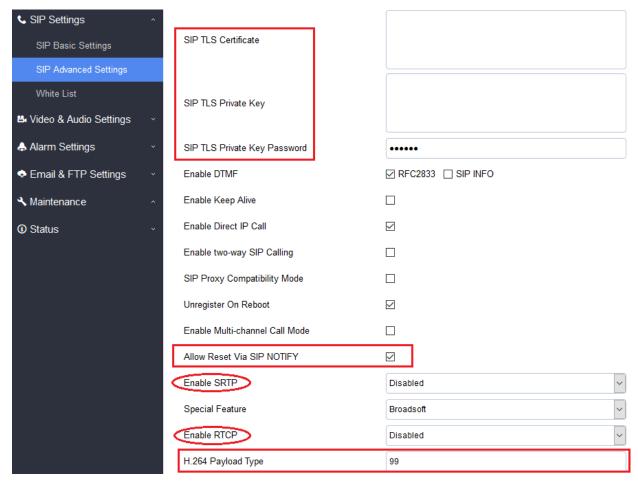

Functionality

This is an enhancement for an existing features, to help ITSP or Service Provider customers to remotely provisioning and control the door phone (GDS3710) if something happened from customer side (e.g.: phone stolen, service fee due, etc.).


The H.264 payload type can now be configured to be compatible with 3rd party video phones, as well as other advanced SIP settings, to easy system integration process.



DISPLAY USER OPEN DOOR VIA PIN OVER EVENT LOG

Web Configuration

This option can be found under device web $UI \rightarrow Maintenance \rightarrow Event Log$:

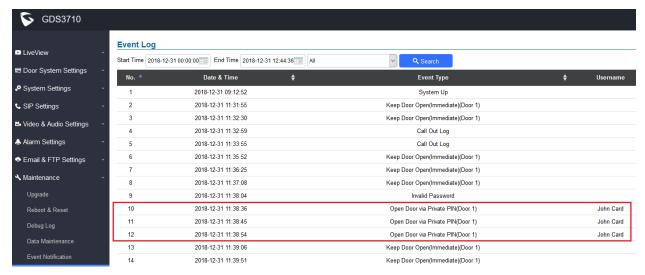

Functionality

This is an enhancement for an existing features, to help ITSP or Service Provider customers, as well as System Integrators or Administrators to understand who opened the door using PIN, which is not available in previous firmware.

This feature enhance the local system administration and maintenance.




CONFIG FIRMWARE OR CONFIGURATION SERVER PATH AND PING TEST VIA SSH

• Web Configuration

This feature is added to allow user to change firmware server path or configuration server path via SSH. This is very useful for ITSP or service contractors or installer to maintenance the device, for example, the webUI is purposed blocked, ITSP or Service Technician can use scripts in SSH to perform necessary configuration or maintenance, or upgrade firmware.

The SSH has to be enabled to use this feature. The option can be found under device web UI \rightarrow System Settings:

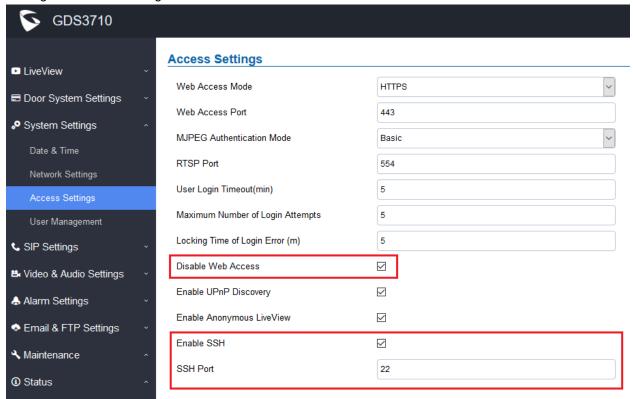

Functionality

This feature is added to allow users (service technician, installer, etc.) to configure or change the firmware server or configuration server path via SSH, enhance the security of SIP accounts configured in GDS37XX.

3rd party SSH application like *PuTTY* is required to use this feature.



For example, below is the screenshot of such CLI interface:

```
192.168.22.165 - PuTTY
login as: admin
admin@192.168.22.165's password:
Grandstream Command Shell Copyright 2006-2018
GDS3710> status
Product Model: GDS3710
Network:
       MAC Addr: --00:0B:82:B3:1A:37
LAN IP Address: --192.168.22.165
LAN Subnet Mask: --255.255.255.0
        LAN Default Gateway: --192.168.22.1
System Statistics:
       Hardware Version:
                                       --V1.5A
        Part Number:
                                        --9650001415A
        Bootloader Version:
                                        --1.0.5.2
       Core Version:
Base Version:
                                       --1.0.5.2
                                       --1.0.5.2
        Firmware Version:
                                       --1.0.5.2
        System Up Time Since: --3 hours 53 minutes
GDS3710> help
Commands available:
    help -- Show available commands
                    -- Exit this command shell
     exit
    status
                   -- Show the information of the system
     restart -- Reboot the device
    reset -- faction and the system
upgrade -- Upgrade the system
config -- Configure the device
bing -- Send ICMP ECHO_REQUEST packets to network hosts
GDS3710> config
CONFIG> help
Supported commands:
    ported commands:

set FWUpgradeType value -- Set FW Upgrade Type 0-TFTP 1-HTTP, 2-HTTPS

set FWServerPath value -- Set FW Server Path

set ConfigUpgradeType value set ConfigServerPath value get FWUpgradeType -- Get FW Upgrade Type

get ConfigUpgradeType -- Get FW Server Path

get ConfigUpgradeType -- Get Config Upgrade Type

get ConfigServerPath -- Get Config Server Path

commit -- Commit the changes to FLASH
     commit
                                                -- Commit the changes to FLASH
     help
                                                 -- Show this help text
     exit
                                                 -- Exit this command shell
CONFIG> exit
GDS3710> ping www.grandstream.com
PING www.grandstream.com (45.55.195.232): 56 data bytes
64 bytes from 45.55.195.232: seq=0 ttl=53 time=10.591 ms
64 briton from 4E EE 10E 222. acc-1 ++1-E2 +imo-0 710 ma
```

NOTE:

- This feature is designed for ITSP Service Provider, or Service Technician or Installers.
- End users without necessary knowledge are strongly discouraged to access it, avoiding damage the
 device or making the device not working properly.



FIRMWARE VERSION 1.0.4.9

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

11/21/2018

SUMMARY OF UPDATE

This is **MAJOR UPDATE** with purpose of bug fixes and feature enhancement. Please read below WARNING carefully before upgrading.

It's strongly recommended for users to back up all the data (both configuration and application) before upgrade, also perform factory reset if the previous firmware is an old version in different FW level.

WARNING:

- Self-reboot TWICE is required to finish the whole upgrade process and it can take about 20 minutes. Please be patient and DO NOT interrupt power. Incomplete upgrade can potentially brick the device.
- Please press keypad to verify the upgrade is finished. If BEEP sound heard and BLUE LED lighted up upon pressing, the means the device finished upgrading and booted up successfully. If other LED patterns are in progress or there is no BEEP sound/BLUE light, the device hasn't finished upgrade yet, DO NOT unplug power during this stage to prevent damaging the device.
- After upgrading, please download <u>GS Search</u> utility tool and perform a search within LAN using your PC. The device should show up in search result with the correct firmware version. Double clicking it will open device web UI successfully. That indicates upgrading has completed successfully.
- Once upgraded to 1.0.4.x firmware, downgrade to previous lower lever firmware (1.0.1.xx/1.0.2.xx/1.0.3.xx) is NOT SUPPORTED.
- Local firmware upgrade recommended. Please download and use the <u>GS Upgrade</u> <u>Tool</u> provided by Grandstream for local firmware upgrade, avoiding internet or power interruption to brick the device.
- For 1.0.1.xx and 1.0.2.xx firmware, single firmware file not supported and multiple unzipped binary files are required for successful upgrade. Please allow at least <u>20</u> <u>minutes</u> for local upgrade before log in back to check or power cycle the device.
- <u>Factory Reset</u> is recommended after upgrading from previous lower lever firmware.
 Please backup data before performing factory reset then restore back the data.



FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	

ENHANCEMENT

- Added support for TLSV1.2
- Optimized firmware upgrade process and reduced self-reboot from three time to twice.
- Support single firmware file upgrade with 6bit ECC.
- Single firmware file upgrade supported since 1.0.3.35. Previous lower lever firmware 1.0.1.xx/1.0.2.xx upgrade requires firmware with multiple binary files. Two firmware packages provided.

BUG FIX

- Fixed probability issue in 1.0.4.5 where upgrading from previous firmware if amboot not upgraded will stop the upgrade process therefore brick the device.
- Fixed device keep on playing doorbell sound if account unregistered.
- Fixed issue that keypad not response sometimes.
- Fixed security vulnerability that root access may compromised via SSH.

KNOWN ISSUES

- LiveView page, the page may crash if click the "Local Configuration Function"
- INVITE to an ICMP address, the doorbell still rings as normal.
- The panel lights might off during the call.

NEW P-VALUE

N/A

NEW HTTP API

N/A

Released HTTP API documentation can be downloaded from here:

http://www.grandstream.com/sites/default/files/Resources/gds37xx http api.pdf



FIRMWARE VERSION 1.0.4.5 (REMOVED)

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

09/13/2018

SUMMARY OF UPDATE

This is **MAJOR UPDATE** with purpose of bug fixes and feature enhancement. Please read below WARNING carefully before upgrading.

It's strongly recommended for users to back up all the data (both configuration and application) before upgrade, also perform factory reset if the previous firmware is an old version in different FW level.

WARNING:

- Three-times self-reboot is required to finish the whole upgrade process and it can take more than 30 minutes. Please be patient and <u>DO NOT interrupt power</u> until 30 minutes later. Unplugging it before complete upgrade can potentially brick the device.
- After 30 minutes, please press any button on the device keypad to verify the symptom of complete upgrade. If it has a BEEP sound and BLUE light for the button light up upon pressing, the device has finished upgrading and rebooted successfully. If other patterns are in progress or there is no BEEP sound/BLUE light, the device hasn't finished upgrade yet, DO NOT unplug power during this stage to prevent damaging the device.
- After upgrading, please download <u>GS_Search</u> app and perform a search within LAN using your PC. The device must show up in search result with the correct firmware.

 Double clicking it will open device web UI successfully. That indicates upgrading has successfully completed.
- Once upgraded to 1.0.4.x firmware, downgrade to previous lower lever firmware (1.0.1.xx/1.0.2.xx/1.0.3.xx) is NOT SUPPORTED.
- Local firmware upgrade recommended. Please download and use the <u>GS Upgrade</u> <u>Tool</u> provided by Grandstream for local firmware upgrade, avoiding internet or power interruption to brick the device.
- For 1.0.1.xx and 1.0.2.xx firmware, all the unzipped binary files are required for successful upgrade. Please allow at least <u>30 minutes</u> in local upgrade before log in back to check or power cycle the device.



• <u>Factory Reset</u> is recommended after upgrading from previous lower lever firmware. Please backup data before performing factory reset then restore back the data.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	

ENHANCEMENT

- Single firmware file upgrade supported with 6bit ECC.
- Support parallel hunting (simultaneously ringing configured extensions and/or IP addresses) when doorbell pressed.
- Added Card_ID, SIP extension, etc. details in the HTTP Event Notification.

BUG FIX

- Fixed DTMF open door issue with early media, SIN INFO.
- Fixed alarm not fired when enable silent alarm with schedule configured.
- Fixed initial audio chopped off issue with outgoing calls from GDS3710.
- Fixed Log Notification Type missing.
- Fixed call fails when dialing digit length less than the maximum number of digits.
- Fixed audio may be noisy after long time (in hours) of call (not feasible in real environment)
- Fixed No plugin preview not working when MJPEG video codec configured.
- Fixed "Card Issuing Mode Expired Timer" cannot be saved.
- Fixed key light not bright enough when using HTTP API to open the door.
- Fixed GDS3710 SSH access unauthorized with static IP address after reboot.
- Fixed the temperature alarm email cannot be sent normally.
- Fixed timer error when hanging up the call.
- Fixed spotted video image when switching call lines in GDS3710.

KNOWN ISSUES

- Video JPEG stream will fail in GXP audio phones when NAT involved.
- The SIP phone sending DTMF to GDS may sometimes hand up and clear the call
- Device will fail to send DNS resolution when Stun Server using FQDN (only IP Stun works)
- The 2nd outbound proxy will not use the DNS-SRV parsing domain name.



- The option may crash if click the "Local Configuration Function"
- INVITE to an ICMP address, the doorbell still rings as normal.
- The panel lights might off during a call

NEW P-VALUE

P-Value	Values	Default Value	Comments
P15434= <int> (Add)</int>	0 1	0	 Serial Hunting Parallel Hunting

NEW HTTP API

GET:

://ip:port/goform/config?cmd=get&type=door">http|https>://ip:port/goform/config?cmd=get&type=door

SET:

://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.gofo

For details please refer to HTTP API Document and User Manual.




NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

PARELLEL HUNTING/SIMUTANEOUS RINGING WHEN DOORBELL PRESSED

Web Configuration

This option can be found under device web UI→ Basic Settings→:

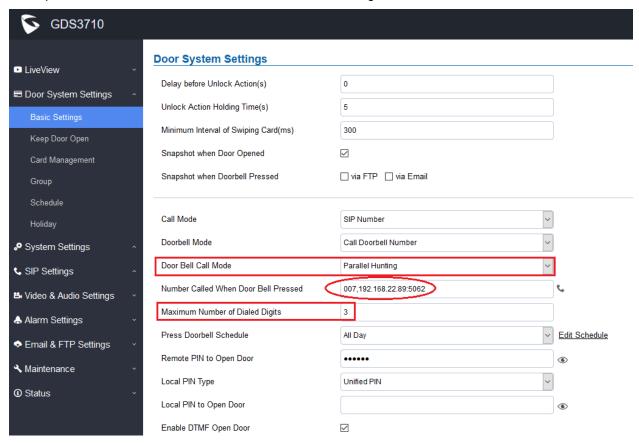

Functionality

This feature allows user to configure SIP extensions (if having IPPBX) or IP addresses (if no IPPBX) or combined into the "Number Called When Door Bell Pressed" field, so the doorbell pressed, those IP phones will ring simultaneously (ringing at the same time). Anyone pick up the phone will be able to talk to the GDS3710 (or viewing the image at capable IP Phones), then press the digit PIN to open the door remotely, or use the "ONE KEY OPEN DOOR" feature if configured correctly with compatible IPPBX and IP Phones.

In "Door Bell Call Mode", there are two options in the pull down menu: Serial Hunting, Parallel Hunting. "Serial Hunting" means extensions and/or/combined IP devices ring one after one by order (this feature has already been supported in previous firmware); "Parallel Hunting" means all the extensions and/or/combined IP devices ring simultaneously at the same time (new feature in this firmware).


User can select either one depending on the application scenarios.



EVENT NOTIFICATION

Web Configuration

This option can be found under device web UI → Maintenance → Event Notification:

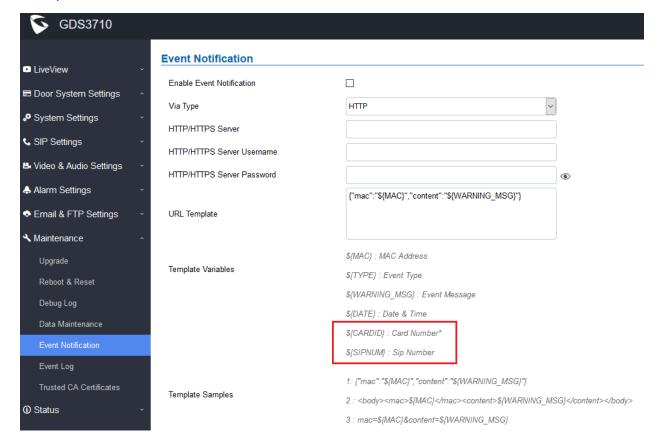

Functionality

This is an enhancement for an existing features after feedbacks from customers.

Added Card_ID, SIP extension, etc. details in the HTTP Event Notification which not supported in previous firmware. This will allow 3rd party system integrator or developers to implement related application for users. Details please refer to User Menu and HTTP API

If enabled, device can send HTTP events to related web server and allow 3rd party system integrators to implement dedicated usage applications for customers (e.g.: live monitor the door access status).

Released HTTP API documentation can be downloaded from here:

http://www.grandstream.com/sites/default/files/Resources/gds37xx_http_api.pdf



New Pvalue

P-Value	Values	Default Value	Comments
P15434= <int> (Add)</int>	0 1	0	2. Serial Hunting3. Parallel Hunting

New HTTP API

GET:

://ip:port/goform/config?cmd=get&type=door">http|https>://ip:port/goform/config?cmd=get&type=door

SET:

://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http|https>://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config?cmd=set&P15434=<0|1>">http://ip:port/goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.goform/config.gofo

For details please refer to HTTP API Document and User Manual.

http://www.grandstream.com/sites/default/files/Resources/gds37xx_http_api.pdf



FIRMWARE VERSION 1.0.3.35

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

07/16/2018

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement.

IMPORTANT UPGRADING NOTE

- Local firmware upgrade recommended.
- Please download and use the "<u>Utility</u>" provided by Grandstream for local firmware upgrade, avoiding internet or power interruption to brick the device.
- <u>Factory Reset</u> is recommended after upgrading from old 1.0.<u>1</u>.xx or 1.0.2.xx firmware. Downgrade back to 1.0.1.xx or 1.0.2.xx is NOT supported once upgrade to 1.0.3.xx.
- Please backup data before performing factory reset then restore back the data.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	



ENHANCEMENT

- Added option to assign a schedule to the doorbell.
- Added option to set the maximum number of digits dialed.

BUG FIX

- Fixed FTP upload process incompatible issue.
- Fixed when Motion Detection enabled, alarming triggered but SIP call failed.
- Fixed fail to send DNS resolution when Stun Server using FQDN (only IP Stun works)
- Fixed pressing keypad during network interruption or outage, the key tone keep buzzing.
- Fixed hostage code in use, "Enable on hook after remote door opened" should be invalid (setting overlapped) to know the hostage situation at door side.
- Fixed RTSP feature options should be: Disabled, Enable and Forced, Enable but not Forced.
- Fixed webUI misaligned in the Data Maintenance page.
- Fixed WebUI error heading under Network Infor submenu.
- Fixed the red prompted will pop up twice when wrong password inputted.
- Fixed the missing type of Log Notification (System Up).
- Fixed and specified the default initial start time of card is "1970-01-01" when adding.
- Fixed when MJPEG Authentication is different with the request the response message still return.

KNOWN ISSUES

- Video JPEG stream will fail in GXP audio phones when NAT involved.
- The SIP phone sending DTMF to GDS may sometimes hand up and clear the call
- Allowing to accept multiple calls at the same time
- The 2nd outbound proxy will not use the DNS-SRV parsing domain name.
- The HTTP web access device may appear close wait
- The option may crash if click the "Local Configuration Function"
- INVITE to an ICMP address, the doorbell still rings as normal.



NEW FUNCTIONS

Option to Assign Schedule to Door Bell.

This feature allow user to configure a schedule to the Doorbell Button. Once configured, the doorbell button will turn ON or OFF based on configured schedule. For example, some users do not want the doorbell to work during the night.

Maximum Number of Dialed Digits

This feature will allow user to configure the maximum digits allowed to dial in the keypad. Once the configured condition satisfied, the device will send out the digit to call automatically without pressing #

NEW P-VALUE

P-Value	Values	Default Value	Comments
P15419= <int> (Add)</int>	0 20	0	Maximum Number of
			Dialed Digits
P15418= <int> (Add)</int>	0 10	0	Press Doorbell Schedule
P443= <int> (Update)</int>	0 2	0	Enable SRTP
			0: Disable
			1: Enable but No Forced
			2: Enable and Forced

NEW HTTP API

P15419

GET:

://<servername>/goform/config?cmd=get&type=door">SET:

://<servername>/goform/config?cmd=set&P15419=<0-20>"> http://dispervername>/goform/config?cmd=set&P15419=<0-20>"> http://dispervername>/goform/config?cmd=set&P15419=<0-20>

P15418

GET:

://<servername>/goform/config?cmd=get&type=door

://<servername>/goform/config?cmd=set&P15418=<0-10>"> http://dispervername>/goform/config?cmd=set&P15418=<0-10>"> http://dispervername>/goform/config?cmd=set&P15418=<0-10>

P443

GET:

://<servername>/goform/config?cmd=get&type=sip">set:

For details, please refer to the latest version of HTTP API Document and User Manual.




NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

ASSIGN SCHEDULE TO DOOR BELL

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings:

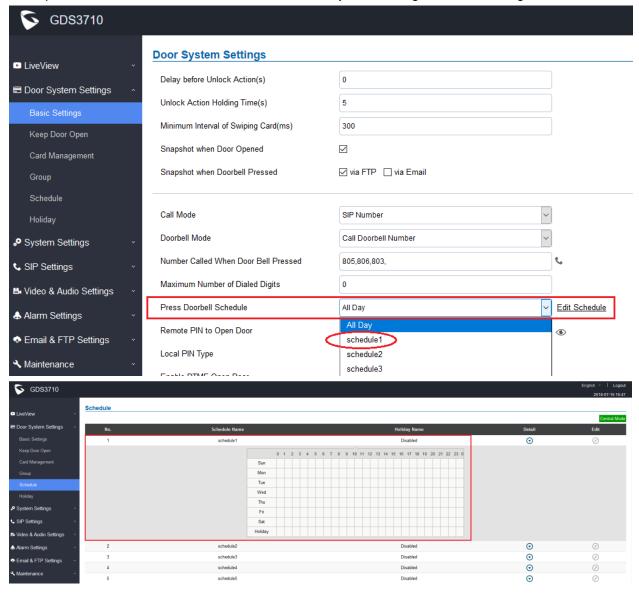

Functionality


This feature allows user to configure a schedule to the Doorbell Button. Once configured, the doorbell button will turn ON or OFF based on configured schedule. For example, some users do not want the doorbell to work during the night.



MAXIMUM NUMBER OF DIGIT DIALED

Web Configuration

This option can be found under device web UI→ Door System Settings → Basic Settings:

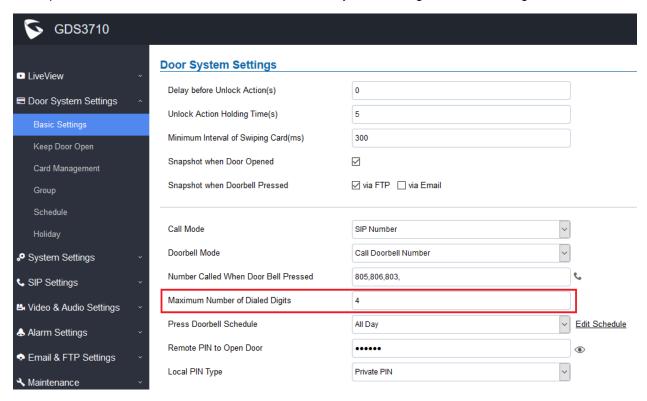

Functionality

This feature will allow user to configure the maximum digits allowed to dial in the keypad. Once the configured condition satisfied, the device will send out the digits and call automatically without pressing #. This is similar to a very simple dial plan but just number of digits managed.



FIRMWARE VERSION 1.0.3.34

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

06/12/2018

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement.

IMPORTANT UPGRADING NOTE

- Local firmware upgrade recommended.
- Please download and use the "<u>Utility</u>" provided by Grandstream for local firmware upgrade, avoiding internet or power interruption to brick the device.
- <u>Factory Reset</u> is recommended after upgrading from old 1.0.<u>1</u>.xx or 1.0.2.xx firmware. Downgrade back to 1.0.1.xx or 1.0.2.xx is NOT supported once upgrade to 1.0.3.xx.
- Please backup data before performing factory reset then restore back the data.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	



ENHANCEMENT

- Optimized ringing timeout and set to within 5 seconds.
- Optimized 4th MJPEG stream, added 1st, 2nd and 3rd MJPEG when encode type is MJPEG.
- Chrome and Firefox via websocket to get live video stream, NO Plugin required to install, but IE still
 requires the support of video plugin.
- Added support for basic authentication of MJPEG HTTP API (similar to GS IPC behavior).
- Added Open Door by configured schedule or time window.
- Added "Test" button for "Alarm Action" in the webUI.
- Added Alarm Notification for Access Attempts of users out of the configured schedule.
 HTTP API Log Index Code: 1110, Non-scheduled Access (refer to related Log Type Document)
- Added option to send Snapshot via email when doorbell pressed.
- Added option to send "Call Completed Elsewhere" when doorbell pressed and door opened successfully by other GXP phones so no missing call logs will be displayed.
- Added RTCP/RTCP-XR for SIP Call.
- Improved Event Log UI layout.

BUG FIX

- Fixed GDS3710 doorbell call would fail if target is IP but with non-default port.
- Fixed GDS3710 RTCP feature not working as expected.
- Fixed Schedule Open Door time span configuration related issue.
- Fixed SMTP test failure when LLDP is disabled.
- Fixed NTP error occurred during RTCP/RTCP-XR transmission
- Fixed XML Config File not update the "Keep Door Open" settings if "Immediate Open Door" selected.
- Fixed the webpage display abnormal if there are special character "," in the group name.
- Removed vague translation of "Open Door Valid Time" in WebUI and the HTTP API function module.
- Fixed the temperature sensor displayed abnormal in the WebUI.
- Fixed the doorbell tone distortion.
- Fixed HTTP API open door log message error.
- Fixed GDS3710 FTP uploading snapshots failure if FTP server using domain name.
- Fixed SIP call hangs up if DNS server is domain name

KNOWN ISSUES

- Video JPEG stream will fail in GXP audio phones when NAT involved.
- The SIP phone sending DTMF to GDS may sometimes hand up and clear the call
- Allowing to accept multiple calls at the same time
- Device will fail to send DNS resolution when Stun Server using FQDN (only IP Stun works)
- The 2nd outbound proxy will not use the DNS-SRV parsing domain name.
- The HTTP web access device may appear close wait
- The option may crash if click the "Local Configuration Function"
- INVITE to an ICMP address, the doorbell still rings as normal.



NEW FUNCTIONS

 Basic authentication of MJPEG video or Snapshot image via HTTP API to easy 3rd party System Integration, similar to GS IPC implementation.

For easy system integration (with the cost of less secure), once the feature enabled (default is disabled), user can send HTTP API with correct credentials to retrieve MJPEG video or JPEG snapshot from GDS3710, similar to the behavior of Grandstream IP Cameras.

The HTTP API or CLI command listed as below:

MJPEG Video:

http(s)://admin:password@IP_GDS3710:Port/jpeg/mjpeg.html

JPEG Snapshot:

http(s)://admin:password@IP_GDS3710:Port/jpeg/view.html

NOTE:

- > MJPEG stream may feel like animation due to the compromise of video quality and bandwidth.
- Similar command can be applied to open source application like **VLC MediaPlayer** to retrieve H.264 video stream with better quality:

rtsp://admin:password@IP_GDS3710:Port/X

where X= 0, 4, 8 corresponded to 1st, 2nd and 3rd video stream where 2nd recommended.

Open Door by configured schedule or time window.

This feature is good for usage scene like schools or similar private or public places where the door needs to keep open at specific time window but closed otherwise. Also good for buildings or properties where a party or seminar need to be hosted for some period of time in a day (the door keeps open) then back to locked with authorized entry after that. Also good for lunch breaks in a factory or company where door open and no access log required.

- Alarm Notification of Access Attempts by users out of the configured schedule
 This feature will allow related building or office managers aware the abnormal activities when legitimated users access the door out of the allowed configured schedule. For example, entry during weekend or night at not working hours.
- Send Snapshot via email when doorbell pressed.
 This feature once enabled, the GDS3710 will email the snapshot when doorbell pressed, in addition to the existing feature that FTP the snapshots to the Server, if working SMTP configured.
- Implemented "Call Completed Elsewhere" to omit "Missing Call Logs" in GXP phone
 This implementation will allow GXP phones NOT display 'Missing Calls" in the log if the office having
 multiple GXP phones in the group to open door, can open door call is performed by other GXP.
- Added RTCP/RTCP-XR for SIP Call to meet Cloud Solution Service Provider.
 This feature allows 3rd party Service Provider or Cloud Solution to monitor the operation status of the GDS3710 by using related SIP Calls.



NEW P-VALUE

P-Value	Values	Default Value	Comments
P15409	0: Disable 1: Enable	0	Email Snapshot when
			Doorbell Pressed
P15408	1~10	1	Non-scheduled Access
			Alarm Action Profile
P15407	0: Disable 1: Enable	0	Enable Non-scheduled
			Access Alarm
P2392	0: Disable	0	Enable RTCP, RTCP-XR.
	1: RTCP 2: RTCP-XR		Default disabled

NEW HTTP API

GET:

://<servername>/goform/config?cmd=get&type=sip">http|https>://<servername>/goform/config?cmd=get&type=sip

SET:

://<servername>/goform/config?cmd=set&P2392=<0|1|2>

For details please refer to HTTP API Document and User Manual.



NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

CHROME/FIREFOX NO PLUGIN REQUIRED FOR VIDEO LIVEVIEW

Web Configuration

This option can be found under device web $UI \rightarrow LiveView \rightarrow$:



Functionality


This feature allows user and installer to "Preview" the Live Video using popular browsers like Chrome or Firefox immediately without downloading and installing the plugins or NPAPIs like previously, due to most current browsers are not supporting the NPAPI anymore for security concern.



BASIC AUTHENTICATION of MJPEG VIDEO OR SNAPSHOT VIA HTTP API

• Web Configuration

This option can be found under device web UI→System Settings:

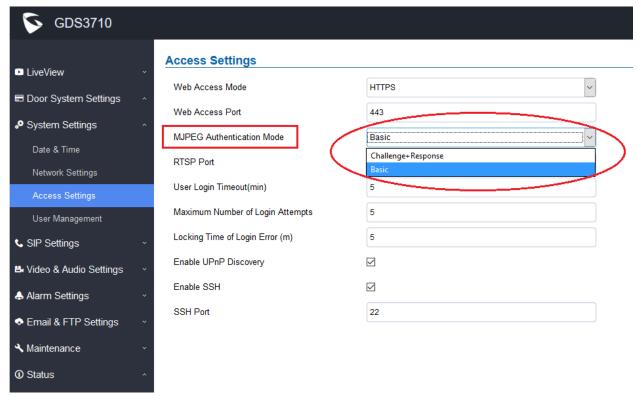

Functionality

Allow 3rd party system integrator or developers to implement related application for users. Details please refer to User Menu. By default this feature is disabled and use more secured "Challenge+Response" mode.

If enabled, user can send HTTP API with correct credentials to retrieve MJPEG video or JPEG snapshot from GDS3710, similar to the behavior of Grandstream IP Cameras.



The HTTP API or CLI command listed as below:

MJPEG Video:

http(s)://admin:password@IP_GDS3710:Port/jpeg/mjpeg.html

JPEG Snapshot:

http(s)://admin:password@IP_GDS3710:Port/jpeg/view.html

NOTE:

- > MJPEG stream may feel like animation due to the compromise of video quality and bandwidth.
- Similar command can be applied to open source application like VLC MediaPlayer to retrieve H.264 video stream with better quality: rtsp://admin:password@IP_GDS3710:Port/X where X= 0, 4, 8 corresponded to 1st, 2nd and 3rd video stream where 2nd recommended.
- > Detailed information, please check out the updated <u>latest version</u> of **HTTP API**.



OPEN DOOR BY CONFIGURED SCHEDULE OR TIME WINDOW


Web Configuration

This option can be found under device web UI → Door System Settings → Keep Door Open: There are two mode:

1. Immediate Open Door (One Time Only Action)



2. Schedule Open Door (Repeated Action)

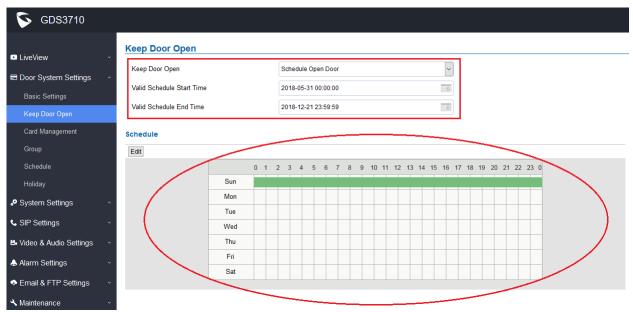

Functionality


By default this feature is disabled. This feature when enabled will allow usage scene like schools or similar private or public places where the door needs to keep open at specific time window but closed otherwise. Also good for buildings or properties where a party or seminar need to be hosted for some period of time in a day (the door keeps open) then back to locked with authorized entry after that. Also good for lunch breaks in a factory or company where door open and no access log required.



ALARM NOTIFICATION OF ACCESS BY USERS OUT OF SCHEDULE

Web Configuration

This option can be found under device web UI→ Alarm Settings → Alarm Events Config:

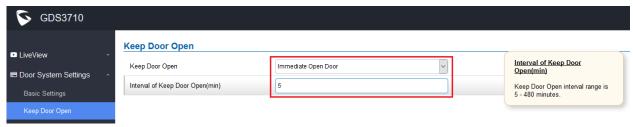

Functionality

By default this feature is disabled. When configured and enabled, this feature will allow related building or office managers aware the abnormal activities when legitimated users access the door out of the allowed configured schedule. For example, entry during weekend or night at not working hours.

New Pvalue


P-Value	Values	Default Value	Comments
P15408	1~10	1	Non-scheduled Access
			Alarm Action Profile



SEND SNAPSHOT VIA EMAIL WHEN DOORBELL PRESSED

• Web Configuration

This option can be found under device web UI→ Door System Settings → Basic Settings:

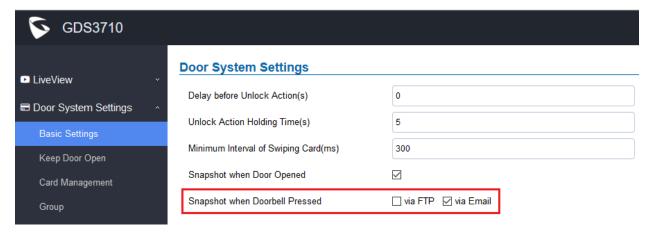

Functionality

This feature once enabled, the GDS3710 will email the snapshot when doorbell pressed, in addition to the existing feature that FTP the snapshots to the Server, if working SMTP configured.

New Pvalue


P-Value	Values	Default Value	Comments
P15409	0: Disable 1: Enable	0	Email Snapshot when
			Doorbell Pressed



RTCP/RTCP-XR SIP CALL FOR ITSP/CLOUD SOLUTION

• Web Configuration

This option can be found under device web UI→ SIP Settings → SIP Advanced Settings:

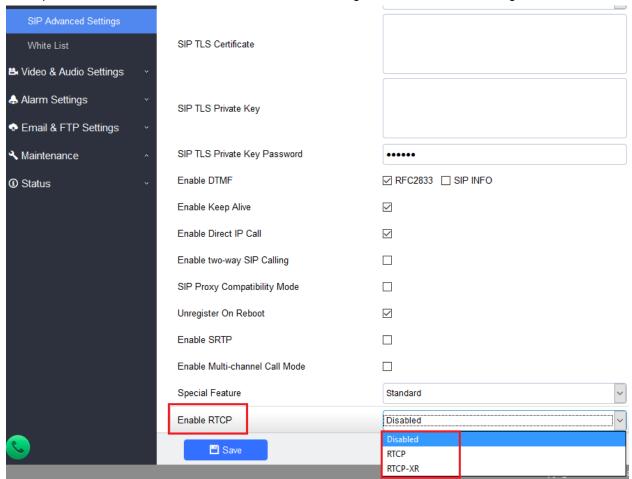

Functionality

This feature allows 3rd party Service Provider or Cloud Solution to monitor the operation status of the GDS3710 by using related SIP Calls.

New Pvalue


P-Value	Values	Default Value	Comments
P2392	0, 1, 2	0: Disabled	Enable RTCP,
		1: RTCP	RTCP-XR.
		2: RTCP-XR	Default is Disabled.



IMPROVED EVENT LOG UI LAYOUT

• Web Configuration

This option can be found under device web UI → Maintenance → Event Log:

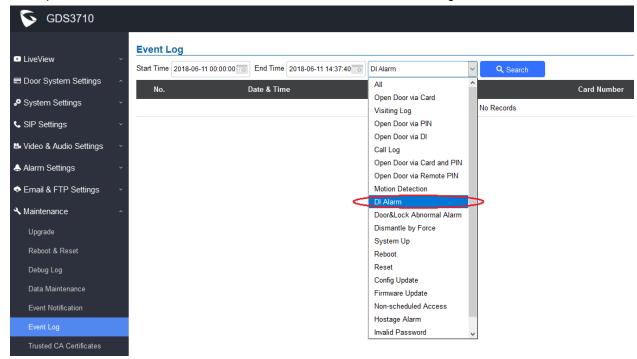

Functionality

This UI layout improvement allows user to have a better choice and view about the Event Log.



FIRMWARE VERSION 1.0.3.32

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

05/08/2018

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement.

IMPORTANT UPGRADING NOTE

- Local firmware upgrade recommended.
- Please download and use the "<u>Utility</u>" provided by Grandstream for local firmware upgrade, avoiding internet or power interruption to brick the device.
- Factory Reset is recommended after upgrading from old 1.0.1.xx or 1.0.2.xx firmware.

 Downgrade back to 1.0.1.xx or 1.0.2.xx is NOT supported once upgrade to 1.0.3.xx.
- Please backup data before performing factory reset then restore back the data.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	



ENHANCEMENT

- Added LED lighting indication pattern for firmware upgrade process. The sequence during upgrade is:
 - 1) Doorbell button blue LED will flash when firmware files are downloading.
 - 2) Digit 1,2,3 blue LED will flash during upgrading from 0 to 25%, then stays on;
 - 3) Digit 4,5,6 blue LED will flash during upgrading from 25 to 50%, then stays on;
 - 4) Digit 7,8,9 blue LED will flash during upgrading from 50 to 75%, then stays on;
 - 5) Digit *,0,# blue LED will flash during upgrading from 75 to 100%, then stays on;
 - 6) After all key's blue LEDs light on then flash twice then reboot itself to finish the upgrade process.
- Added White List Number to maximum 20 digits up to 30 records.
- Added support for HTTP command to Open Door.
- Added display device Logs at GDS webGUI.
- Added Start/End date for Card Management based on field feedback.
- Added "Test" Button for Alarm Action.
- Added "Alarm In/Out Status" display at GDS "Status" page GUI.
- Added Self-Define Event Notification Message.



BUG FIX

- Fixed Motion Detection and Tamper DI input, these two alarms cannot upload snapshots to the Central Storage and FTP server.
- Fixed Ringing timeout set to "0" unable to initiate the call.
- Fixed use call icon to call GXP/GXV phone and execute remote open door, the visiting log displayed error in GDSManager Utility Software.

KNOWN ISSUES

- Video JPEG stream will fail in GXP audio phones when NAT involved.
- The SIP phone sending DTMF to GDS may sometimes hand up and clear the call
- Allowing to accept multiple calls at the same time
- Device will fail to send DNS resolution when Stun Server using FQDN (only IP Stun works)
- The 2nd outbound proxy will not use the DNS-SRV parsing domain name.
- Device will not update to new IP after switching the network until after reboot.
- Device will not prompt error if IP address and Gateway configured incorrect.
- When unlocking latency is not zero, swiping card cannot clear unestablished SIP call.
- The HTTP web access device may appear close_wait
- The option may crash if click the "Local Configuration Function"
- IP address obtained by LLDP may be wrongly disabled.



NEW FUNCTIONS

• LED Lighting Indication Pattern for Firmware Upgrade Process

The sequence during upgrade is:

- 1) Doorbell button blue LED will flash when firmware files are downloading.
- 2) Digit 1,2,3 blue LED will flash during upgrading from 0 to 25%, then stays on;
- 3) Digit 4,5,6 blue LED will flash during upgrading from 25 to 50%, then stays on;
- 4) Digit 7,8,9 blue LED will flash during upgrading from 50 to 75%, then stays on;
- 5) Digit *,0,# blue LED will flash during upgrading from 75 to 100%, then stays on;
- 6) After all key's blue LEDs light on then flash twice then reboot itself to finish the upgrade process.

HTTP Open Door:

3rd party system integrator can now "Enable" the HTTP API for Remote Open Door (Default is disabled, enable this feature customers will take the risk of security).

Grandstream provided a sample HTML utility to help customer to understand how to implement this feature. Details please refer to HERE.

Self-Defined Event Message


3rd party system integrator can now "Enable" the Event Notification and use Self-Defined Event Message. This allows system integrator to implement cloud service solution, like collecting real time event status from the GDS and centrally monitor the running status of the device.

NEW P-VALUE

P-Value	Values	Default Value	Comments
P15424	0- Disable	0	Enable HTTP API
	1- Enable		Remote Open Door
P15428	5~300	30	Open Door Valid Time
P15417	1: HTTP	1	Via Type
	2: HTTPS		
P15416	String	{"mac":"\${MAC}",	URL Template
		"content":"	
		\${WARNING_MSG}"}	



NEW HTTP API

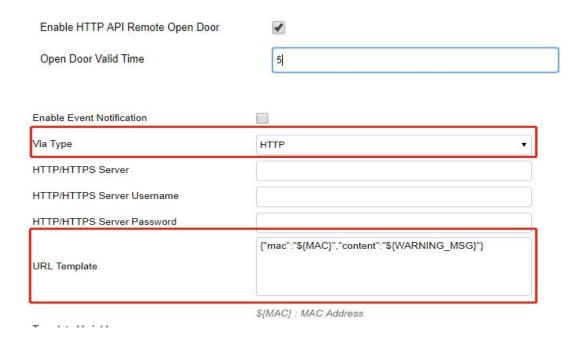

For details please refer to User Menu.




NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

HTTP OPEN DOOR

Web Configuration

This option can be found under device web UI→Door System Settings: →Basic Settings:

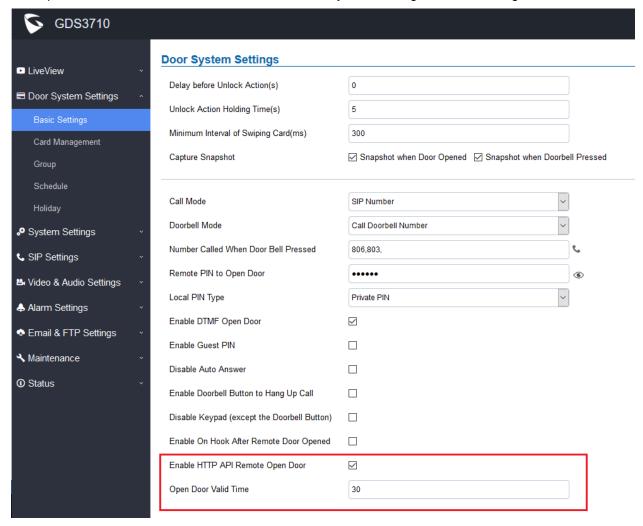

Functionality

Allow 3rd party system integrator or developers to implement related application for users. Details please refer to User Menu or the sample HTML utility from Grandstream.

The Open Door Valid Time is a time window which allows the HTTP API to work when handing those HTTP API command, this is opened for user to configure based on the environment implemented.


For example, if the time is 30 seconds, then after initial HTTP API, within 30 seconds the valid command with correct authentication code should be received otherwise will time out and wait for new CLI.



SELF-DEFIND EVENT NOTIFICATION MESSAGE

Web Configuration

This option can be found under device web UI→ Maintenance → Event Notification:

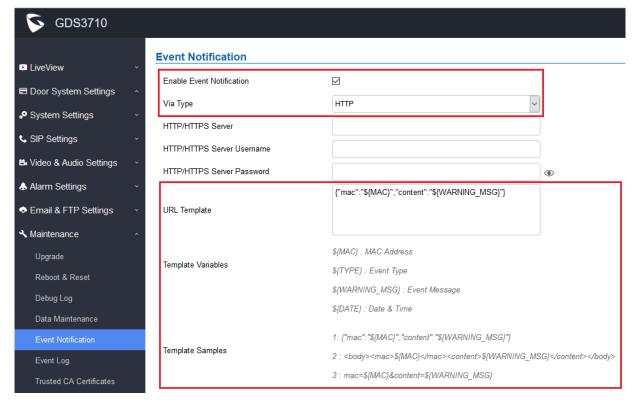

Functionality

This feature allow the 3rd party system integrator or developer to implement Centralized Control or Monitor system (e.g.: the Cloud) to provide related service. Sample Event Notification Template illustrated in the webGUI. More details please refer to User Menu.

New Pvalue

P-Value	Values	Default Value	Comments
P15424	2- Disable	0	Enable HTTP API
	3- Enable		Remote Open Door
P15428	5~300	30 (In Seconds)	Open Door Valid Time
P15417	1: HTTP; 2: HTTPS	1	Via Type
P15416	String	{"mac":"\${MAC}",	URL Template
		"content":"	
		\${WARNING_MSG}"}	



FIRMWARE VERSION 1.0.3.31

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

04/23/2018

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement.

IMPORTANT UPGRADING NOTE

- Local firmware upgrade recommended.
- Please download and use the utility provided by Grandstream for local firmware upgrade, avoiding internet or power interruption to brick the device.
- Factory Reset is recommended after upgrading from old 1.0.1.x or 1.0.2.x firmware.
- Please backup data before performing factory reset then restore back the data.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	

ENHANCEMENT

- "Enable Doorbell Button to Hang Up Call" set as default value.
- Optimized ONVIF timezone settings and webGUI display.
- Added ability to disable certificate validation.
- Added event log and notification to System Up/Reboot/Reset/ConfigUpdate/FirmwareUpdate
- Added support for uploading Trusted CA Certificates
- Added "Unregister On Reboot" as default
- Added bad block handling schema in cache
- Added LED flash in pattern to indicate the provisioning process.



BUG FIX

- Fixed slow keypad response issue in some scenarios.
- Fixed Privacy Masks may fail sometimes if modifying audio codec or video resolution configuration.
- · Fixed system no error prompt if configure IP address and Gateway incorrect.
- Fixed error when importing OSD text and alarm phone list in P value.
- Fixed the display format of time incorrect even the correct format chosen.
- Fixed at some noisy environment AEC broken causing echo at far side.
- Fixed backlight not off after RFID card swiped.
- Fixed sometimes device blocked, keypad dead without key tone and blue light, cannot make or accept SIP calls, no video and audio.
- Fixed not sending HTTP POST to the HTTP server.
- Fixed PIN Open Door stop working if DNS resolution failed
- Fixed incorrect password login issue and no password recovery email configured click "Save" showing the mailbox testing successful.
- Fixed the FTP configuration page the hint error and storage place error.
- Fixed SIP NOTIFY with resync event reboot the device issue.
- Fixed MD, Tamper Alarm, etc. snapshots storage location error.
- Fixed the device may reboot if enable HTTP server and Motion Detection.
- Fixed continuous MD events in long period of time could cause device no response to keypad and card swipe, and video continuously reconnecting.
- Fixed Group Adding Schedule Failure.
- Fixed Time Zone missing BagRep. Kiev (capital of Ukraine).

KNOWN ISSUES

- Video JPEG stream will fail in GXP audio phones when NAT involved.
- The SIP phone sending DTMF to GDS may sometimes hand up and clear the call
- · Allowing to accept multiple calls at the same time
- Device will fail to send DNS resolution when Stun Server using FQDN (only IP Stun works)
- The 2nd outbound proxy will not use the DNS-SRV parsing domain name.
- Device will not update to new IP after switching the network until after reboot.
- Device will not prompt error if IP address and Gateway configured incorrect.
- When unlocking latency is not zero, swiping card cannot clear unestablished SIP call.
- The HTTP web access device may appear close_wait
- The option may crash if click the "Local Configuration Function"
- IP address obtained by LLDP may be wrongly disabled.



NEW FUNCTIONS

Key Function Modification:

- 1. Depending on the first key input is "*" or numeric digit, the device will treat this as "password input" or "extension number input" separately and Doorbell button will not function in this scene (not the first input) until the task finished or timeout.
- 2. If the first key input is Doorbell, device will treat this as calling the preconfigured numbers or IP addresses, then all other key input (like input local PIN to open door) will be disabled until the doorbell call finished or timeout.
- 3. When call in ringing stage before connected, all the keypad input will be disabled and no response, unless "Enable Doorbell Button to Hang Up Call" selected (default), then press the doorbell button can end the call. Otherwise if "Enable Doorbell Button to Hang Up Call" deselected, call cannot be terminated from GDS keypad, the connected call will be terminated by far end and unconnected call will be ringing timeout.
- 4. When call established, all the keypad input will be treated as DTMF.

• Alarm Modification

- When there are continuously alarm events in 30 minutes and every minute there is at least one new alarm event and alarm not be taken care, then the device will reduce the alarm frequency in next 10 minutes to save system resource. Instead of constantly sending out alarm, the device will send out one alarm in every 10 minutes, instead of sending lots of alarms, giving the above condition not changed.
- 2. If the next 10 minutes the condition not met, the device will restore back to normal alarm cycle to send out alarm.
- 3. If the above condition not satisfied, the device will use normal alarm cycle to send out alarm event report. That means if there is only one or less alarm event in every one minute, the device will just send out the alarm event when it happened.

NEW P-VALUE

P-Value	Values	Default Value	Comments
P8463	4- Disable	0	Validate Server Certificates
	5- Enable		
P8433-P8438	<string></string>		Trusted CA Certificates
			Files
	Max.length=4096		



NEW HTTP API

<pre><parameter>=<value></value></parameter></pre>	Page	Values	Comments
P8463= <int></int>	Upgrade	0,1	Validate Server Certificates
type= <string></string>	Trusted CA Certificates	trustedca	Get Trusted CA Certificates info
P8433-P8438=< string >	Trusted CA Certificates	string	Trusted CA Certificates Files

NEW FEATURES OVERVIEW

This section lists major new features or improvement and describes how to use it from the user's point of view.

DOOR SYSTEM SETTINGS

Web Configuration

This option can be found under device web UI→Door System Settings →Basic Settings:

Door System Settings Delay before Unlock Action(s) 0 Unlock Action Holding Time(s) 5 Min. Interval of Swiping Card(ms) 300 ✓ Unlock ✓ Doorbell Pressed Capture Image Call Mode SIP Number Doorbell Mode Call Doorbell Number Number Called When Door Bell Pressed 803,806, Remote PIN to Open the Door (6) ~ Local PIN Type Private Card PIN Enable DTMF Open Door ~ Enable Guest PIN Disable Auto Answer Enable Doorbell Button to Hang Up Call Disable Keypad (except Doorbell Button) Enable On Hook After Remote Unlock



Functionality


Several new functions has been revised for the wording:

- 1. Added taking snapshot when doorbell pressed.
- 2. Added lock keypad (only Doorbell working)
- 3. Added automatic clear the call when door opened.

MULTI-CHANNEL CALL MODE

Web Configuration

This option can be found under device web UI→SIP Settings → SIP Advanced Settings:

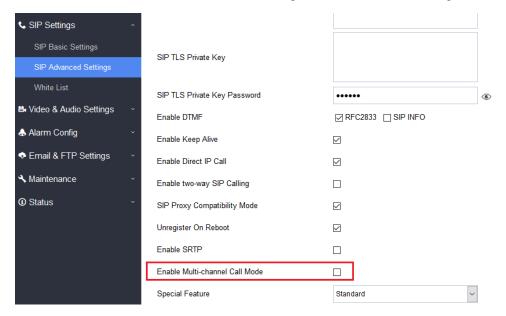

Functionality

This feature allow the device to receive multiple calls at the same time, with one active and others on hold (up to 4 calls maximum). The first call the blue LED light will light up keypad digit "1", 2nd call will light up keypad digit "2", and so on. On hold call will have related digit blinking while active call will have the digit blue LED solid light up. Call can be switched by pressing the blinking digits.

The default value is disabled, the device can only take ONE call at one time.

New Pvalue

Pvalue	Description	Value Range	Default
P15427	Configure Multi- Channel Call Mode	Value = 0, Disable Value = 1, Enable	0, Disable



FIRMWARE VERSION 1.0.3.23

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A, 1.7A)

DATE

01/10/2018

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement.

IMPORTANT UPGRADING NOTE

- Once upgraded to 1.0.3.x firmware, downgrading to 1.0.2.x or previous lower firmware version is NOT SUPPORTED.
- <u>Factory Reset</u> is recommended after upgrading from old 1.0.1.x or 1.0.2.x firmware.
- Please backup data before performing factory reset then restore back the data.

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	
GDS3710 HW1.7A	YES	

ENHANCEMENT

- Improved the tool tip content of "Central Mode"
- Improved the Doorbell Sound
- Added Standard Mode and Broadsoft Mode in SIP Settings, Broadsoft Supported.
- Improved some webGUI language and Tool Tip language.
- Added card ID number and phone number reported in event log message.
- Added "Click-to-Dial" feature support.

- Fixed DHCP Option66 function invalid
- Fixed (Broadsoft) HTTP download fail when the URL contains double slash
- Fixed Session Timer on by default



- Fixed issues with Broadsoft Certificate
- Fixed audio collection failure when continuously pressing keys and swiping cards
- Fixed LLDP enabled SIP failed to register
- Fixed enabled silent alarm the Doorbell played.
- Fixed multiple RFID cards sharing same virtual number will cause private password invalid.
- Fixed GDSManager open door remotely the GDS3710 will not capture snapshot even configured.
- Fixed only calling first number in the alarm list
- Fixed confliction between Lock Keypad and Disable Auto Answer.
- Fixed mailbox configuration page cannot be closed.
- Fixed Wiegand keys output does not support private card PIN and private PIN.
- Fixed configuration file suffix displayed incorrectly.
- Fixed HTTPS failed to download the configuration file if file name with capital letters.
- Fixed alarm number deleted the device will still call the alarm phone when triggered.
- Fixed swipe card successfully will not cancel the unestablished SIP call.
- Fixed enable zero configuration will cause device reboot and download wrong data from UCM.
- Fixed text spelling error in Alarm Mail content.

KNOWN ISSUES

- Occasionally the keypad will slow or no response to the input but will recover in seconds
- The SIP phone sending DTMF to GDS may sometimes hand up and clear the call
- Allowing to accept multiple calls at the same time
- The 2nd outbound proxy will not use the DNS-SRV parsing domain name.
- GDS will not prompt when IP address and Gateway inconsistent.
- Device will not update to new IP after switching the network until after reboot.
- Modify audio codec and video resolution may cause privacy failure occasionally.
- When unlocking latency is not zero, swiping card cannot clear unestablished SIP call.

NEW P-VALUE

- P15425 Enable Wiegand Output Authentication
- P14121 Wiegand Output
- P6767 Firmware Upgrade Method
- P192 Firmware Server Path
- P6768 Firmware HTTP/HTTS User Name
- P6769 Firmware HTTP/HTTS Password
- P232 Firmware Upgrade File Prefix
- P233 Firmware Upgrade File Postfix
- P193 Automatic Upgrade Interval (Minutes)
- P212 Config Upgrade Method
- P237 Config Server Path
- P6776 Config HTTP/HTTS User Name



P6777 Config HTTP/HTTS PasswordP234 Config Upgrade File Prefix

• P235 Config Upgrade File Postfix

• P2495 Enable Session Timer. 0: No. 1: Yes. Default is 0

P424 Special Feature. 100: Standard. 102: Broadsoft. Default is 100

P1360 HTTP/HTTPS User NameP1361 HTTP/HTTPS Password

NEW HTTP API

cmd= <string></string>	call	http sip call cmd	
Call_type= <int></int>	<0 1>	0: end call 1: call	
Call_num= <string></string>		Call num or IP	
P15425= <int></int>	<0 1>	Enable	
		Wiegand Output	
		Authentication	
		0: Disable	
		1: Enable	
P14121= <int></int>	<0 1 2>	Wiegand Output	
		0: Disable	
		1: Relay and Local	
		authentication	
		2: Relay and Bypass local	
P6767= <int></int>	<0 1 2>	Firmware Upgrade Method	
		0: TFTP 1: HTTP	
		2: HTTPS	
P192= <string></string>		Firmware Server Path	
P6768= <string></string>		Firmware HTTP/HTTS User	
		Name	
P6769= <string></string>		Firmware HTTP/HTTS	
		Password	
P232= <strng></strng>		Firmware Upgrade File Prefix	
P233= <strng></strng>		Firmware Upgrade File Postfix	
P193= <int></int>	60 - 525600	Automatic Upgrade Interval	
		(Minutes)	
P212= <int></int>	<0 1 2>	Config Upgrade Method	
		0: TFTP 1: HTTP	
		2: HTTPS	
P237= <string></string>		Config Server Path	
P6776= <string></string>		Config HTTP/HTTS	
		User Name	
P6777= <string></string>		Config HTTP/HTTS Password	
P234= <strng></strng>		Config Upgrade File Prefix	
P235= <strng></strng>		Config Upgrade File Postfix	



NEW FEATURES OVERVIEW

This section lists major new features and describes how to use it from the user's point of view.

CENTRAL MODE

Web Configuration

This option can be found under device web UI→Dorr System Settings →Basic Settings →Card and Pin Schedule Configuration Mode.

Card and Pin schedule configuration Mode



Functionality

This feature only works with GDSManager. If enabled, Card Infor, Group, Schedule, Holiday can be synchronized with CentralServer (aka: GDSManager). No matter information revision on Central Side or on individual GDS side, this feature will make the information synchronized, from GDSManager to GDSs, or vice versa. Otherwise the revised information will only updated locally. Default is Disabled.

New Pvalue

Pvalue	Description	Value Range	Default
P15301	<new pvalue=""> Central Mode</new>	0 / 1 (0:Disable 1:Enable)	0

BROADSOFT MODE

Web Configuration

This option can be found under device web UI→SIP Settings → SIP Advanced Settings → Special Feature.



Functionality

This feature allow GDS to be compatible with Broadsoft softswitch. When enabled, the GDS will be able to be automatically mass provisioned and controlled by Broadsoft Server and provide features and services in that platform according.




Pvalue	Description	Value Range	Default
P424	Configuration Special Features	Value = 100; Standard Value = 102; Broadsoft	100, Standard

CLICK TO DIAL

Web Configuration

This feature allows user to log into the GDS webGUI and call out from GDS via browser. Administration privilege is required to use this function.

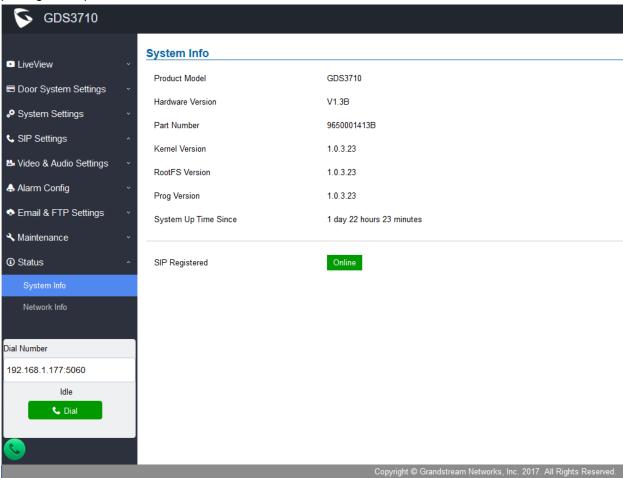

Functionality

User can input and dial SIP extension number or phone number if the GDS registered to an operating SIP server/proxy. If no SIP server involved, user can still input the IP address and port number of a known IP video phone or audio phone in the same LAN.





FIRMWARE VERSION 1.0.3.13

PRODUCT NAME

GDS3710 (HW Supported: 1.3A, 1.3B, 1.5A, 1.6A)

DATE

12/3/2017

SUMMARY OF UPDATE

This is **MAJOR UPDATE** with new SDK.

Strongly recommend users to back up all the data (both configuration and application) before update, also perform factory reset if the previous firmware is old version in different lever.

IMPORTANT UPGRADING NOTE

- Once upgraded to 1.0.3.x firmware, downgrading to 1.0.2.x or previous lower firmware version is NOT SUPPORTED.
- Factory Reset is recommended after upgrading from old 1.0.1.x or 1.0.2.x firmware.
- Please backup data before performing factory reset then restore back the data

FIRMWARE APPLIES TO BELOW HW VERSION ONLY

HW version	FW	Comments
GDS3710 HW1.3A	YES	Only support HTTP upgrade image
GDS3710 HW1.3B	YES	Only support HTTP upgrade image
GDS3710 HW1.5A	YES	
GDS3710 HW1.6A	YES	

NEW P-VALUE

•	Take snapshot when press keypad	P15420=0/1 0: Disable 1: Enable
•	Enable Button to On Hook	P14582=0/1 0: Disable (Default) 1: Enable

Disable Keypad
 P15421=0/1 0: Disable (Default) 1: Enable
 Fnable Uplock to On Hook
 P15422=0/1 0: Disable (Default) 1: Enable

Enable Unlock to On Hook
 Secondary Outbound Proxy
 P15422=0/1 0: Disable (Default) 1: Enable
 P2433=string Max.Length=255

Secondary Outbound Proxy
 Enable two-way SIP Calling
 Card Issuing State Expire Time(m)
 P2433=string Max.Lengtri=255
 P8001=0/1 0: Disable 1: Enable
 P15423=1-1440

Card Issuing State Expire Time(m)
 Enable Log Reporting
 HTTP Server Host
 P15423=1-1440
 P15410=0/1 0: Disable 1: Enable
 P15411=string Max. Length=128

HTTP Server Host P15411=string Max. Lengtn=128
HTTP Server Port P15412=0-65535

HTTP Server URL
 HTTP Server Username
 HTTP Server Password
 P15413=string Max.Length=256
 P15414=string Max.Length=128
 P15415=string Max.Length=128



ENHANCEMENT

- Improved the tool tip content of "Central Mode"
- Added option to disable alarm sound at phone side when event trigger SIP call to the phone.
- Increased maximum characters to 256 in "Number called when doorbell pressed" to allow serial hunting
 of SIP extensions or IP address with port or mixing of both, with each ring several seconds before going
 next.
- Added if schedule disabled, GDS3710 will bypass the option to open door.
- Enhanced the "Registration Expiration" timer settings.
- Adjusted some default values and its P values.
- Added feature to capture snapshot when doorbell pressed.
- Added feature to disable keypad input (lock keypad) and ONLY doorbell button can be pressed.
- Revised the tooltips of DI Open Door (alarm_in and alarm_out tooltips).
- Added option to disconnect call automatically after door open event.
- Added timer to expire Card Issuing Mode automatically.
- Added option to enable/disable call termination when OpenDoor Button (in the SIP phone side) pressed.
- Added ability for whitelist entries to open door using remote PIN.
- Implemented the HTTP Upload (RFID card) Log Event support for 3rd party Software Integration.
- Updated feature code input rule for *# or ** for doorbell and end operation in 2 seconds if pressed wrong.
- Added VLAN and Priority Parameters in the LLDP settings.

- Fixed LLDP function not valid and IP will not automatically set to static if wrong VLAN Tag set.
- Fixed Wiegand lamp does not light up green when remote PIN entered to open door.
- Fixed Alarm Events Configuration displayed incorrectly.
- Fixed WDR mode very bright spot becoming pink issue and put back the WDR feature.
- Fixed swipe card still capture image even "capture image on unlock" unselected.
- Fixed unable to import the system configuration data.
- Fixed revising P value file with string like Holidays can still be imported
- Fixed using Hostage Code to open door if "capture image on unlock" un-checked, the device will not capture and upload the capture image.
- Fixed video cannot connect after motion detection alarm triggered.
- Fixed invalid P value in Holidays.
- Fixed SIP number is IP address and GDS as callee, DTMF unable to open door.
- Fixed GDS3710 cannot be searched and added by GVR355X NVR
- Fixed switch network the device restart
- Fixed network status page displayed error with default IP 192.168.1.168



- Fixed Group Information cannot be synchronized with GDSManager.
- Fixed initial delay in the audio call.
- Fixed * and ** not allowed in "Number called when doorbell pressed".
- Fixed cannot handle IPPBX feature code "**"
- Fixed card information cannot be modified with IE9.
- Fixed DTMF set to SIP INFO or RFC2833, the open door function is invalid.
- Fixed device not reboot after receiving check-sync SIP message.
- Fixed STUN server filled the device will not send out Keep Alive packet.
- Fixed enable LLDP reboot the device will not do SIP registration.
- Fixed the PIN format is not consistent depending on In or Out call directions
- Fixed the schedule importing failed.
- Fixed DTMF cannot dial out from GDS3710 to interact with IVR.
- Fixed Guest PIN time duration unable to save.
- Fixed one-way audio issue in SIP call.
- Fixed in some network environment enable LLDP sometimes the device will not get IP address.
- Fixed using FQDN SIP domain name sometimes cause the key press no response.
- Fixed swipe card successfully the established unanswered SIP call by pressing doorbell not cancelled.
- Fixed keypad locked but the blue light still response to keypad pressing, should be no response.
- Fixed initial audio delay when audio call established.
- Fixed noise audio issue at the GDS output/speaker.
- Fixed invalid RFID card its mapped SIP extension can still remote open door by SIP call.
- Fixed if muted key tone, the wrong password input without prompt tone.
- Fixed UCM zero configuration the data pushed from UCM to GDS will not synchronized in GDS webGUI display.
- Fixed OSD time set for 12H the display in LiveView is not complete.
- Fixed card management page the information cannot be modified.
- Fixed when changing audio codec to G.722, the volume suddenly becomes louder.
- Fixed illegal format file imported to card management page without prompt warning.

KNOWN ISSUES

- The SIP phone sending DTMF to GDS may sometimes hand up and clear the call
- The alarm email text content may have error characters.
- When Doorbell On Hook uncheck but call established, press the button during the call in session will actually initial a new call and hold current call.
- GDS will accept new incoming call and automatically hold previous call but cannot get out of hold for previous call. GDS should reply 486 and reject all new incoming call when 1st call established.
- The 2nd outbound proxy will not use the DNS SRV parsing domain name.
- Occasionally the keypad will slow or no response to the input but will recover after seconds



NEW FEATURES OVERVIEW

This section lists major new features and describes how to use it from the user's point of view.

CENTRAL MODE

Web Configuration

This option can be found under device web UI→Dorr System Settings →Basic Settings →Card and Pin Schedule Configuration Mode.

Card and Pin schedule configuration Mode



Functionality

This feature only works with GDSManager. If enabled, Card Infor, Group, Schedule, Holiday can be synchronized with CentralServer (aka: GDSManager). No matter information revision on Central Side or on individual GDS side, this feature will make the information synchronized, from GDSManager to GDSs, or vice versa. Otherwise the revised information will only updated locally. Default is Disabled.


New Pvalue

Pvalue	Description	Value Range	Default
P15301	<new pvalue=""> Central Mode</new>	0 / 1 (0:Disable 1:Enable)	0

DISABLE ALARM SOUND AT PHONE SIDE FOR TRIGERED SIP CALL

• Web Configuration

This option can be found under device web $UI \rightarrow SIP$ Settings $\rightarrow SIP$ Advanced Settings \rightarrow Enable two-way SIP Calling.



Functionality

This feature allow GDS to start two-way audio immediately at event triggered alarm calls. Default is checked, the alarm call triggered from GDS to phone will play pre-recorded Siren sound to the phone (user at phone side can press any key from the phone to stop Siren sound and start two-way communication).



Pvalue	Description	Value Range	Default
P8001	Enable two-way SIP Calling	Value = 0; Disabled Value = 1; Enabled	1: Enabled

CAPTURE IMAGE WHEN DOOR BELL PRESSED

Web Configuration

This option can be found under device web $UI \rightarrow Door$ System Settings \rightarrow Basic Settings.

■ Door System Settings ^		
Pania Cattinga	Unlock Hold Time(s)	5
Basic Settings	Outing Conditionals (see	200
Card Management	Swipe Card Intervals(ms)	300
Group	Capture Image	☑ Unlock ☐ Pressed doorbell button

Functionality

This feature allow GDS to take snapshot and upload to Central Server (GDSManager) or FTP server or send email attachment using preconfigured email account. Default is take snapshot when door unlocked.

New Pvalue

Pvalue	Description	Value Range	Default
P15420	Capture Image on Pressing Doorbell	Value = 0; Disabled Value = 1; Enabled	0: Disabled

DISABLE KEYPAD

Web Configuration

This option can be found under device web UI \rightarrow Door System Settings \rightarrow Basic Settings.

Enable Doorbell Button to Hang Up Call	
Disable Keypad	

Functionality

This feature allow user to lock and disable all keypad except the doorbell, so only press doorbell the GDS will be response. This meets some special usage scene where user only wants the doorbell.



Pvalue	Description	Value Range	Default
P15421	Disable Keypad	Value = 0; Disabled Value = 1; Enabled	1: Enabled

ENABLE REMOTE UNLOCK TO ON HOOK

Web Configuration

This option can be found under device web UI→Door System Settings → Basic Settings.

Functionality

This feature will allow GDS to clear the call 5 seconds after the phone side successfully opened the door remotely. This will be convenient for IP phone users in case using hands free or speaker mode opening door remotely but forgetting hand up the phone to clear the call.

New Pvalue

Pvalue	Description	Value Range	Default
P15422	Enable Remote Unlock to On Hook	Value = 0; Disabled Value = 1; Enabled	0: Disabled

DISABLE AUTO ANSWER

Web Configuration

This option can be found under device web $UI \rightarrow Door$ System Settings \rightarrow Basic Settings.

Enable Guest PIN	
Disable Auto Answer	

Functionality

This feature allow to disable the default Auto Answer feature of the GDS door phone. The GDS will keep on ringing when called until someone press any button to pick up the call. This feature is for some special usage scenarios. Default is enable and GDS is in Auto Answer mode.



Pvalue	Description	Value Range	Default
P14580	Disable the Auto Answer of GDS	Value = 0; Disabled Value = 1; Enabled	1: Enabled

ENABLE DOORBELL BUTTON TO HANG UP CALL

Web Configuration

This option can be found under device web UI→Door System Settings → Basic Settings.				
Enable Doorbell Button to Hang Up Call				
Disable Keypad				

Functionality

This feature allow doorbell button to be pressed to hand up the ongoing call, in case the number dialed is wrong or the callee is not available to answer the call made from the GDS door phone. Default is disabled.

New Pvalue

Pvalue	Description	Value Range	Default
P14582	Enable the Doorbell Button to Handup Call		0: Disabled

CARD ISSUING STATE EXPIRED TIME

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings → Card Issuing State Setting → Enable Card Issuing Mode

Card Issuing State Setting		
Enable Card Issuing Mode	☑	
Card Issuing State Expire Time(m)	5	



Functionality

This feature will only available when "Enable Card Issuing Mode" select and enabled. The default value is 5 minutes. This feature will allow GDS to exist from the Card Issue Mode when the configured timer expired, This will help to prevent the human error in case the "Card Issuing Mode" is enabled and not restore back to the normal operation mode therefore the GDS is not operating as usual.

New Pvalue

Pvalue	Description	Value Range	Default
P15423	Card Issuing Mode Effective Timer	Value Range (in Minutes): 1 ~ 1440	5 Minutes

LIGHT SETTINGS

Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings → Light Settings

Light Settings	
Enable Key Blue Light	\square
Enable Background Light	\checkmark

Functionality

This feature allow user to turn ON or OFF the Key Blue Light and the Background Light (White LED Light). Default both set of lights are On, so when key pressed the blue light will light up to show the key pressed, and the background white LED will light up to illuminate the user doing the operation.

New Pvalue

Pvalue	Description	Value Range	Default
P14800	Enable Key Blue Light	Value = 0; Disabled Value = 1; Enabled	1: Enabled
P14801	Enable Background Light	Value = 0; Disabled Value = 1; Enabled	1: Enabled



ENABLE DOORBELL BLUE LIGHT PER SETTINGS

• Web Configuration

This option can be found under device web UI → Door System Settings → Basic Settings.

Blue Doorbell Light Lighting Time Settings



Functionality

This feature allow doorbell button blue light turn ON and OFF based on configured time schedule. For example user can configure the doorbell button light up in Blue Light in the evening when environment is dark without enough illumination. Default is disabled.

New Pvalue

Pvalue	Description	Value Range (Pure Digital String)	Default
P14560	Doorbell Blue Light Start Time	MAX length is 6. Example: 125900 -> 12:59:00	000000
P14561	Doorbell Blue Light End Time	MAX length is 6. Example: 125900 -> 12:59:00	000000

ENABLE LOG REPORT

Web Configuration

This option can be found under device web UI → Maintenance → Log Manager.

Log Manager

Enable Log Reporting	abla	
HTTP Server URL		
HTTP Server Username		
HTTP Server Password		•



Functionality

This feature allow user to configure the Log Reporting feature via HTTP Server. The live log information will be sent to pre-configured HTTP Server for storage, diagnose and processing. The HTTP server can generate all kinds of related report based on the logs received. This is good for 3rd party redevelopment application usage.

New Pvalue

Pvalue	Description	Value Range	Default
P15410	Enable Log Reporting	Value = 0; Disabled, 1; Enabled	0: Disabled
P15413	HTTP Server URL	Format: http://ip:port/path e.g.: http://192.100.10.10:80/	String. Max. Length=256
P15414	HTTP Server Username	String, Max. Length=128	String
P15415	HTTP Server Password	String, Max. Length=128	String.



FIRMWARE VERSION 1.0.2.25

PRODUCT NAME

GDS3710 (HW Supported: 1.2A, 1.3A, 1.3B, 1.5A, 1.6A)

DATE

11/8/2017

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement

IMPORTANT UPGRADING NOTE

This version stopped <u>HW1.2A/1.3A/1.3B</u> fabrication support, still **support HTTP upgrade**. Firmware applies to below HW versions:

HW version	FW	Comments	
GDS3710 HW1.2A	YES	Only support HTTP upgrade image	
GDS3710 HW1.3A	YES	Only support HTTP upgrade image	
GDS3710 HW1.3B	YES	Only support HTTP upgrade image	
GDS3710 HW1.5A	YES		
GDS3710 HW1.6A	YES		

NEW P-VALUE

Enable Log Reporting
 HTTP Server Host
 HTTP Server Port
 HTTP Server URL
 HTTP Server Username
 HTTP Server Password
 P15410=0/1 (0: Disable 1: Enable)
 P15411=String (Max. Length=128)
 P15412=0-65535
 P15413=String (Max.Length=256)
 P15414=String (Max.Length=128)
 P15415=String (Max.Length=128)

ENHANCEMENT

- Added if schedule disabled, GDS3710 will bypass the option to open door.
- Implemented the HTTP Upload (RFID card) Log Event support for 3rd party Software Integration.



- Fixed the initial delay in audio call
- Fixed the time will not be updated by NTP server after GDS reboot.
- Fixed the password field displayed with error.
- Fixed special character can be save and stored in Unlock Hold Time
- Fixed the system basic page display abnormal issue.
- Fixed GDS3710 cannot be searched and added by NVR GVR355x (via ONVIF)
- Fixed the P value is invalid for holiday
- Fixed Group information cannot be synchronized with GDSManager.
- Fixed reboot device after enable LLDP, SIP account may not be able to register.
- Fixed delete the RFID card operation the cancel icon not working
- Fixed enable LLDP might not be able to get IP address via DHCP in some (VLAN) environment



FIRMWARE VERSION 1.0.2.22

PRODUCT NAME

GDS3710 (HW Supported: 1.2A, 1.3A, 1.3B, 1.5A, 1.6A)

DATE

09/18/2017

SUMMARY OF UPDATE

The main purpose of this release is bug fixes

IMPORTANT UPGRADING NOTE

- Once upgraded to 1.0.2.x firmware, downgrading to 1.0.1.x or lower firmware version is NOT supported.
- <u>Factory Reset</u> is recommended after upgrading from 1.0.<u>1</u>.x to 1.0.<u>2</u>.x.
- Please backup data before performing factory reset then restore the data

- Fixed when uncheck "center mode", GDSManager group relationship etc. will fail.
- Fixed group deleted, group status and information disabled but card swiping fail.
- Fixed DTMF function is invalid at some cases.
- Fixed in Privacy Mask page the Show MD Region is invalid.
- Fixed set to 12-hour display format will not take effect and show wrong format.
- Fixed Silent Alarm option displaying errors.
- Fixed DTMF option format displayed wrong in IE browser.
- Fixed deleted 2nd alarm receiving email account the email still delivering.
- Fixed personnel, gender displaying error when card number is 0
- Fixed Wiegand Output feature issue.



FIRMWARE VERSION 1.0.2.21

PRODUCT NAME

GDS3710 (HW Supported: 1.2A, 1.3A, 1.3B, 1.5A, 1.6A)

DATE

08/31/2017

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement

IMPORTANT UPGRADING NOTE

- Once upgraded to 1.0.2.x firmware, downgrading to 1.0.1.x or lower firmware version is NOT supported.
- Factory Reset is recommended after upgrading from 1.0.1.x to 1.0.2.x.
- Please backup data before performing factory reset then restore the data

ENHANCEMENT

- Allow config and call IP address format on SIP field when dialing the Virtual Number
- Added "Silent Alarm" Mode
- Added option Backup/Restore including all passwords like SIP/FTP/RemoteAccess, etc.
- Added schedule support for Card and PIN
- Added LLDP support
- Added database automatic backup and synchronization
- Modified WebGUI style
- Added card information batch delete option in the WebGUI
- Added option to enable "Motion Detection", "Tamper Alarm" and backlight partially light
- Added card user limitation up to 2000 and group limit to 50.
- Added Card and PIN schedule configuration Central Mode. If enabled, the Group/Schedule/Holiday
- could only be synchronized from the Central of the GDS Manager
- Added LDC Ratio Control and Adjustment
- Expended the range of Ring timeout
- Added option to disable Auto Answer
- Updated the "DingDong" tone when doorbell pressed
- · Added function to check the default value
- Added Factory Reset via special procedures. Details please refer to updated User Manual
- Added file upload/download (card information, configuration etc.) can be executed after authentication
- Added enforcement when admin password is changed via WebGUI, user has to fill in a Valid Email



• Account to retrieve the email before the new admin password taking effect

- Fixed Guest PIN invalid when modifying the guest pin conflicting with local PIN.
- Fixed the Blue Light turning off 1 minute late than configured time.
- Fixed SIP number is not displayed correctly at card management page.
- Fixed Holiday cannot display Chinese
- Fixed adjust resolution will make the Privacy Mask not working
- Fixed private door password displayed empty when PIN not configured
- Fixed error Email Format giving out confused prompt
- Fixed static IP with different subnet cannot be searched by GDSManager and GSuf_Pro
- Fixed Wiegand Output function is invalid sometimes.
- Fixed ONVIF device service restart issue
- Fixed adjust and save the Door System setting page will restart the SIP client process
- Fixed Digital Input if in Open State, the Alarm State should also be in Open State
- Fixed revise the Group, Schedule and Holiday cannot be saved
- Fixed Wiegand Input can be directed to different protocol of the device
- Fixed Wiegand Input can be used as personal PIN to open the door
- Fixed one invalid P-value will fail the entire XML file import
- Fixed delete the group should automatically switch to disable card in that group
- Fixed group not available to displayed when carried schedule with holidays
- Fixed Wiegand Input can still open door even the "Wiegand Input" disabled
- Fixed exported configuration file missing P values of group, schedule and holidays
- Fixed issue when editing the region of Privacy Masks
- Fixed DHCP Option 66 invalid issue
- Fixed phone hand up but the doorbell still ringing
- Fixed Motion Detection sensibility is abnormal
- Fixed mute Key Tone will cause RFID card not response
- Fixed using Wiegand Input successfully open door via password but LED of Wiegand device is wrong



FIRMWARE VERSION 1.0.2.13

PRODUCT NAME

GDS3710 (HW Supported: 1.2A, 1.3A, 1.3B, 1.5A, 1.6A)

DATE

06/26/2017

SUMMARY OF UPDATE

The main purpose of this release is bug fixes and feature enhancement

IMPORTANT UPGRADING NOTE

- Once upgraded to 1.0.2.x firmware, downgrading to 1.0.1.x or lower firmware version is NOT supported.
- <u>Factory Reset</u> is recommended after upgrading from 1.0.<u>1</u>.x to 1.0.<u>2</u>.x.
- Please backup data before performing factory reset then restore the data

ENHANCEMENT

- Supported ONVIF Profile S
- Added "Privacy Mask" support in Motion Detection Setting
- Updated OCX plugin engine to Version 3.1.0.74
- Added DTMF Open Door control option in WebGUI
- Supported HTTP API
- Optimized HTTP API for Card Management
- Added "enable blue doorbell light" option in the webGUI
- Added switch on the doorbell blue light by configured time period of the day.
- Implemented "Silent Alarm" mode
- Added HTTP API for getting snapshots and streams.
- Removed the size limit of load kernel



- Fixed reload data is invalid.
- Fixed privacy mask may not work when adjusting CMOS video settings
- Fixed the initialization of DO causing short pulse when power up the device.
- Fixed webGUI may lose access when switching audio codecs.
- Fixed after getting IP address, the webGUI may not be accessible immediately.
- Fixed adjusting Mode, LED and Power Frequency settings may cause abnormal shutter speed.
- Fixed the display error of time zone.
- Fixed P value not working for enable DTMF Open Door.



FIRMWARE VERSION 1.0.2.9

PRODUCT NAME

GDS3710 (HW Supported: 1.2A, 1.3A, 1.3B, 1.5A, 1.6A)

DATE

06/1/2017

SUMMARY OF UPDATE

The main purpose of this release is bug fixes to response to market feedback.

IMPORTANT UPGRADING NOTE

- Once upgraded to 1.0.2.x firmware, downgrading to 1.0.1.x or lower firmware version is NOT supported.
- <u>Factory Reset</u> is recommended after upgrading from 1.0.<u>1</u>.x to 1.0.<u>2</u>.x.
- Please backup data before performing factory reset then restore the data

ENHANCEMENT

- Corrected errors in local PIN type tool tips.
- Add back DTMF Open Door as optional choice, with user acknowledging the security risk.
- Revised "Alarm Output Duration(s)" choice option as 5/10/15/20/25/30 seconds.

- Fixed exporting file P value issue with Motion Detection data.
- Fixed changing the SSH port, it can be saved but cannot be accessed.
- Fixed device falling into reboot loop when failing to obtain IP address from network.
- Fixed ONVIF implementation causes automatic reboot due to memory leak.
- Fixed the initialization of DO causing short pulse when power up the device.
- Fixed back light and ring light issue when device rebooted.



FIRMWARE VERSION 1.0.2.5

PRODUCT NAME

GDS3710 (HW Supported: 1.2A, 1.3A, 1.3B, 1.5A, 1.6A)

DATE

05/18/2017

SUMMARY OF UPDATE

This firmware version is a MAJOR update, with lots of bug fixes and feature enhancement

IMPORTANT UPGRADING NOTE

- Once upgraded to 1.0.2.x firmware, downgrading to 1.0.1.x or lower firmware version is NOT supported.
- Factory Reset is recommended after upgrading from 1.0.1.x to 1.0.2.x.
- Please backup data before performing factory reset then restore the data

ENHANCEMENT

- Added folder creation and file arrangement if multiple GDS3710s are uploading snapshots to FTP server.
- Improved the password prompt wording.
- Added DTMF audio playing when key be pressed.
- Separated volume control in webGUI.
- Added "Audio, Snapshot, Recording and File Path Saved" operation with icons at Live View webpage.
- Added "show password" feature when the eye icon be clicked in the webGUI.
- Added prompt popup message when capture button clicked.
- Use different email title to separate the Motion Detection and Temperature Out of the Range alarm.
- Set initial value of "0" for Virtual Number and SIP number if user leaving the field empty.
- Added support open door remotely via GDS Manager utility (after GDS Manager version 1.0.0.78)
- Supported GXP color phone JPEG_Over_HTTP support with encryption and authentication.
- Added SSH support with default TCP port 22, obsolete TELNET.
- Added GS_Wave (Android/iOS) Application support for Open Door.
- Added PING function in SSH CLI interface.
- Enhanced webGUI login process and added random default password.
- Enhance security by disable the DTMF to open door
- Disabled WDR Mode (temporarily, will enable once the pink color bug fixed)
- Added support of sending DTMF tone in SIP calling (RFC2833, SIP INFO)



- Fixed web port and RTSP port not correct.
- Fixed exported system configuration data cannot be imported successfully.
- Fixed illegal or special characters can be saved into card number.
- Fixed non-digit characters can be saved into open door PIN field.
- Fixed abusively pressing keypad could make the key tone distorted and blue LED lighted abnormally.
- Fixed capture image not working when configured as "Card & Private PIN Mode".
- Fixed exported configuration file without speaker volume, key tone volume and doorbell volume.
- Fixed Motion Detection selected region failed to be restored when exported.
- · Fixed Option 66 feature not working.
- Fixed duplicated RFID card number can be added without prompt.
- Fixed the shutter speed not adjustable issue.
- Fixed failed test cases for ANATEL certification
- Fixed issue in peered IP Calling.
- Fixed P value cannot be written if the shutter speed is 1/5000.
- Fixed GDS3710 reboot cycle if P value is imported to the device incorrectly.
- Fixed firmware upgrade process could cause device to be automatically factory reset.
- Fixed Motion Detection sometimes abnormal issue.
- Fixed switching HTTPS to HTTP the port remain the same issue.
- Fixed cannot call GDS3710 via a number when peered with another device via IP.



FIRMWARE VERSION 1.0.1.19

PRODUCT NAME

GDS3710 (HW Supported: 1.2A, 1.3A, 1.3B, 1.5A)

DATE

03/06/2017

SUMMARY OF UPDATE

The main purpose of this release is bug fix and feature enhancement since \$1 Beta

ENHANCEMENT

- Added a button to view the password entered.
- Added "Guest Mode" for access control.
- Corrected some typo and wording reported.
- Added option to enable SIP extension call by dialing keypad directly.
- Removed the startup audio.
- Added OSD information into the alarm message title.
- Added RFIC card and Private PIN double authentication to improve the open door security.
- Added challenge-response algorithm to open door.
- Improved FTP snapshot filename by adding MAC address and event type.
- Update and improved G.722 AEC parameters.
- · Reduced alarm email and attachment.
- · Added function to allow all passwords been imported.
- Started one firmware file support from this version.
- Limited the remote PIN to open door to be pure digits only with maximum length of 8.
- Limited the maximum length of login password to be 32 characters.



- Fixed device still have sound when volume set to 0
- Fixed AEC may fail sometimes at some special audio scenarios.
- Fixed HTTP Upgrade request the user-agent does not contain device name, hardware version and software version information for provisioning.
- Fixed press door bell will hand up alarming phone call.
- Fixed web port changing from 443 to 80, HTTPS cannot be accessed.
- Fixed no P value for shutter speed and interval of swiping card.
- Fixed click the UPnP cannot access the web interface.
- Fixed email setting page prompting error after clicking "Save".
- Fixed open door operation will clear all the pending calls, leave ongoing call untouched.
- Fixed configuration data cannot be imported normally.
- Fixed alarm email with abnormal name.
- Fixed no prompt tone when guest not input PIN in the required time window.
- Fixed input the wrong PIN, then correct PIN, the device will not open door.
- Fixed the RTSP value range, should be set to 554-65535.
- Fixed the snapshot filename different in FTP and Email.
- Fixed guest PIN and Private PIN confliction issue.
- Fixed DHCP OPTION66 not working problem.
- Fixed alarm snapshot cannot be uploaded to the central storage server.
- Fixed open door via PIN the equipment log sometime not match the record.
- Fixed the web port and RTSP port is not correct
- Fixed Guest PIN open door issue.