GCC601X UC + Networking Convergence Solutions

System Firmware Release Notes

IMPORTANT UPGRADING NOTE

- [12/6/2024] [1.0.5.5 (SYS)] Due to changes in Application Filtering, users will no longer be able to downgrade to SYS 1.0.3.x or lower and PBX 1.0.25.41 or lower after upgrading to 1.0.5.5.
- [8/21/2024] [1.0.1.34 (SYS)] Supported new GCC601x models and blocked firmware downgrade to any older firmware than 1.0.1.34.
- [7/26/2024] [1.0.1.32 (SYS)] Changed the default value from Enable to Disable for "**Allow DHCP Option 43 and 66 to Override Server**" and "**Check/Download New Firmware at Bootup**". Upon upgrading from older version, these two options will be disabled. Please re-enable it if needed.

Table of Content

IMPORTANT UPGRADING NOTE 1

FIRMWARE FILE DOWNLOAD 5

FIRMWARE VERSION 1.0.7.82 (SYS) 6

PRODUCT NAME 6
DATE 6
FIRMWARE FILE INFORMATION 6
CHANGES/ENHANCEMENT 6

FIRMWARE VERSION 1.0.7.71 (SYS) 8

PRODUCT NAME 8
DATE 8
FIRMWARE FILE INFORMATION 8
CHANGES/ENHANCEMENT 8

FIRMWARE VERSION 1.0.7.69 (SYS)(BETA ONLY) 9

PRODUCT NAME 9
DATE 9
FIRMWARE FILE INFORMATION 9
CHANGES/ENHANCEMENT 9

FIRMWARE VERSION 1.0.7.59 (SYS) 10

PRODUCT NAME 10
DATE 10
FIRMWARE FILE INFORMATION 10
CHANGES/ENHANCEMENT 10

FIRMWARE VERSION 1.0.7.57 (SYS)(BETA ONLY) 11

PRODUCT NAME 11
DATE 11
FIRMWARE FILE INFORMATION 11
CHANGES/ENHANCEMENT 11
BUG FIXING 12

FIRMWARE VERSION 1.0.7.48 (SYS) 13

PRODUCT NAME 13
DATE 13

FIRMWARE FILE INFORMATION 13
CHANGES/ENHANCEMENT 13

FIRMWARE VERSION 1.0.7.46 (SYS) 14

PRODUCT NAME 14
DATE 14
FIRMWARE FILE INFORMATION 14
BUG FIXING 14

FIRMWARE VERSION 1.0.7.44 (SYS) 15

PRODUCT NAME 15
DATE 15
FIRMWARE FILE INFORMATION 15
CHANGES/ENHANCEMENT 15
BUG FIXING 18

FIRMWARE VERSION 1.0.7.14 (SYS) 19

PRODUCT NAME 19
DATE 19
FIRMWARE FILE INFORMATION 19
CHANGES/ENHANCEMENT 19

FIRMWARE VERSION 1.0.7.10 (SYS) 20

PRODUCT NAME 20
DATE 20
FIRMWARE FILE INFORMATION 20
CHANGES/ENHANCEMENT 20

FIRMWARE VERSION 1.0.7.5 (SYS) 21

PRODUCT NAME 21
DATE 21
FIRMWARE FILE INFORMATION 21
CHANGES/ENHANCEMENT 21

FIRMWARE VERSION 1.0.5.11 (SYS) 31

PRODUCT NAME 31
DATE 31
FIRMWARE FILE INFORMATION 31
CHANGES/ENHANCEMENT 31

FIRMWARE VERSION 1.0.5.6 (SYS) 32

PRODUCT NAME 32
DATE 32
FIRMWARE FILE INFORMATION 32
CHANGES/ENHANCEMENT 32

FIRMWARE VERSION 1.0.3.6 (SYS) 34

PRODUCT NAME 34
DATE 34
FIRMWARE FILE INFORMATION 34
CHANGES/ENHANCEMENT 34

FIRMWARE VERSION 1.0.3.5 (SYS) 35

PRODUCT NAME 35
DATE 35
FIRMWARE FILE INFORMATION 35
CHANGES/ENHANCEMENT 35

FIRMWARE VERSION 1.0.1.34 (SYS) 37

PRODUCT NAME 37
DATE 37
FIRMWARE FILE INFORMATION 37
CHANGES/ENHANCEMENT 37

FIRMWARE VERSION 1.0.1.32 (SYS) 38

PRODUCT NAME 38
DATE 38
FIRMWARE FILE INFORMATION 38
CHANGES/ENHANCEMENT 38

FIRMWARE VERSION 1.0.1.10 (SYS) 39

PRODUCT NAME 39
DATE 39
FIRMWARE FILE INFORMATION 39
CHANGES/ENHANCEMENT 39

FIRMWARE VERSION 1.0.1.8 (SYS) 40

PRODUCT NAME 40
DATE 40
FIRMWARE FILE INFORMATION 40
CHANGES/ENHANCEMENT 40

FIRMWARE FILE DOWNLOAD

Individual firmware files are available for downloading at URL below:

https://www.grandstream.com/support/firmware

FIRMWARE VERSION 1.0.7.82 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

11/05/2026

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: bfb77a19d895ec15ce9e8f98e5b09409

- GCC601x complete firmware file name: gcc601xfullyfw.bin

  MD5 checksum: 833a313ac467436e59729ffbc6ad0362

  (Including SYS 1.0.7.82 + PBX 1.0.27.100)

CHANGES/ENHANCEMENT

- **Security**: Removed distrusted emSign ECC Root CA – G3.
- **Security**: Fixed use-after-free (UAF) vulnerability in the Linux kernel's IPv4 TCP connection-handling stack (CVE-2026-98432).
- **Security**: Fixed Google Brotli compression decoder vulnerability CVE-2026-111497.
- Added option to run WAN speed test under local Web UI.
- Added "SIP Attack" option in IDS/IPS menu.
- Disabled OpenVPN LZO Compression by default to prevent security warnings and import errors.
- Updated Morocco time zone Africa/Casablanca from GMT+1 to GMT+0 (UTC+0).
- Fixed an issue where URL filtering does not accept hyphen (-) character.
- Fixed an issue where the Cairo time zone shows incorrect DST offset in standalone mode.
- Fixed an issue where the GCC does not discover an AP caused by traffic redirection.
- Fixed an issue where the GCC forwards RADIUS traffic through WAN interface instead of LAN interface.

- Fixed an issue where the GCC does not send DDNS update requests when uses PPPoE connection.
- Fixed an issue where import OpenVPN client configuration file fails due to invalid auth-user-pass syntax.
- Fixed an issue where Captive Portal returns HTTP 431 when managed by GCC.
- Fixed an issue where Fails to Forward SNMP Responses to LAN Client on UDP Port 161.
- Internal bug fixes.

FIRMWARE VERSION 1.0.7.71 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

8/11/2026

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 07c22d2c3c82d5c82a3ed6ef70eaf3ea

- GCC601x complete firmware file name: gcc601xfullyfw.bin

  MD5 checksum: 29675010e95ba6568f31e7c81c5b96a1

  (Including SYS 1.0.7.71 + PBX 1.0.27.94)

CHANGES/ENHANCEMENT

- Internal bug fixes.

FIRMWARE VERSION 1.0.7.69 (SYS)(BETA ONLY)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

7/14/2026

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 715ae66c57af4a316b90a801d505029f

- GCC601x complete firmware file name: gcc601xfullyfw.bin

  MD5 checksum: 0f8494e3ca9f71979eff145121f19c26

  (Including SYS 1.0.7.69 + PBX 1.0.27.94)

CHANGES/ENHANCEMENT

- Home / Networking / Firewall / Network Notes module supports permission management.
- Added LLDP info to clients list.
- Unlock GCC6021 port 25 - 27 for WAN configuration.
- Fixed an issue where the geographical location of the IP address is incorrect in Geo-IP filtering.
- Internal bug fixes.

FIRMWARE VERSION 1.0.7.59 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

4/17/2026

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: ee2282d933f921f48f76032db142fddc

- GCC601x complete firmware file name: gcc601xfullyfw.bin

  MD5 checksum: 62b21425f7e5b9b3f23d9cc51674c388

  (Including SYS 1.0.7.59 + PBX 1.0.27.94)

CHANGES/ENHANCEMENT

- Fixed an issue where the Wireguard has no access in some case.
- Internal bug fixes.

FIRMWARE VERSION 1.0.7.57 (SYS)(BETA ONLY)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

3/18/2026

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 1d5bcd21242300840fa316c54f09cad2

- GCC601x complete firmware file name: gcc601xfullyfw.bin


  MD5 checksum: b46d50c5491860a485e8ca776d782f1f

  (Including SYS 1.0.7.57 + PBX 1.0.27.94)

CHANGES/ENHANCEMENT


- **Networking**

  - **Network Settings → LAN → Bonjour Gateway:** Added support for Bridge mode

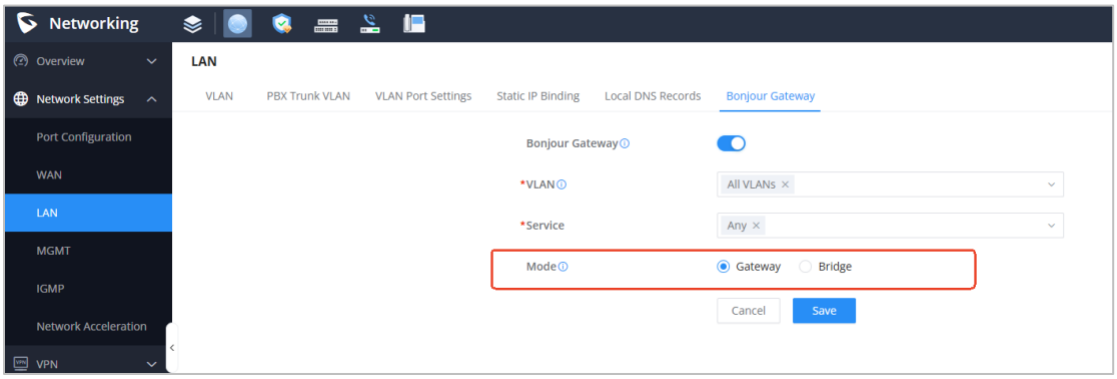

- **Network Nodes**

  - **Clients:** Added "Identity Name" information column

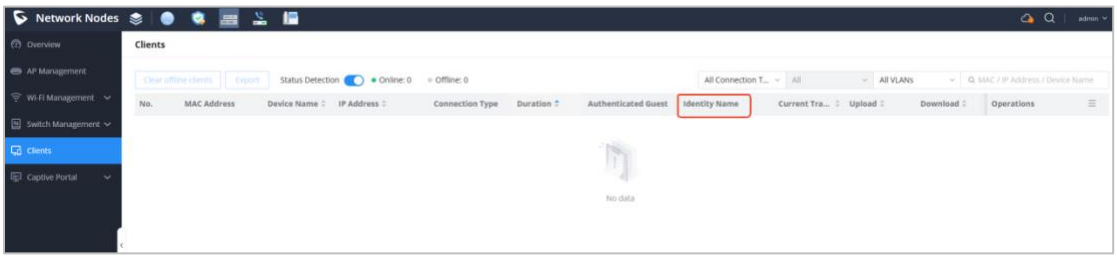

- **Supported number of VLAN**

Model	GCC6010	GCC6011	GCC6010W	GCC6020	GCC6021
VLAN	32	128	64	256	256

BUG FIXING

- Fixed an issue where the device does not synchronize system time correctly.
- Internal bug fixes.

FIRMWARE VERSION 1.0.7.48 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

9/18/2025

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 58f3d9225124b40c6f96692900516e90

- GCC601x complete firmware file name: gcc601xfullyfw.bin

  MD5 checksum: 0f1862b0bd9ff858926948b43e473381

  (Including SYS 1.0.7.48 + PBX 1.0.27.90)

CHANGES/ENHANCEMENT

- Added support for GDMS new IPsec option “Add Router LAN address”, which will allow the router to use its own LAN address to configure local subnet for VPN.
- Added support for USB 4G/5G dongle.

FIRMWARE VERSION 1.0.7.46 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

9/18/2025

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 8e748d405355f9c0012d5ce10db24185

- GCC601x complete firmware file name: gcc601xfullyfw.bin

  MD5 checksum: c6dc027a626e09bec0edd71ca7b84464

  (Including SYS 1.0.7.46 + PBX 1.0.27.90)

BUG FIXING

- Internal bug fixes

FIRMWARE VERSION 1.0.7.44 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

8/27/2025

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 24a69f2f7aeb85b9f5e183cddad0b515

- GCC601x complete firmware file name: gcc601xfullyfw.bin


  MD5 checksum: 88f3c1609ad8092734d44557f1694437

  (Including SYS 1.0.7.44 + PBX 1.0.27.89)


CHANGES/ENHANCEMENT

- **Home**
  - **Overview → Basic Information:** Added Security Versions.
  - **System Settings → Basic Settings:** Added **LED Indicator** configurations.
  - **System Settings → Security Settings → Web Access:** Added **Server Certificate**.
  - **System Settings → SMS Settings:** Added support for **Alibaba Cloud.**
  - **Maintenance → Backup & Restore:** Added support for changing backup file name.
  - **Setup Wizard:** Added session for quick firewall inbound policy configuration.
- **Networking**
  - **Network Settings → Port Configuration:** Added configuration for Port Name
  - **Network Settings → LAN → Static IP Binding:** Added support for VLAN setting

- **VPN:**
  - Added feature of **ZeroTier** VPN

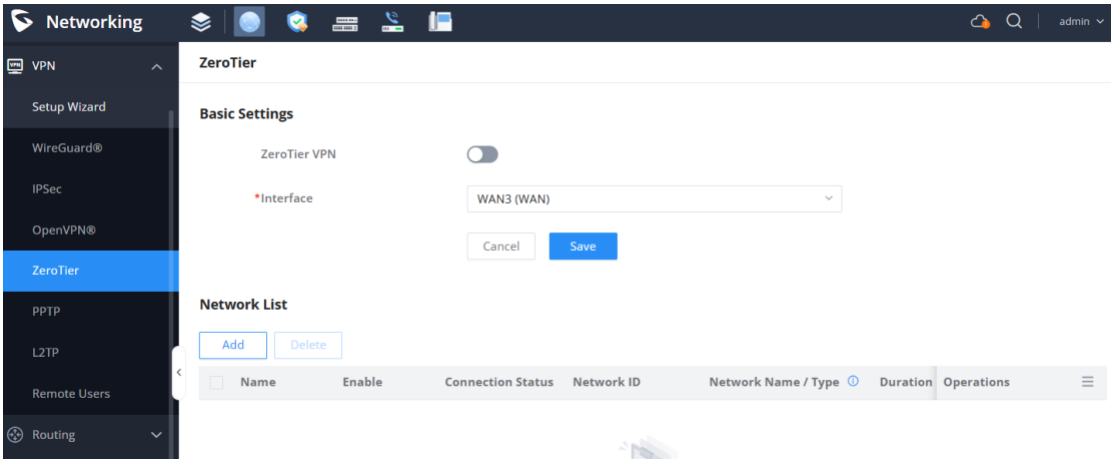


  - Added **Setup Wizard** of **ZeroTier**
  - Added feature of RADIUS authentication for **OpenVPN®**

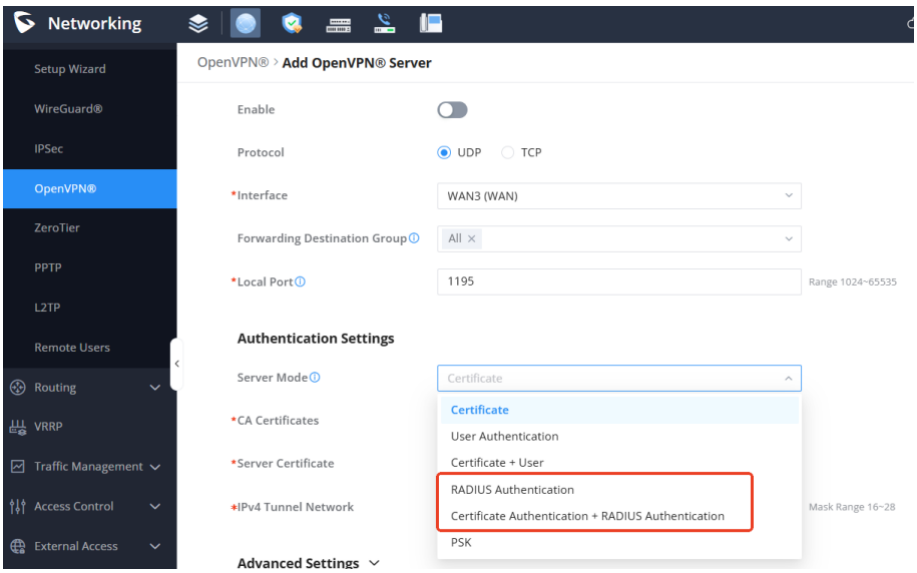


  - **External Access → DDNS:** Added support for custom service providers
  - **System Settings → File Sharing:** Added support of microSD and SSD external device

- **Firewall**
  - **Content Control**
    - **DNS Filtering:**


- Added VLAN configuration for web filtering and application filtering

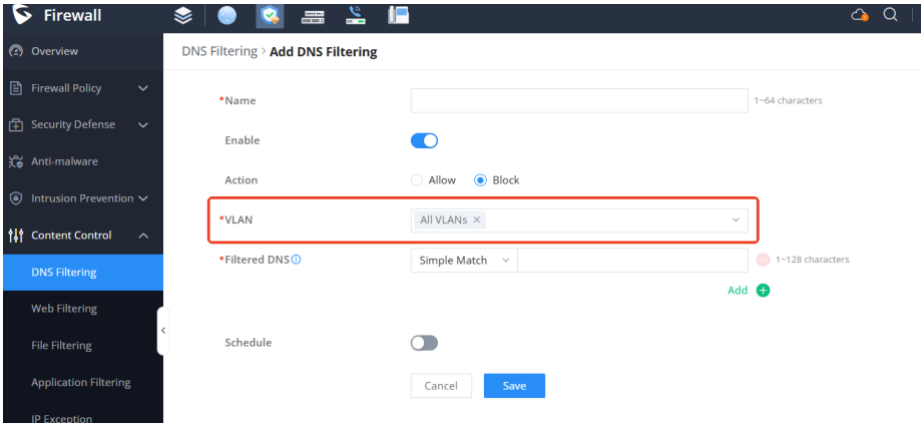


- Added DNS Filtering configuration and Redirect Blocked Webpage configuration

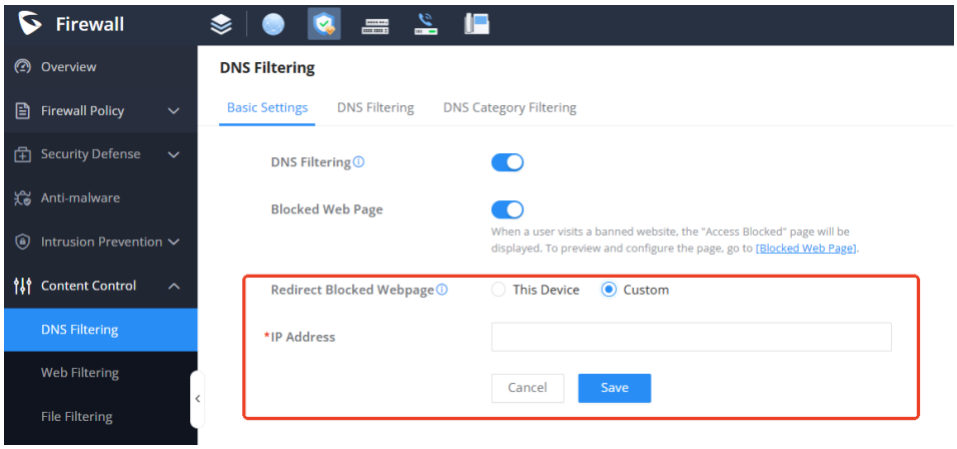

- Added new feature of File filtering

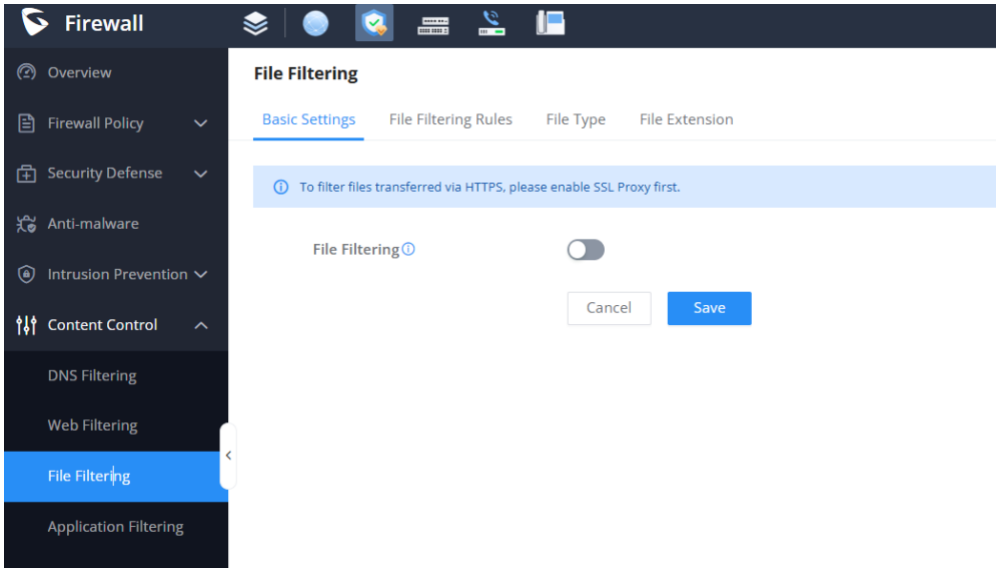

- **SSL Proxy → Basic Settings:** Added **Forced Proxy** and **Optional Proxy** configurations, and added **Built-in Domain Exemptions**

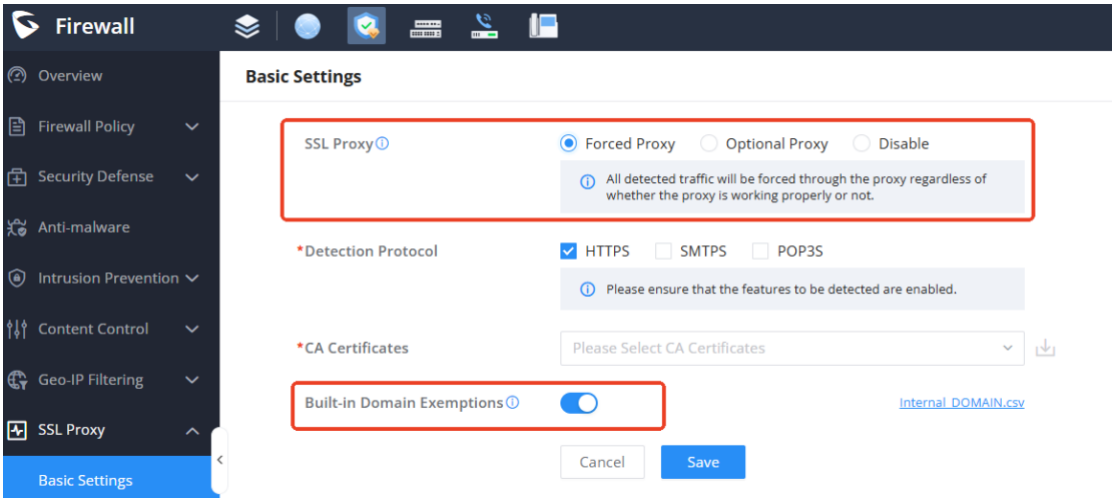

- **Security Log:** Added filter of **Firewall Policy**

- **Network Nodes**
  - **AP Management:** Added support for GWN767x models
  - **Switch Management:** Added support for GWN771x and GWN782x models
  - **Wi-Fi Management → SSIDs:** Changed the bandwidth limits for "Maximum Upstream Bandwidth" and "Maximum Downstream Bandwidth" to 1-10240 Mbps

BUG FIXING

- Fixed a bug that causes device unable to route traffic between OpenVPN® server and OpenVPN® client.
- Fixed a bug that IPS incorrect trigger for Intrusion.
- Fixed an issue that Wireguard VPN cannot handle Domains for Endpoint address.

FIRMWARE VERSION 1.0.7.14 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

8/6/2025

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: e4fb5f65bd96bf348bb8e035ae84cabf

CHANGES/ENHANCEMENT

- *Fixed a constant rebooting issue introduced on 8/2/2025 by virus signature lib update.

**Note: Do not need to upgrade this firmware if the unit was not affected by 8/4/2025.*

FIRMWARE VERSION 1.0.7.10 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

5/23/2025

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 41b1247288692db35096c26aea1e8686

- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

  MD5 checksum: 4fe23131df1d756fcd47afafa7ddf77a

  (Including SYS 1.0.7.10 + PBX 1.0.27.47)

CHANGES/ENHANCEMENT

- Internal bug fixes.

FIRMWARE VERSION 1.0.7.5 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

4/21/2025

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 125a3a460e8a392fde12a5e4a93c9bc9


- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

  MD5 checksum: f807833711e7378a28c2538e20a14da2


  (Including SYS 1.0.7.5 + PBX 1.0.27.44)

CHANGES/ENHANCEMENT

- **Home**
  - Added **Feedback** and **Remote Management (GWN App)** in the top bar admin dropdown menu.

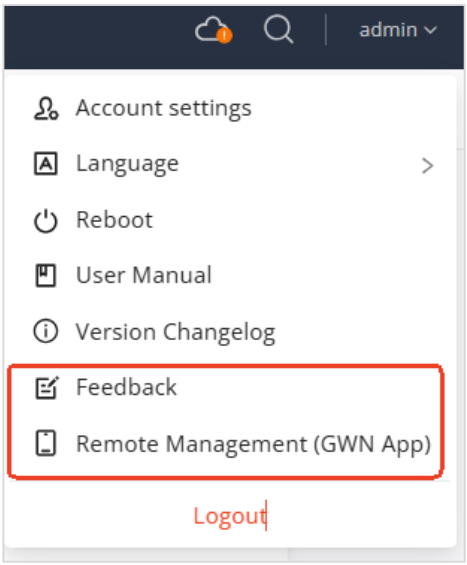


- Added **Real-time Session Statistics**, **Firewall service**, and **PBX** information in **Overview**.
- Added VLAN configuration when enabling **PBX** module.
- System Settings
    - Basic Settings
        - Fixed Asuncion time zone to UTC-3
        - Fixed Kazakhstan Almaty time zone to UTC+5
        - Added settings for multiple NTP server
        - Changed default time zone to UTC+00:00 Etc/Universal, country to Spain
    - Security Settings
        - Added **Multi-Factor Authentication** for **Accounts Settings**

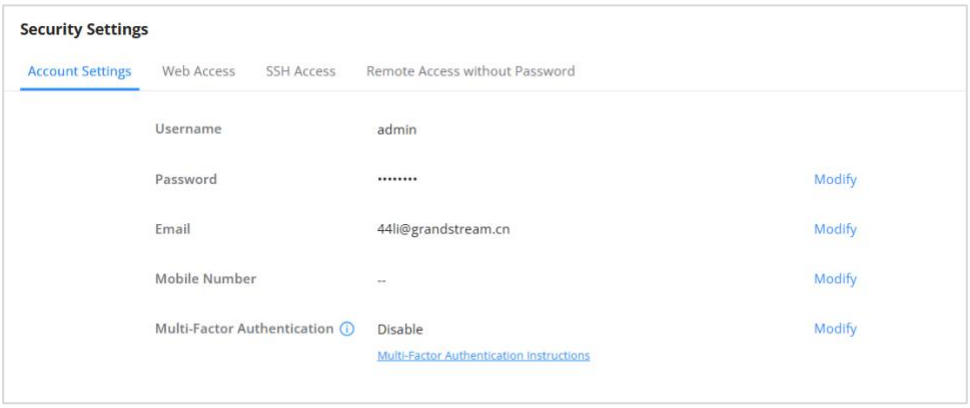

        - Added **Allowed IP Addresses** settings in **Web Access**
    - Schedule
        - Added a button of **Reference Details**, from which user can check to where the schedule is applied
- Maintenance
    - Upgrade
        - Added a factory reset prompt when downgrading to an incompatible firmware
- Log & Disgnostics
    - Added **Core Files** retrieval


- **Networking**
  - Network Settings:
    - WAN
      - Added **Bridge Mode**
      - Optimized the **Tracking IP** feature
    - LAN
      - Optimzed the Static IP Binding settings
  - VPN
    - Added **Setup Wizard** for **WireGuard®, IPsec, OpenVPN®, PPTP and L2TP**

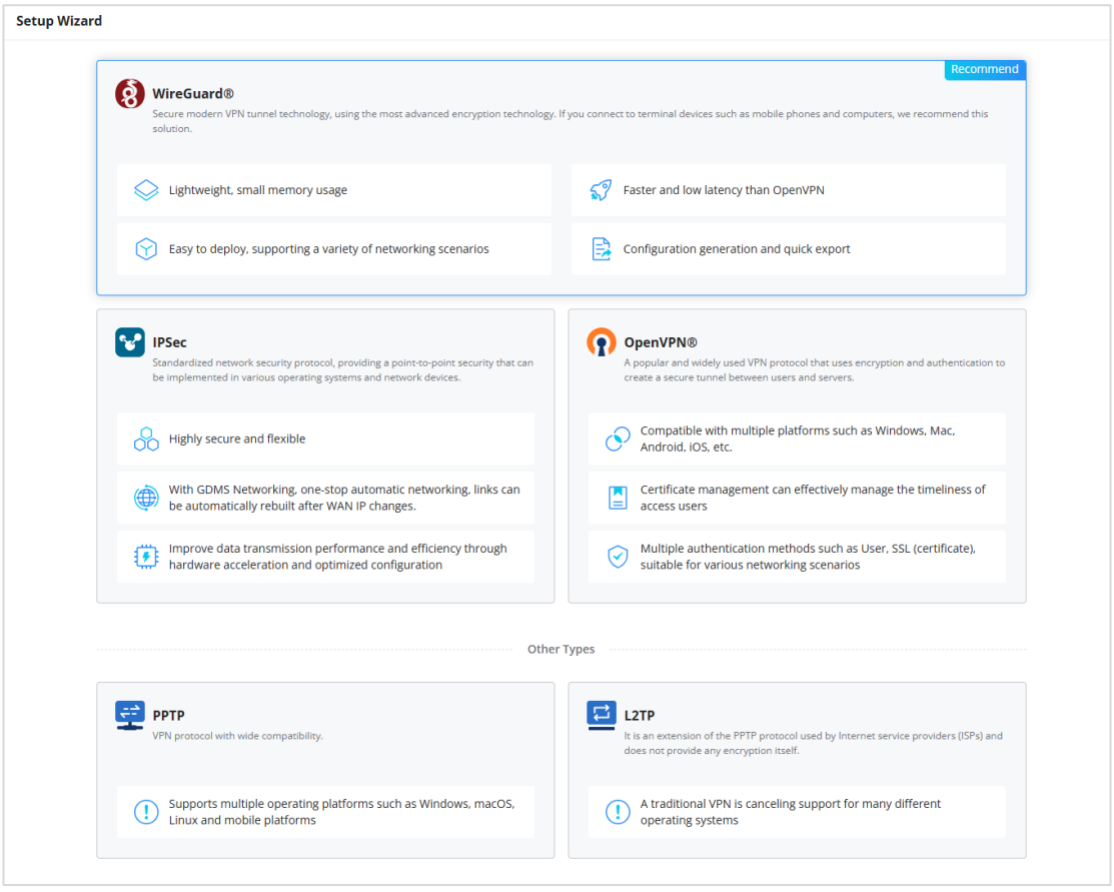

    - Optimzed UI configurations and added configuration guide link for **WireGuard®, IPsec, OpenVPN®, PPTP and L2TP**

- Added **Remote Clients** information list for **WireGuard®**
- Added support of domains for the Endpoint address on **WireGuard®.**
- Added Site-to-Site connection status to **IPsec**
- Added column of **IP Address** and **Tunnel IP** to client list under **OpenVPN®** and **PPTP Servers**
- Added support of **IPSec Encryption** to **L2TP** server.
- Added support for users to manually adjust the MTU and MSS values for IPsec connections.
- Added support of exporting client .ovpn file for **OpenVPN® Clients**
- Optimzed the logic that when a WAN interface is deleted, the dependent VPN will not be removed but set to disable instead.


- Routing
  - Added the **Routing Table** page
  - Optimzed the UI configuration of **Static Routes** and **Policy Routes**
  - Added configuration pages for **OSPF**, **RIP**, and **BGP**

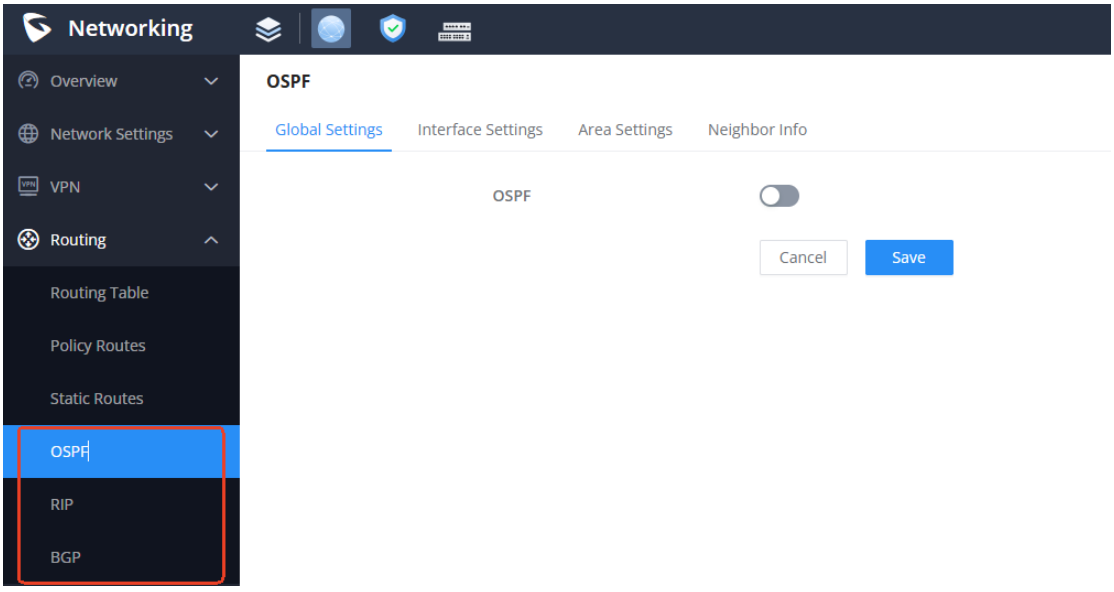

- Traffic Management
  - Added **Statistic by IP address** under **Traffic Statistics → Basic Settings**
- External Access

- Added configurations of **IP Source** and **Update Interval (Min)** to **DDNS**
- Added the **Clone** feature to **Port Forwarding** rules

- Maintenance
  - Added an input restrictions to TR-069 ACS Username and Password.
  - From **System Diagnostics**, moved **Ping/Traceroute** to **Maintenance → Network Tools**, and **Core File** to **Home → Logs & Diagnosticse**
  - Added a feature of **Local Logs** download under **Syslog**
  - Added features of **NSlookup** and **Wake on LAN** under **Network Tools**

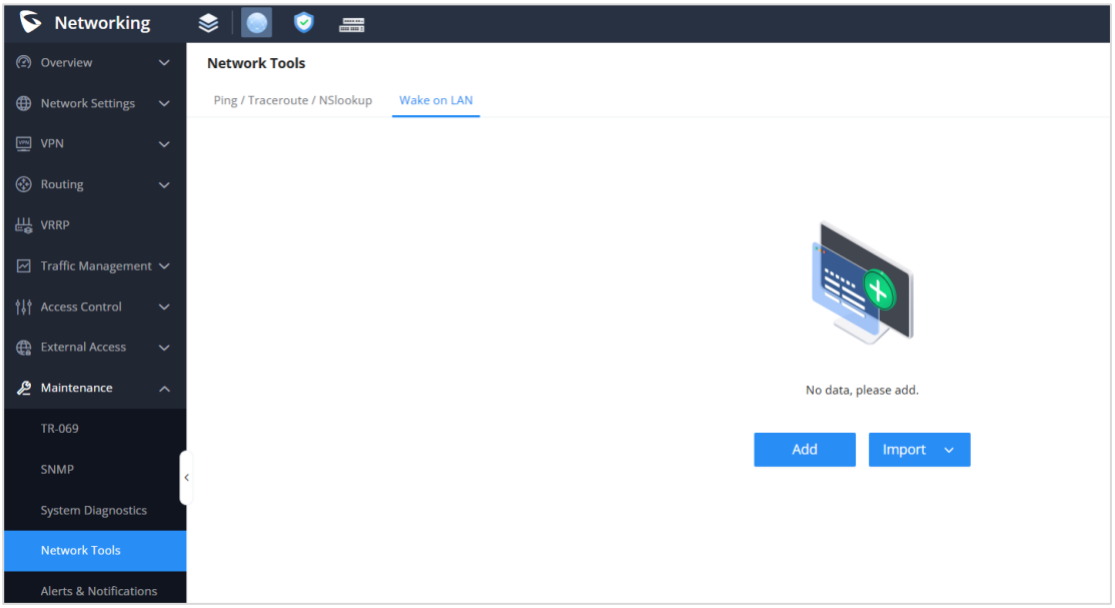


  - Optimzed the UI for **Alerts & Notifications** page

- System Settings
  - Added **Email Settings**
  - Moved **RADIUS, Certificates** to **Profiles**

- Added **Profiles**
  - Added support of **MAC Group, IP Address Group, FQDN, RADIUS, Certificates**


- **Firewall**

- Added support of **Profiles** of **IP Address Group** and **FQDN** group to DoS Exception, IPS Exception, Bonet Exception, Content Control Exception, SSL Proxy Exception, SSL Proxy source address, Geo-IP Exception.

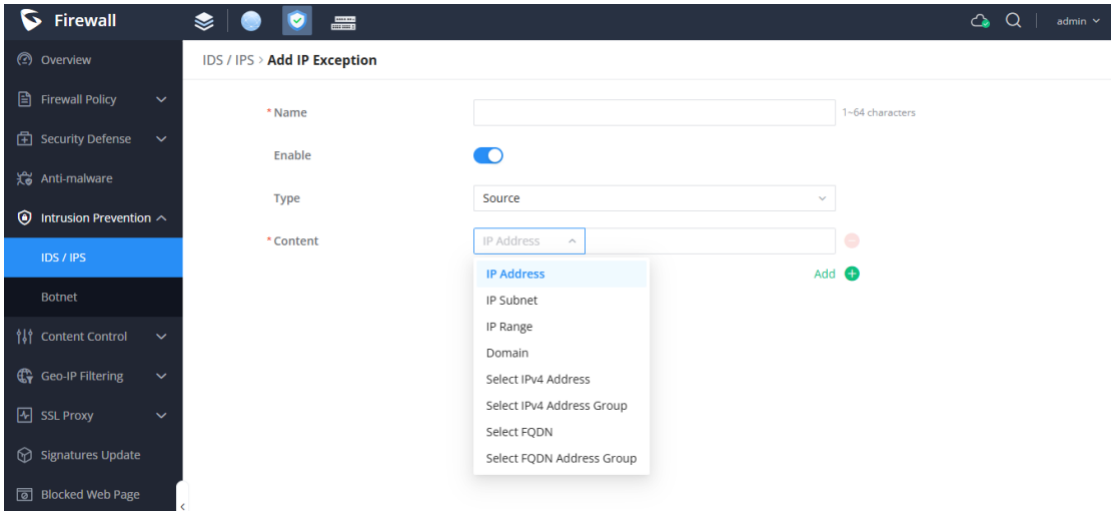


- Overview
    - Added **App Category** for **APP Filtering** in **Top Security Log**
    - Added **Refresh** button for **Firewall Service** plan
- Firewall Policy
    - Added the feature of **Schedule** for **Traffic Rules**
    - Added **Clone** button for **Traffic Rules** and Advanced NAT


- Added **Signatures Update** to manage all related Firewall module's signature libraries.

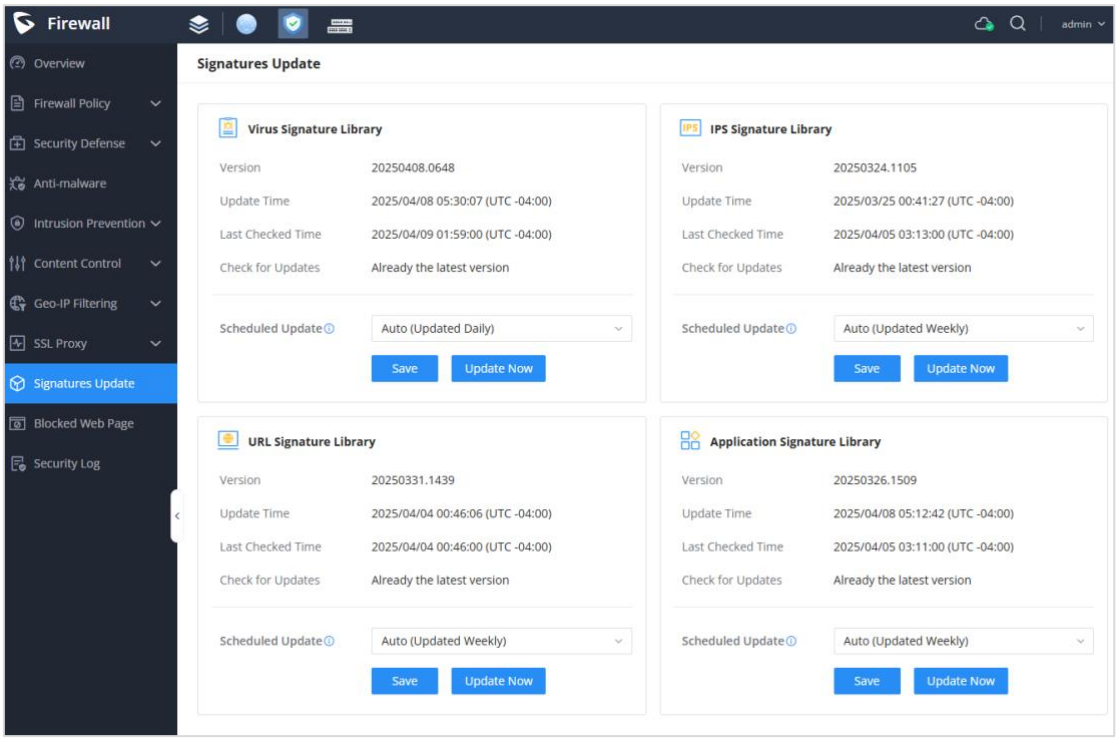


- Content Control
  - Added **DNS Category Filtering** under **DNS Filtering**

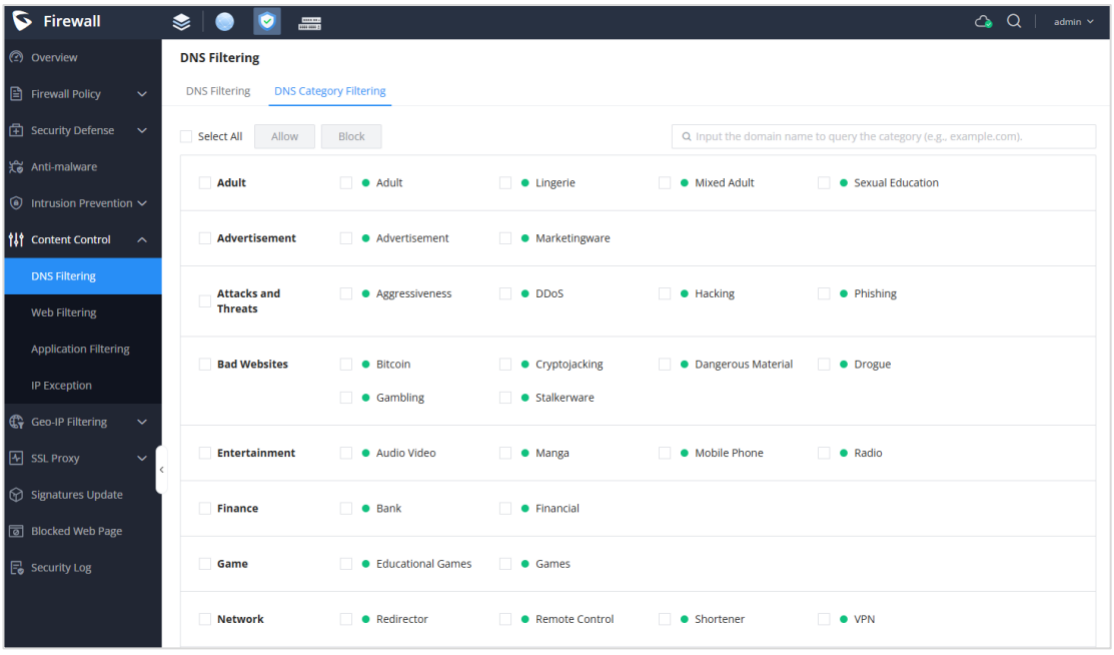

- Optimized the **Application Filtering Rules** and **Application List** interface UI, and added **Network Protocol** and **Unknown Applications** categories

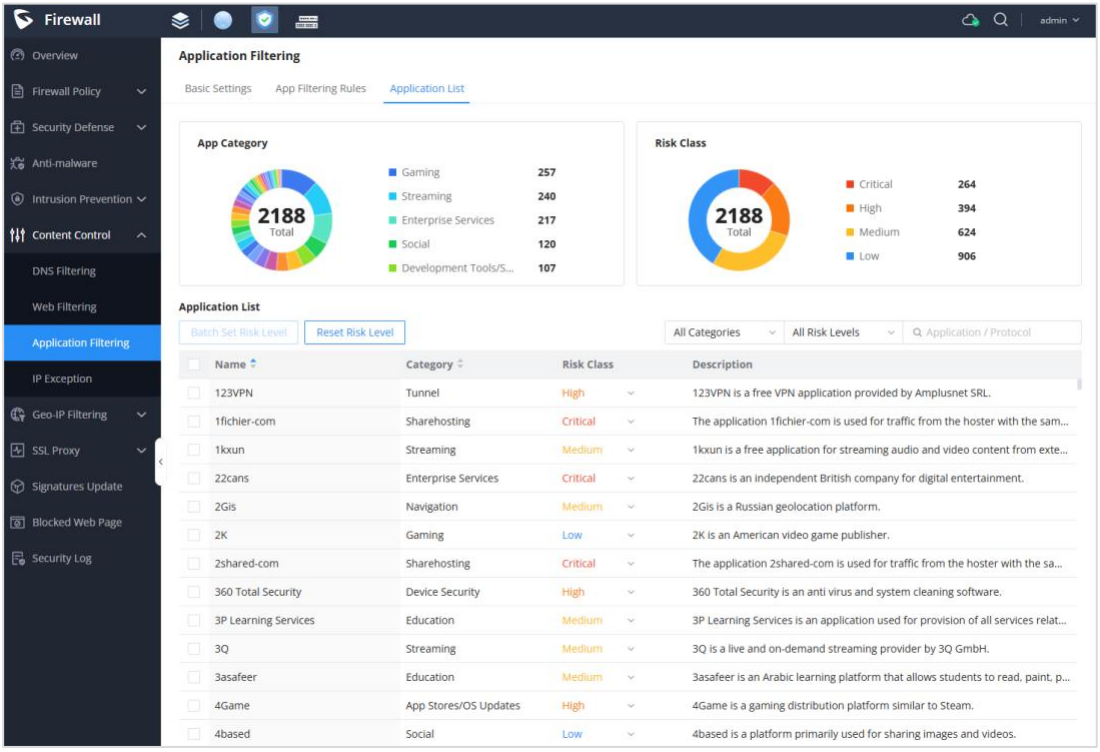


- Added **Blocked Web Page** to self-define the landing page for **Access Blocked** and **Virus detected**

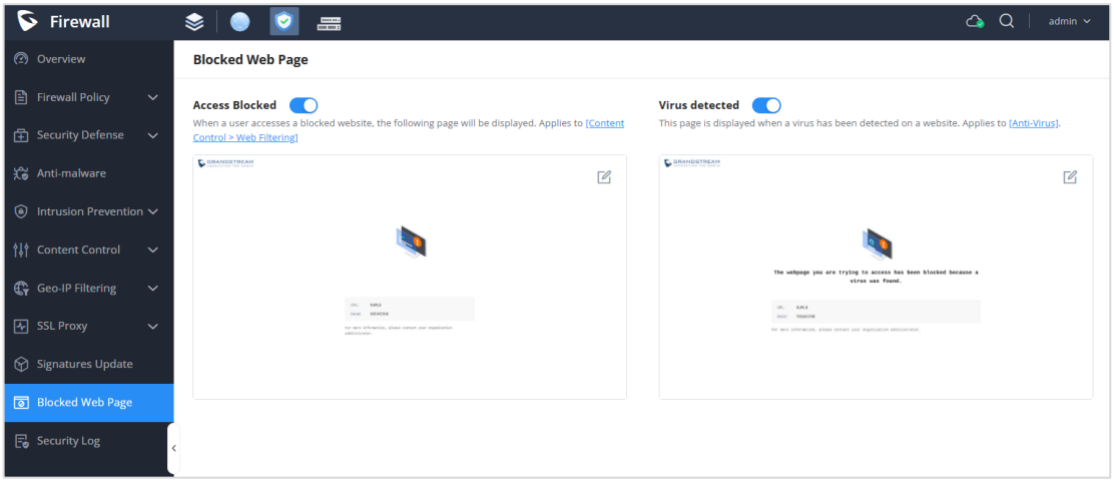

- Security Log
  - Added **Details** for **DoS & Spoofing** and **Application Filtering**
  - Added support of **Export All** logs
  - Added **DNS Filtering Risk Level Settings** to **Log Level and Email Notification**

- **Network Nodes**
  - Added support of **VLAN ID** configuration to **Wi-Fi Management → PPSK**
  - Added support of **Captive Portal** to wired clients
  - Added **Bypass Splash Page** to **Captive Portal → Policy**

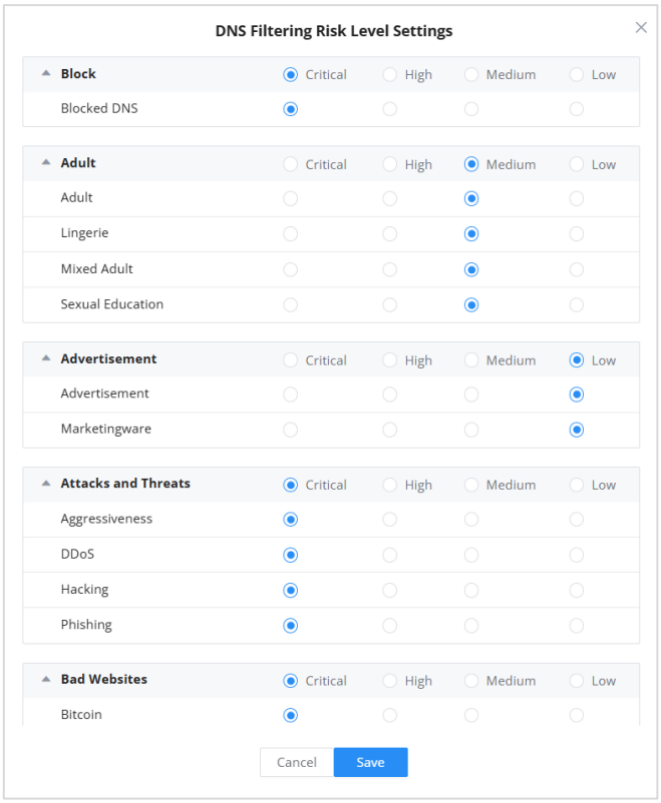

- Fixed a bug where UC endpoints could not detect VoIP devices on the WAN side.
- Fixed a bug that caused VPN configurations to be erased when the WAN connection was disabled or deleted.
- Fixed a bug that character "-" cannot be used in the special characters list for certificate names.
- Fixed a bug that Daylight Saving Time was applied in the Asuncion/Paraguay time zone.
- Fixed a bug of /31 subnet mask support.
- Fixed a bug that caused intermittent disconnections with IPSec VPN.

FIRMWARE VERSION 1.0.5.11 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

1/13/2025

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 6f06b8ba6b41fa9c7ca704b5b68fce3e

- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

  MD5 checksum: 39c3816a7734cfd4c9aa94f1228a83cd

  (Including SYS 1.0.5.11 + PBX 1.0.27.17)

CHANGES/ENHANCEMENT

- Internal bug fixes

FIRMWARE VERSION 1.0.5.6 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

12/6/2024

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 0815d1f0a1e272e6d3b6b0216aedb870

- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

  MD5 checksum: 1b19dcb30ead367939324922dbe85d20

  (Including SYS 1.0.5.6 + PBX 1.0.27.14)

CHANGES/ENHANCEMENT

- [Home] Added Operation Log page.
- [Home] Added the ability to schedule regular backups under the *Maintenance→Backup & Restore* page.
- [Home] Added support for MTA email method.
- [Networking] Added support for load balancing strategies under the *Routing→Policy Routes* page.
- [Networking] Added support for VRRP.
- [Networking] VPN settings are now retained after closing VPN.
- [Networking] DNS filtering now supports filtering by SNI and common name in the certificate.
- [Networking] IPSec is now limited to 64 tunnels.
- [Networking] Added support for connection speed test with GWN Cloud.
- [Networking] Added support for receiving PPSK configurations from GWN Cloud.
- [Firewall] Added ability to configure outbound traffic rules under the *Firewall Policy→Traffic Rules* page.

- [Firewall] IDS/IPS detection settings will now be applied to all WAN interfaces. Interfaces can no longer be excluded.
- [Firewall] Added support for SMPT(S) and POP3(S) detection protocols.
- [Firewall] Added support for importing and exporting SSL proxy exemption lists.
- [Firewall] Added ability to schedule the automatic turning on/off of DNS filtering, web filtering, and application filtering.
- [Firewall] Added support for Geo-IP filtering.
- [Firewall] SSL exemption list now supports wildcard input.
- [Firewall] Added security log risk levels and corresponding filters.
- [Firewall] Added *Application List* tab to the [Application Filtering] section. This page will show a list of all monitored applications and their corresponding risk levels.
- [Network Nodes] Added support for 6GHz band in the SSID, Radio, and Mesh settings.
- [UC Endpoints] Fast Provision will now also include the PBX module's local LDAP phonebook information.
- Several bug fixes.

FIRMWARE VERSION 1.0.3.6 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

10/8/2024

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 25957d6a84dd13b2976c6d08ae386221

- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

  MD5 checksum: dd0e37ef081abf11ea56151029724fc0

  (Including SYS 1.0.3.6 + PBX 1.0.25.41)

CHANGES/ENHANCEMENT

- [Home] Fixed an issue that offline device disappears from Network Topology
- [Networking] Fixed an issue that on GCC6010 SFP1 only supports maximum 1G bandwidth. Now it opens to 2.5G.
- Internal bug fixes.

FIRMWARE VERSION 1.0.3.5 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

9/20/2024

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: bbcd081cb648443fd7e9cac33e5ff333

- GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

  MD5 checksum: 89d6b124242b06bf2e82790b5929a0fc

  (Including SYS 1.0.3.5 + PBX 1.0.25.40)

CHANGES/ENHANCEMENT

- [Home] Added support for formatting M.2 SSD
- [Home] Added support of **Real-time Session Statistics** in Overview page
- [Home] Added support of **Show Offline Device** in Topology page
- [Home] Added configuration of **Redirect from Port 80** in System Settings → Security Settings → Web Access
- [Home] Added support of complete firmware upgrade to upgrade both System and PBX firmware by one .bin file
- [Home] Fixed the bug that prompts “internal error” when performing “Detect New Version” in firmware Upgrade
- [Networking] Allowed same VLAN ID configuration on different WANs
- [Networking] Changed IPv6 MTU minimum value to 1280
- [Networking] Added **WAN Port MAC address** configuration

- [Networking] Added **Blackhole** option for Static Routes → Outgoing Interface
- [Networking] Added **PBX Service** configurations for Traffic Management → QoS → VoIP Settings
- [Networking] Added support of batch delete to Maintenance → System Diagnostics → Core File
- [Networking] Added support of saving capture on attached storage under Maintenance → System Diagnostics → Capture
- [Networking] Added **Takeover / Un-Takeover Switch Alert** option into Maintenance → Alerts & Notifications → E-mail Notification Settings
- [Networking] Fixed the bug that WAN related configurations are deleted when disabling WAN
- [Networking] Enforced minimum 1 LAN port when disabling Port under Network Settings → Port Configuration
- [Networking] Supported exporting pem format certificate in System Settings → Certificates
- [Firewall] Added support of **Static ARP List** under Security Defense → ARP Protection
- [Firewall] Moved Spoofing Defense from DoS Defense to ARP Protection
- [Firewall] Added support of **IP Exception** to Content Control
- [Firewall] Added search feature in Content Control → Application Filtering → App Filtering Rules
- [Firewall] UI optimization
- Internal bug fixes.

FIRMWARE VERSION 1.0.1.34 (SYS)

PRODUCT NAME

GCC6010, GCC6010W, GCC6011

DATE

8/21/2024

FIRMWARE FILE INFORMATION

- GCC601x system firmware file name: gcc601xfw.bin

  MD5 checksum: 2736f9bd5a51e24e53857546887a22ec

CHANGES/ENHANCEMENT

- Added support of new models, GCC6010W, GCC6011
- Blocked system firmware downgrade to any older version
- Internal bug fixes.

FIRMWARE VERSION 1.0.1.32 (SYS)

PRODUCT NAME

GCC6010

DATE

7/26/2024

FIRMWARE FILE INFORMATION

- GCC6010 system firmware file name: gcc601xfw.bin

  MD5 checksum: 3b6810c23b4ee941c534649ef84d41ea

CHANGES/ENHANCEMENT

- Resolved the Tiktok Live streaming issue when Antivirus is enabled.
- Changed the default value from Enable to Disable for "**Allow DHCP Option 43 and 66 to Override Server**" and "**Check/Download New Firmware at Bootup**". Upon upgrade from older version, these two options will be disabled, please re-enable it if needed.
- Changed the default value from 10sec to 300sec for all **Flood Attack Defense** timeout settings.
- Changed the default action to **Drop** for WAN I**nbound Rules** under **Firewall Policy**.
- Updated the DPI library, latest library is not compatible with SYS version lower than 1.0.1.32.
- Updated the IPS, URL, and Antivirus signature library.
- Internal bug fixes.

FIRMWARE VERSION 1.0.1.10 (SYS)

PRODUCT NAME

GCC6010

DATE

6/28/2024

FIRMWARE FILE INFORMATION

- GCC6010 system firmware file name: gcc601xfw.bin

  MD5 checksum: c3b812966176a904282000ab622f3011

CHANGES/ENHANCEMENT

- Disable **Check/Download New Firmware at Bootup** by default.
- Internal bug fixes.

FIRMWARE VERSION 1.0.1.8 (SYS)

PRODUCT NAME

GCC6010

DATE

6/4/2024

FIRMWARE FILE INFORMATION

- GCC6010 system firmware file name: gcc601xfw.bin

  MD5 checksum: 0294ea7965254b2e99d10a5399bfd05b

CHANGES/ENHANCEMENT

- This is the initial release of GCC6010 system firmware.