

# GCC601X UC + Networking Convergence Solutions System Firmware Release Notes

## IMPORTANT UPGRADING NOTE

- [12/6/2024] [1.0.5.5 (SYS)] Due to changes in Application Filtering, users will no longer be able to downgrade to SYS 1.0.3.x or lower and PBX 1.0.25.41 or lower after upgrading to 1.0.5.5.
- [8/21/2024] [1.0.1.34 (SYS)] Supported new GCC601x models and blocked firmware downgrade to any older firmware than 1.0.1.34.
- [7/26/2024] [1.0.1.32 (SYS)] Changed the default value from Enable to Disable for "Allow DHCP Option 43 and 66 to Override Server" and "Check/Download New Firmware at Bootup". Upon upgrading from older version, these two options will be disabled. Please re-enable it if needed.



## **Table of Content**

IMPORTANT UPGRADING NOTE	
FIRMWARE FILE DOWNLOAD	4
FIRMWARE VERSION 1.0.7.14 (SYS)	5
PRODUCT NAME	
DATE	
FIRMWARE FILE INFORMATION	
CHANGES/ENHANCEMENT	
FIRMWARE VERSION 1.0.7.10 (SYS)	6
PRODUCT NAME	6
DATE	
FIRMWARE FILE INFORMATION	
CHANGES/ENHANCEMENT	
FIRMWARE VERSION 1.0.7.5 (SYS)	7
PRODUCT NAME	
DATE	
FIRMWARE FILE INFORMATION	
FIRMWARE VERSION 1.0.5.11 (SYS)	
PRODUCT NAME	
DATE FIRMWARE FILE INFORMATION	
CHANGES/ENHANCEMENT	
FIRMWARE VERSION 1.0.5.6 (SYS)	
PRODUCT NAME	
DATE FIRMWARE FILE INFORMATION	
CHANGES/ENHANCEMENT	
FIRMWARE VERSION 1.0.3.6 (SYS)	19
PRODUCT NAME	19
DATE	
FIRMWARE FILE INFORMATION	19



CHANGES/ENHANCEMENT	19
FIRMWARE VERSION 1.0.3.5 (SYS)	20
PRODUCT NAME	20
DATE	20
FIRMWARE FILE INFORMATION	20
CHANGES/ENHANCEMENT	20
FIRMWARE VERSION 1.0.1.34 (SYS)	22
PRODUCT NAME	22
DATE	22
FIRMWARE FILE INFORMATION	22
CHANGES/ENHANCEMENT	22
FIRMWARE VERSION 1.0.1.32 (SYS)	23
PRODUCT NAME	23
DATE	23
FIRMWARE FILE INFORMATION	
CHANGES/ENHANCEMENT	23
FIRMWARE VERSION 1.0.1.10 (SYS)	24
PRODUCT NAME	24
DATE	24
FIRMWARE FILE INFORMATION	24
CHANGES/ENHANCEMENT	24
FIRMWARE VERSION 1.0.1.8 (SYS)	25
PRODUCT NAME	25
DATE	25
FIRMWARE FILE INFORMATION	25
CHANGES/ENHANCEMENT	25



## FIRMWARE FILE DOWNLOAD

Individual	firmware	files a	re available	for do	ownloading	at URL	below:

https://www.grandstream.com/support/firmware



# FIRMWARE VERSION 1.0.7.14 (SYS)

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

8/6/2025

#### FIRMWARE FILE INFORMATION

• GCC601x system firmware file name: gcc601xfw.bin

MD5 checksum: e4fb5f65bd96bf348bb8e035ae84cabf

#### **CHANGES/ENHANCEMENT**

\*Fixed a constant rebooting issue introduced on 8/2/2025 by virus signature lib update.

<sup>\*</sup>Note: Do not need to upgrade this firmware if the unit was not affected by 8/4/2025.



# FIRMWARE VERSION 1.0.7.10 (SYS)

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

5/23/2025

#### FIRMWARE FILE INFORMATION

GCC601x system firmware file name: gcc601xfw.bin

MD5 checksum: 41b1247288692db35096c26aea1e8686

• GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

MD5 checksum: 4fe23131df1d756fcd47afafa7ddf77a

(Including SYS 1.0.7.10 + PBX 1.0.27.47)

## **CHANGES/ENHANCEMENT**

Internal bug fixes.



# **FIRMWARE VERSION 1.0.7.5 (SYS)**

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

4/21/2025

#### FIRMWARE FILE INFORMATION

GCC601x system firmware file name: gcc601xfw.bin


MD5 checksum: 125a3a460e8a392fde12a5e4a93c9bc9

GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

MD5 checksum: f807833711e7378a28c2538e20a14da2


(Including SYS 1.0.7.5 + PBX 1.0.27.44)

- Home
  - Added Feedback and Remote Management (GWN App) in the top bar admin dropdown menu.

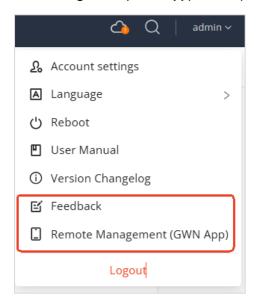




- Added Real-time Session Statistics, Firewall service, and PBX information in Overview.
- Added VLAN configuration when enabling **PBX** module.
- System Settings
  - o Basic Settings
    - Fixed Asuncion time zone to UTC-3
    - Fixed Kazakhstan Almaty time zone to UTC+5
    - Added settings for multiple NTP server
    - Changed default time zone to UTC+00:00 Etc/Universal, country to Spain
  - Security Settings
    - Added Multi-Factor Authentication for Accounts Settings

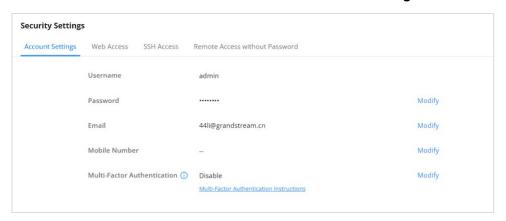

- Added Allowed IP Addresses settings in Web Access
- o Schedule
  - Added a button of Reference Details, from which user can check to where the schedule is applied
- Maintenance
  - o Upgrade
    - Added a factory reset prompt when downgrading to an incompatible firmware
- Log & Disgnostics
  - o Added Core Files retrieval



- Networking
  - Network Settings:
    - o WAN
- Added Bridge Mode
- Optimized the Tracking IP feature
- o LAN
- Optimzed the Static IP Binding settings
- VPN
  - o Added Setup Wizard for WireGuard®, IPsec, OpenVPN®, PPTP and L2TP

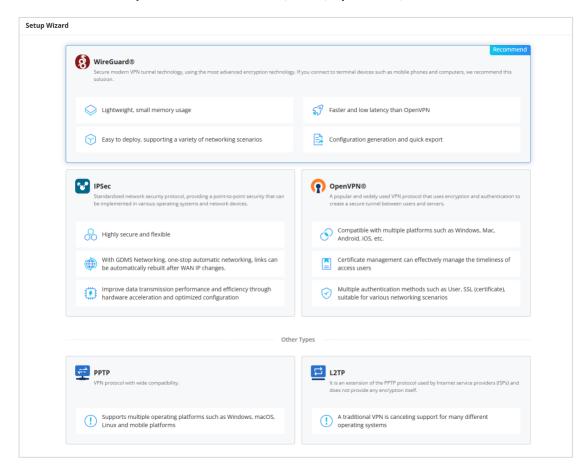

o Optimzed UI configurations and added configuration guide link for WireGuard®, IPsec,


OpenVPN®, PPTP and L2TP



- Added Remote Clients information list for WireGuard®
- o Added support of domains for the Endpoint address on WireGuard®.
- Added Site-to-Site connection status to IPsec
- o Added column of IP Address and Tunnel IP to client list under OpenVPN® and PPTP Servers
- Added support of IPSec Encryption to L2TP server.
- Added support for users to manually adjust the MTU and MSS values for IPsec connections.
- Added support of exporting client .ovpn file for OpenVPN® Clients
- Optimzed the logic that when a WAN interface is deleted, the dependent VPN will not be removed but set to disable instead.

#### Routing


- Added the Routing Table page
- o Optimzed the UI configuration of Static Routes and Policy Routes
- o Added configuration pages for OSPF, RIP, and BGP

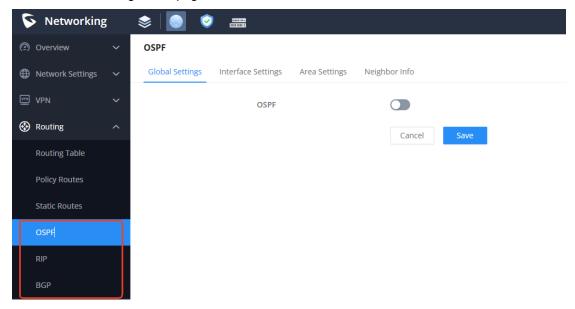

- Traffic Management
  - Added Statistic by IP address under Traffic Statistics → Basic Settings
- External Access
  - o Added configurations of IP Source and Update Interval (Min) to DDNS



- Added the Clone feature to Port Forwarding rules
- Maintenance
  - Added an input restrictions to TR-069 ACS Username and Password.
  - From System Diagnostics, moved Ping/Traceroute to Maintenance → Network Tools, and
     Core File to Home → Logs & Diagnosticse
  - Added a feature of Local Logs download under Syslog
  - Added features of NSlookup and Wake on LAN under Network Tools

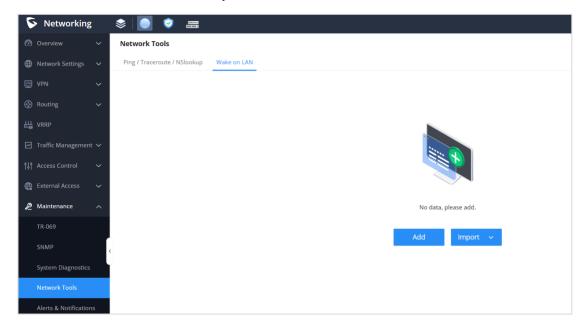


- o Optimzed the UI for Alerts & Notifications page
- System Settings
  - Added Email Settings
  - o Moved RADIUS, Certificates to Profiles
- Added Profiles
  - o Added support of MAC Group, IP Address Group, FQDN, RADIUS, Certificates


#### Firewall

Added support of Profiles of IP Address Group and FQDN group to DoS Exception, IPS Exception,
 Bonet Exception, Content Control Exception, SSL Proxy Exception, SSL Proxy source address, Geo-IP Exception.



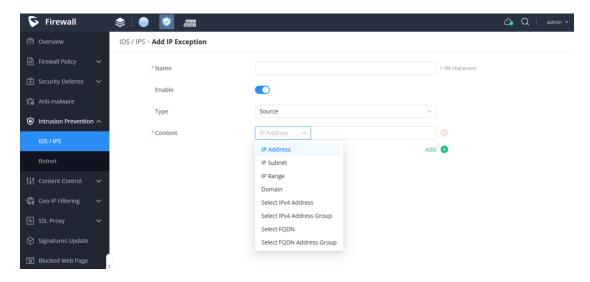


- Overview
  - o Added App Category for APP Filtering in Top Security Log
  - o Added Refresh button for Firewall Service plan
- Firewall Policy
  - Added the feature of Schedule for Traffic Rules
  - Added Clone button for Traffic Rules and Advanced NAT
- Added Signatures Update to manage all related Firewall module's signature libraries.

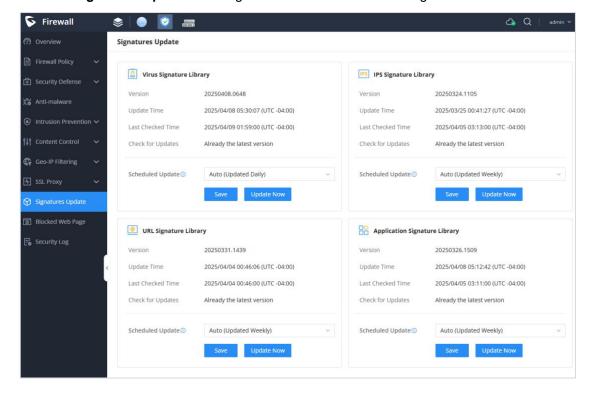




#### - Content Control

o Added DNS Category Filtering under DNS Filtering

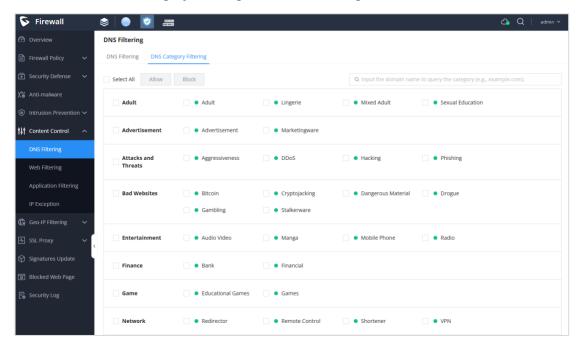


Optimized the Application Filtering Rules and Application List interface UI, and added
 Network Protocol and Unknown Applications categories

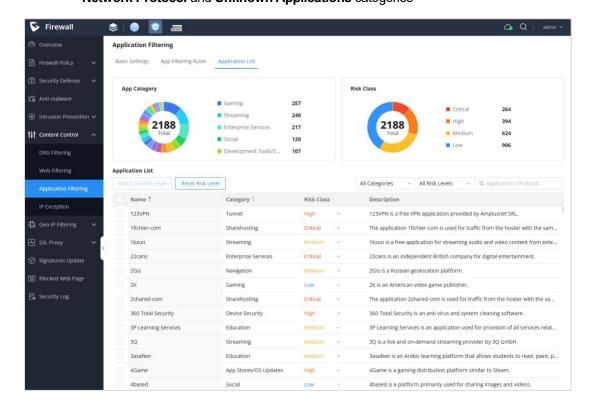




- Added Blocked Web Page to self-define the landing page for Access Blocked and Virus detected

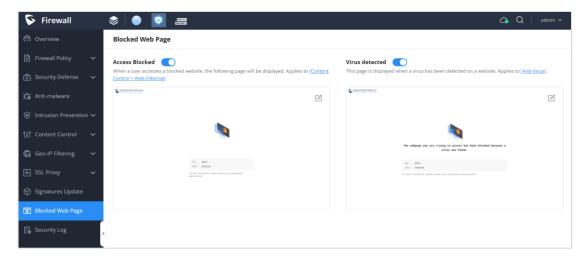

- Security Log
  - o Added Details for DoS & Spoofing and Application Filtering
  - Added support of Export All logs
  - o Added DNS Filtering Risk Level Settings to Log Level and Email Notification

#### Network Nodes

- Added support of VLAN ID configuration
   to Wi-Fi Management → PPSK
- Added support of Captive Portal to wired clients
- Added Bypass Splash Page to Captive
   Portal → Policy

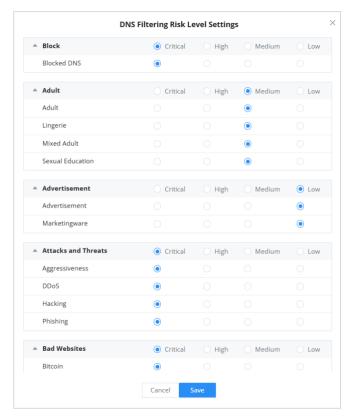



- Fixed a bug where UC endpoints could not detect VoIP devices on the WAN side.
- Fixed a bug that caused VPN configurations to be erased when the WAN connection was disabled or deleted.
- Fixed a bug that character "-" cannot be used in the special characters list for certificate names.
- Fixed a bug that Daylight Saving Time was applied in the Asuncion/Paraguay time zone.
- Fixed a bug of /31 subnet mask support.
- Fixed a bug that caused intermittent disconnections with IPSec VPN.



# FIRMWARE VERSION 1.0.5.11 (SYS)

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

1/13/2025

#### FIRMWARE FILE INFORMATION

GCC601x system firmware file name: gcc601xfw.bin

MD5 checksum: 6f06b8ba6b41fa9c7ca704b5b68fce3e

• GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

MD5 checksum: 39c3816a7734cfd4c9aa94f1228a83cd

(Including SYS 1.0.5.11 + PBX 1.0.27.17)

## **CHANGES/ENHANCEMENT**

Internal bug fixes



# **FIRMWARE VERSION 1.0.5.6 (SYS)**

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

12/6/2024

#### FIRMWARE FILE INFORMATION

GCC601x system firmware file name: gcc601xfw.bin

MD5 checksum: 0815d1f0a1e272e6d3b6b0216aedb870

GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

MD5 checksum: 1b19dcb30ead367939324922dbe85d20

(Including SYS 1.0.5.6 + PBX 1.0.27.14)

- [Home] Added Operation Log page.
- [Home] Added the ability to schedule regular backups under the Maintenance →Backup & Restore page.
- [Home] Added support for MTA email method.
- [Networking] Added support for load balancing strategies under the *Routing →Policy Routes* page.
- [Networking] Added support for VRRP.
- [Networking] VPN settings are now retained after closing VPN.
- [Networking] DNS filtering now supports filtering by SNI and common name in the certificate.
- [Networking] IPSec is now limited to 64 tunnels.
- [Networking] Added support for connection speed test with GWN Cloud.
- [Networking] Added support for receiving PPSK configurations from GWN Cloud.
- [Firewall] Added ability to configure outbound traffic rules under the *Firewall Policy → Traffic Rules* page.



- [Firewall] IDS/IPS detection settings will now be applied to all WAN interfaces. Interfaces can no longer be excluded.
- [Firewall] Added support for SMPT(S) and POP3(S) detection protocols.
- [Firewall] Added support for importing and exporting SSL proxy exemption lists.
- [Firewall] Added ability to schedule the automatic turning on/off of DNS filtering, web filtering, and application filtering.
- [Firewall] Added support for Geo-IP filtering.
- [Firewall] SSL exemption list now supports wildcard input.
- [Firewall] Added security log risk levels and corresponding filters.
- [Firewall] Added *Application List* tab to the [Application Filtering] section. This page will show a list of all monitored applications and their corresponding risk levels.
- [Network Nodes] Added support for 6GHz band in the SSID, Radio, and Mesh settings.
- [UC Endpoints] Fast Provision will now also include the PBX module's local LDAP phonebook information.
- Several bug fixes.



# FIRMWARE VERSION 1.0.3.6 (SYS)

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

10/8/2024

#### FIRMWARE FILE INFORMATION

GCC601x system firmware file name: gcc601xfw.bin

MD5 checksum: 25957d6a84dd13b2976c6d08ae386221

GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

MD5 checksum: dd0e37ef081abf11ea56151029724fc0

(Including SYS 1.0.3.6 + PBX 1.0.25.41)

- [Home] Fixed an issue that offline device disappears from Network Topology
- [Networking] Fixed an issue that on GCC6010 SFP1 only supports maximum 1G bandwidth. Now it opens to 2.5G.
- Internal bug fixes.



# FIRMWARE VERSION 1.0.3.5 (SYS)

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

9/20/2024

#### FIRMWARE FILE INFORMATION

GCC601x system firmware file name: gcc601xfw.bin

MD5 checksum: bbcd081cb648443fd7e9cac33e5ff333

GCC601x complete firmware file name: gcc601xfullyfw.bin (Supported only starting from 1.0.3.5)

MD5 checksum: 89d6b124242b06bf2e82790b5929a0fc

(Including SYS 1.0.3.5 + PBX 1.0.25.40)

- [Home] Added support for formatting M.2 SSD
- [Home] Added support of Real-time Session Statistics in Overview page
- [Home] Added support of Show Offline Device in Topology page
- [Home] Added configuration of Redirect from Port 80 in System Settings → Security Settings → Web

  Access
- [Home] Added support of complete firmware upgrade to upgrade both System and PBX firmware by one .bin file
- [Home] Fixed the bug that prompts "internal error" when performing "Detect New Version" in firmware
   Upgrade
- [Networking] Allowed same VLAN ID configuration on different WANs
- [Networking] Changed IPv6 MTU minimum value to 1280
- [Networking] Added WAN Port MAC address configuration



- [Networking] Added **Blackhole** option for Static Routes → Outgoing Interface
- [Networking] Added **PBX Service** configurations for Traffic Management → QoS → VoIP Settings
- [Networking] Added support of batch delete to Maintenance → System Diagnostics → Core File
- [Networking] Added support of saving capture on attached storage under Maintenance → System
   Diagnostics → Capture
- [Networking] Added Takeover / Un-Takeover Switch Alert option into Maintenance → Alerts &
   Notifications → E-mail Notification Settings
- [Networking] Fixed the bug that WAN related configurations are deleted when disabling WAN
- [Networking] Enforced minimum 1 LAN port when disabling Port under Network Settings → Port Configuration
- [Networking] Supported exporting pem format certificate in System Settings → Certificates
- [Firewall] Added support of **Static ARP List** under Security Defense → ARP Protection
- [Firewall] Moved Spoofing Defense from DoS Defense to ARP Protection
- [Firewall] Added support of **IP Exception** to Content Control
- [Firewall] Added search feature in Content Control → Application Filtering → App Filtering Rules
- [Firewall] UI optimization
- Internal bug fixes.



# FIRMWARE VERSION 1.0.1.34 (SYS)

#### **PRODUCT NAME**

GCC6010, GCC6010W, GCC6011

#### **DATE**

8/21/2024

#### FIRMWARE FILE INFORMATION

GCC601x system firmware file name: gcc601xfw.bin

MD5 checksum: 2736f9bd5a51e24e53857546887a22ec

- Added support of new models, GCC6010W, GCC6011
- Blocked system firmware downgrade to any older version
- Internal bug fixes.



# **FIRMWARE VERSION 1.0.1.32 (SYS)**

#### **PRODUCT NAME**

GCC6010

#### **DATE**

7/26/2024

#### FIRMWARE FILE INFORMATION

GCC6010 system firmware file name: gcc601xfw.bin

MD5 checksum: 3b6810c23b4ee941c534649ef84d41ea

- Resolved the Tiktok Live streaming issue when Antivirus is enabled.
- Changed the default value from Enable to Disable for "Allow DHCP Option 43 and 66 to Override Server"
  and "Check/Download New Firmware at Bootup". Upon upgrade from older version, these two options
  will be disabled, please re-enable it if needed.
- Changed the default value from 10sec to 300sec for all Flood Attack Defense timeout settings.
- Changed the default action to Drop for WAN Inbound Rules under Firewall Policy.
- Updated the DPI library, latest library is not compatible with SYS version lower than 1.0.1.32.
- Updated the IPS, URL, and Antivirus signature library.
- Internal bug fixes.



# FIRMWARE VERSION 1.0.1.10 (SYS)

#### **PRODUCT NAME**

GCC6010

#### **DATE**

6/28/2024

#### FIRMWARE FILE INFORMATION

GCC6010 system firmware file name: gcc601xfw.bin

MD5 checksum: c3b812966176a904282000ab622f3011

- Disable Check/Download New Firmware at Bootup by default.
- Internal bug fixes.



# **FIRMWARE VERSION 1.0.1.8 (SYS)**

#### **PRODUCT NAME**

GCC6010

#### **DATE**

6/4/2024

#### FIRMWARE FILE INFORMATION

• GCC6010 system firmware file name: gcc601xfw.bin

MD5 checksum: 0294ea7965254b2e99d10a5399bfd05b

## **CHANGES/ENHANCEMENT**

• This is the initial release of GCC6010 system firmware.