

GRP2601(P)/2602(P/G/W)/2603(P)/2604(P)

Firmware Release Notes

IMPORTANT UPGRADE NOTES

- The following hardware versions cannot downgrade after upgrading to 1.0.5.37:
 - GRP2601(P) hardware version 1.9A
 - GRP2602(P) hardware version 1.9A
 - GRP2604(P) hardware version 1.7A
 - GRP2603P GRP2604P hardware version 1.5A
 - GRP2603P hardware version 1.5B
 - GRP2603 GRP2604 hardware version 1.6B

Table of Content

IMPORTANT UPGRADE NOTES.....	1
Table of Content.....	2
FIRMWARE VERSION 1.0.7.71	13
PRODUCT NAME.....	13
DATE	13
FIRMWARE FILE INFORMATION	13
ENHANCEMENT	13
BUG FIX	13
NEW FEATURES OVERVIEW	13
<i>USE ACCEPT-LANGUAGE HEADER.....</i>	<i>13</i>
<i>ACCOUNT SELECTION MODE FOR DIALING</i>	<i>14</i>
FIRMWARE VERSION 1.0.7.66	16
PRODUCT NAME.....	16
DATE	16
FIRMWARE FILE INFORMATION	16
ENHANCEMENT	16
BUG FIX	16
FIRMWARE VERSION 1.0.7.64	17
PRODUCT NAME.....	17
DATE	17
FIRMWARE FILE INFORMATION	17
ENHANCEMENT	17
FIRMWARE VERSION 1.0.7.63 (BETA ONLY)	18
PRODUCT NAME.....	18
DATE	18
FIRMWARE FILE INFORMATION	18
ENHANCEMENT	18
BUG FIX	18
NEW FEATURES OVERVIEW	18
<i>CALL MONITOR FUNCION</i>	<i>18</i>
<i>LOCAL CALL FEATURE MODE IMPROVEMENT.....</i>	<i>19</i>

FIRMWARE VERSION 1.0.7.4921

PRODUCT NAME.....	21
DATE	21
FIRMWARE FILE INFORMATION	21
ENHANCEMENT	21
BUG FIX	21
NEW FEATURES OVERVIEW	21
<i>REGISTRATION RETRY WAIT TIME(S) UPON 403 FORBIDDEN</i>	21
<i>GEOLOCATION HEADER FORMAT</i>	22
<i>ADD AUTH HEADER ON RE-REGISTER</i>	22
<i>REBOOT ON CHECK-SYNC EVENT WITHOUT "REBOOT="</i>	22

FIRMWARE VERSION 1.0.7.3924

PRODUCT NAME.....	24
DATE	24
FIRMWARE FILE INFORMATION	24
ENHANCEMENT	24
BUG FIX	24
NEW FEATURES OVERVIEW	24
<i>CALL-ID DOMAIN MODE</i>	24
<i>ALERT-INFO BELLCORE MAPPING</i>	25
<i>GENERATE WLAN SESSION KEYS FILE</i>	25

FIRMWARE VERSION 1.0.7.3227

PRODUCT NAME.....	27
DATE	27
FIRMWARE FILE INFORMATION	27
ENHANCEMENT	27
BUG FIX	27
NEW FEATURES OVERVIEW	27
<i>MEDIA NAT TRAVERSAL</i>	27
<i>CANDIDATE TYPE</i>	28

FIRMWARE VERSION 1.0.7.2429

PRODUCT NAME.....	29
DATE	29
FIRMWARE FILE INFORMATION	29
BUG FIX	29

FIRMWARE VERSION 1.0.7.2330

PRODUCT NAME.....	30
DATE	30
FIRMWARE FILE INFORMATION	30
ENHANCEMENT	30
BUG FIX	30
NEW FEATURES OVERVIEW	30
<i>SOFTKEY BAR STYLE</i>	30
FIRMWARE VERSION 1.0.7.19	31
PRODUCT NAME.....	31
DATE	31
FIRMWARE FILE INFORMATION	31
ENHANCEMENT	31
BUG FIX	31
FIRMWARE VERSION 1.0.7.15	32
PRODUCT NAME.....	32
DATE	32
FIRMWARE FILE INFORMATION	32
ENHANCEMENT	32
BUG FIX	32
NEW FEATURES OVERVIEW	32
<i>SYSLOG HEADER FORMAT</i>	32
FIRMWARE VERSION 1.0.7.11.....	33
PRODUCT NAME.....	33
DATE	33
FIRMWARE FILE INFORMATION	33
ENHANCEMENT	33
BUG FIX	33
NEW FEATURES OVERVIEW	33
<i>MONITORED VOICEMAIL ACCESS NUMBER</i>	33
FIRMWARE VERSION 1.0.7.10	34
PRODUCT NAME.....	34
DATE	34
FIRMWARE FILE INFORMATION	34
ENHANCEMENT	34
BUG FIX	35
FIRMWARE VERSION 1.0.5.71	36

PRODUCT NAME.....	36
DTMF event DATE	36
FIRMWARE FILE INFORMATION	36
ENHANCEMENT	36
BUG FIX	36
NEW FEATURES OVERVIEW	36
<i>LLDP TIMEOUT BEFORE DHCP REQUEST</i>	36
FIRMWARE VERSION 1.0.5.68	37
PRODUCT NAME.....	37
DATE	37
FIRMWARE FILE INFORMATION	37
ENHANCEMENT	37
BUG FIX	37
FIRMWARE VERSION 1.0.5.65	38
PRODUCT NAME.....	38
DATE	38
FIRMWARE FILE INFORMATION	38
ENHANCEMENT	38
BUG FIX	38
FIRMWARE VERSION 1.0.5.60	39
PRODUCT NAME.....	39
DATE	39
FIRMWARE FILE INFORMATION	39
ENHANCEMENT	39
BUG FIX	39
NEW FEATURES OVERVIEW	39
<i>ENHANCED CALL PARK</i>	39
FIRMWARE VERSION 1.0.5.54	41
PRODUCT NAME.....	41
DATE	41
FIRMWARE FILE INFORMATION	41
ENHANCEMENT	41
BUG FIX	41
FIRMWARE VERSION 1.0.5.50	42
PRODUCT NAME.....	42
DATE	42

FIRMWARE FILE INFORMATION	42
BUG FIX	42
FIRMWARE VERSION 1.0.5.46	43
PRODUCT NAME.....	43
DATE	43
FIRMWARE FILE INFORMATION	43
ENHANCEMENT	43
BUG FIX	43
FIRMWARE VERSION 1.0.5.38	44
PRODUCT NAME.....	44
DATE	44
FIRMWARE FILE INFORMATION	44
ENHANCEMENT	44
BUG FIX	44
NEW FEATURES OVERVIEW	45
<i>ENABLE INCOMING CALL INDICATOR.....</i>	45
<i>TRANSFER TO VM FEATURE CODE.....</i>	45
<i>VPK PAGING AUTO RETURN TIMEOUT(S).....</i>	45
<i>MAINTAIN SYSTEM LOG INFO AFTER FACTORY RESET</i>	46
FIRMWARE VERSION 1.0.5.26	47
PRODUCT NAME.....	47
DATE	47
FIRMWARE FILE INFORMATION	47
ENHANCEMENT	47
NEW FEATURES OVERVIEW	47
<i>VQ RTCP-XR COLLECTOR ADDRESS SELECTION.....</i>	47
FIRMWARE VERSION 1.0.5.25	48
PRODUCT NAME.....	48
DATE	48
FIRMWARE FILE INFORMATION	48
ENHANCEMENT	48
BUG FIX	48
NEW FEATURES OVERVIEW	48
<i>MULTICAST CALL TIMEOUT(S).....</i>	48
FIRMWARE VERSION 1.0.5.19	50
PRODUCT NAME.....	50

DATE	50
FIRMWARE FILE INFORMATION	50
ENHANCEMENT	50
BUG FIX	50
NEW FEATURES OVERVIEW	51
<i>HIDE POP-UP OPTIONS</i>	51
<i>TRUSTED DOMAIN NAME LIST</i>	51
<i>PHONEBOOK MATCHING</i>	51
<i>SSH PORT</i>	52
<i>ONLINE CONTACTS</i>	53
<i>IN-CALL CONTACT INFO DISPLAY</i>	54
FIRMWARE VERSION 1.0.3.98	55
PRODUCT NAME	55
DATE	55
FIRMWARE FILE INFORMATION	55
ENHANCEMENT	55
BUG FIX	55
NEW FEATURES OVERVIEW	56
<i>ENABLE THE INDICATOR IN RECORDING</i>	56
<i>INBOUND DTMF VOLUME</i>	56
FIRMWARE VERSION 1.0.3.87	57
PRODUCT NAME	57
DATE	57
FIRMWARE FILE INFORMATION	57
ENHANCEMENT	57
BUG FIX	57
NEW FEATURES OVERVIEW	57
<i>PUBLIC MODE TIMEOUT</i>	57
FIRMWARE VERSION 1.0.3.86	59
PRODUCT NAME	59
DATE	59
FIRMWARE FILE INFORMATION	59
ENHANCEMENT	59
BUG FIX	59
NEW FEATURES OVERVIEW	60
<i>UCM LDAP AUTO-CONFIG FEATURE ON LCD</i>	60
FIRMWARE VERSION 1.0.3.83	61

PRODUCT NAME.....	61
DATE	61
FIRMWARE FILE INFORMATION	61
ENHANCEMENT	61
BUG FIX	61
KNOWN ISSUE	62
NEW FEATURES OVERVIEW	62
<i>ENERGY SAVING</i>	62
<i>TOTAL NUMBER OF CUSTOM RINGTONE UPDATE</i>	62
<i>CLEAR USER DATA WHILE DIFFERENT USERS LOG IN</i>	62

FIRMWARE VERSION 1.0.3.72 64

PRODUCT NAME.....	64
DATE	64
FIRMWARE FILE INFORMATION	64
ENHANCEMENT	64
BUG FIX	64
NEW FEATURES OVERVIEW	64
<i>CALL TONE VOLUME</i>	64
<i>ENABLE SPEAKER KEY</i>	65
<i>OPENVPN CLIENT KEY PASSWORD</i>	65
<i>EARLY-MEDIA</i>	65

FIRMWARE VERSION 1.0.3.70 67

PRODUCT NAME.....	67
DATE	67
FIRMWARE FILE INFORMATION	67
ENHANCEMENT	67
BUG FIX	67
NEW FEATURES OVERVIEW	67
<i>WEAK SIPHER SUITES</i>	67

FIRMWARE VERSION 1.0.3.67 69

PRODUCT NAME.....	69
DATE	69
FIRMWARE FILE INFORMATION	69
ENHANCEMENT	69
BUG FIX	69
KNOWN ISSUES.....	69
NEW FEATURES OVERVIEW	69
<i>HANDSET SIDETONE VOLUME</i>	69

<i>HAC</i>	70
<i>OPENVPN TRANSPORT</i>	70

FIRMWARE VERSION 1.0.3.63 71

PRODUCT NAME	71
DATE	71
FIRMWARE FILE INFORMATION	71
ENHANCEMENT	71
BUG FIX	71
NEW FEATURES OVERVIEW	71
<i>E911 SERVICE</i>	71
<i>ZOOM E911 X-SWITCH-INFO SIP HEADER</i>	75
<i>PAGING CALL MODE</i>	75

FIRMWARE VERSION 1.0.3.59 77

PRODUCT NAME	77
DATE	77
FIRMWARE FILE INFORMATION	77
ENHANCEMENT	77
BUG FIX	77
NEW FEATURES OVERVIEW	77
<i>CA SIGNATURE ALGORITHM</i>	77

FIRMWARE VERSION 1.0.3.57 78

PRODUCT NAME	78
DATE	78
FIRMWARE FILE INFORMATION	78
ENHANCEMENT	78
BUG FIX	78
NEW FEATURES OVERVIEW	79
<i>INPUT METHOD</i>	79

FIRMWARE VERSION 1.0.3.51 80

PRODUCT NAME	80
DATE	80
FIRMWARE FILE INFORMATION	80
ENHANCEMENT	80
BUG FIX	80
NEW FEATURES OVERVIEW	80
<i>LDAP MAIL FILTER</i>	80

FIRMWARE VERSION 1.0.3.44 82

PRODUCT NAME.....	82
DATE	82
FIRMWARE FILE INFORMATION	82
ENHANCEMENT	82
BUG FIX	82
NEW FEATURES OVERVIEW	82
<i>SPEAKER RING VOLUME</i>	82

FIRMWARE VERSION 1.0.3.4283

PRODUCT NAME.....	83
DATE	83
FIRMWARE FILE INFORMATION	83
ENHANCEMENT	83
BUG FIX	84
NEW FEATURES OVERVIEW	84
<i>WI-FI SETTINGS SECURITY LEVEL</i>	84
<i>UCM USER PASSWORD</i>	85
<i>ENABLE MUTE KEY IN CALL</i>	85
<i>ENABLE TCP KEEP-ALIVE</i>	86
<i>RTCP KEEP-ALIVE METHOD</i>	86
<i>RTP KEEP-ALIVE METHOD</i>	86
<i>CUSTOMIZED KEYPAD LOCK</i>	87

FIRMWARE VERSION 1.0.3.3189

PRODUCT NAME.....	89
DATE	89
FIRMWARE FILE INFORMATION	89
ENHANCEMENT	89
BUG FIX	90
NEW FEATURES OVERVIEW	91
<i>ALLOW PROGRAMMABLE KEY CONFIGURATION VIA LCD</i>	91
<i>SUPPORT RPORT (RFC3581)</i>	91
<i>ENABLE DND FROM WEB UI</i>	91
<i>FACTORY RESET SECURI LEVEL</i>	92

FIRMWARE VERSION 1.0.3.1893

PRODUCT NAME.....	93
DATE	93
FIRMWARE FILE INFORMATION	93
ENHANCEMENT	93
BUG FIX	94

NEW FEATURES OVERVIEW	94
XML APPLICATION	94
LAST CALL FORWARD ALWAYS	95
SHOW SIP ERROR RESPONSE	96
ENABLE HOOK SWITCH	96
CONTACT SOURCE PRIORIY	96
ENABLE DIRECT IP CALL	97
USE QUICK IP CALL MODE	97
PREDICTIVE DIALING FEATURE	98
PREDICTIVE DIALING SOURCE	98
ONHOOK DIAL BARGING	99
AUTO REDIAL	99
CALL COMPLETION SERVICE	100
INCOMING CALL POPUP	100
MISSED CALL NOTIFICATION	100
CALL WAITING TONE	101
IN-CALL DTMF DISPLAY	101
SHOW ON HOLD DURATION	101
AUTO UNMUTE	102
BUSY TONE ON REMOTE DISCONNECT	102
ENABLE TRANSFER	102
ATTENDED TRANSFER MODE	103
OVERRIDE DND	103
ENABLE CONFERENCE	104
HOLD CALL BEFORE ADDING CONFEREE	104
AUTHENTICATED NTP	104
HIDDEN NUMBER PLAN	105
WARNING TONE	106
GROUP LISTEN	106
MAX NUMBER OF SIP REQUEST RETRIES	107
FAILBACK EXPIRATION	107
FIRMWARE VERSION 1.0.1.57	108
PRODUCT NAME	108
DATE	108
FIRMWARE FILE INFORMATION	108
ENHANCEMENT	108
BUG FIX	108
NEW FEATURES OVERVIEW	108
SYSTEM TIME ZONE	108
FIRMWARE VERSION 1.0.1.52	110

PRODUCT NAME.....	110
DATE	110
FIRMWARE FILE INFORMATION	110
ENHANCEMENT	110
BUG FIX	110
NEW FEATURES OVERVIEW	111
<i>USE ROUTE SET IN NOTIFY</i>	111
<i>AUTO ANSWER NUMBERS</i>	112
<i>IN-CALL DIAL NUMBER ON PRESSING TRANSFER KEY</i>	112
<i>MULTICAST PAGING MPK</i>	113
<i>VPK</i>	113
<i>3 XML PHONEBOOK URLS</i>	116

FIRMWARE VERSION 1.0.1.41 119

PRODUCT NAME.....	119
DATE	119
FIRMWARE FILE INFORMATION	119
ENHANCEMENT	119
BUG FIX	119
NEW FEATURES OVERVIEW	120
<i>LINE LED COLOR SCHEME</i>	120
<i>FORCE REBOOT BY PVALUE PROVISIONING</i>	120
<i>ALLOW MULTIPLE ACCOUNTS</i>	121
<i>DIAL NOW TYPE</i>	121
<i>FORWARD ALWAYS SOFTKEY</i>	122
<i>RING FOR CALL WAITING</i>	122

FIRMWARE VERSION 1.0.1.36 124

PRODUCT NAME.....	124
DATE	124
FIRMWARE FILE INFORMATION	124
ENHANCEMENT	124
BUG FIX	124

FIRMWARE VERSION 1.0.1.18 126

PRODUCT NAME.....	126
DATE	126
FIRMWARE FILE INFORMATION	126

FIRMWARE VERSION 1.0.7.71

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

Boot 1.0.1.35; Core 1.0.7.12; Prog 1.0.7.71

DATE

08/21/2026

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: cfce3555afa0c52b323c60258a513a04

ENHANCEMENT

- Added Two LCD languages support: Marathi and Hindi
- Improved BLF Call-Pickup LCD display with Zoom
- Added Turkish letters support in Q9 Input Method
- Added Call Settings shortcut selection on idle screen
- Added Support of "Accept-Language" SIP header in SIP messages [USE ACCEPT-LANGUAGE HEADER]
- Added Support to set the account selection mode when placing a call from the dialing interface [ACCOUNT SELECTION MODE FOR DIALING]
- Improved provisioning behavior to apply the configuration file server address specified in SIP NOTIFY messages

BUG FIX

- Fixed Device using call history entry on dial screen isn't using selected line to dial out
- Fixed Shortcut key for disabling call forwarding doesn't follow the feature codec customization

NEW FEATURES OVERVIEW

USE ACCEPT-LANGUAGE HEADER

- Web Configuration**

This option can be found under device web UI → Account X → SIP Settings:

Use Accept-Language Header ?

Disabled



- **Functionality**

Whether to carry the Accept-Language header field in SIP Register and SIP Response for SIP INVITE. If configured as "Disabled", the header field will not be carried; if configured as "Auto", it will follow the terminal's "System Settings / Time and Language / Language / Display Language" configuration; if configured as a specific language, the Accept-Language header field will be set to that specified language.

- **Pvalues**

Pvalue	Description	Value Range	Default
95036/95136/95236/ 95336/95436/95536	<New Pvalue> Use Accept-Language Header	String: Arabic (ar) Catalan (ca) Czech (cz) Danish (da) Deutsch (de) Greek (el) English (en) Spanish (es) Francais (fr) Hebrew (he) Hindi (hi) Hrvatski (hr) Magyar (hu) Italiano (it) japanese (ja) korean (ko) latvian (lv) Marathi (mr) Dutch (nl) Polski (pl) Portugue (pt) Russian (ru) Svenska (se) Slovenian (sl) Slovakian (sv) Turkish (tr) Ukrainian (uk) simplified_chinese (zh) Auto (Auto) traditional_chinese (zh-tw) Disabled (Disabled)	Disabled

ACCOUNT SELECTION MODE FOR DIALING

- **Web Configuration**

This option can be found under device web UI → Phone Settings → Call Settings:

Account Selection Mode for Dialing ?

Auto

- **Functionality**

This setting determines the account selection mode when placing a call through the dialing interface. If set to "Auto", when dialing a number selected from call history or contacts, the system will use the

account that was used in the previous call with that number or the account configured for that contact. If set to "Current Account", when dialing a number selected from call history or contacts, the system will use the account that is currently displayed/selected in the dialing interface.

- **Pvalues**

Pvalue	Description	Value Range	Default
82363	<New Pvalue> Account Selection Mode for Dialing	Number : 0 – Auto 1 – Current Account	0

FIRMWARE VERSION 1.0.7.66

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

Boot 1.0.1.35; Core 1.0.7.10; Prog 1.0.7.66

DATE

06/03/2026

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin
- MD5: ff8c77c0d0ec1c24d4d5aecf3b8a70fb

ENHANCEMENT

- Improved Web UI language translations
- Improved LCD custom softkey display

BUG FIX

- Fixed an audio issue during calls in certain TLS-based SIP deployments
- Fixed incorrect time zone display

FIRMWARE VERSION 1.0.7.64

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

04/29/2026

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: eb86287f28d74352e474e1dd00f532a7

ENHANCEMENT

- Updated LDAP search behavior for better server compatibility

FIRMWARE VERSION 1.0.7.63 (BETA ONLY)

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

04/24/2026

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 219f406ae857d7a7ae6981d12f9c7051

ENHANCEMENT

- Added Support of Call Monitor--BMWT Function for Zoom [CALL MONITOR FUNCION]
- Added Support to individually change hard coded star codes [LOCAL CALL FEATURE MODE IMPROVEMENT]
- Added Support to force * code to be sent to the server
- Added Support to send DTMF via SIP INFO after receiving 180 Ringing
- Improved LCD Caller ID display
- Update several customized softkey icons
- Updated BLF on non-primary page display
- Added Swap softkey for Shared line multiple simultaneous calls
- Updated Time zone value

BUG FIX

- Fixed Device LCD freezes randomly while WebUI remains accessible

NEW FEATURES OVERVIEW

CALL MONITOR FUNCION

- **Web Configuration**

This option can be found under device web UI → Account X → Advanced Settings:

Enable Call Monitor Function  ☒

Support Call Monitor Privacy Mode  ☒

Barge-in Feature Code 

Listen Feature Code 

Whisper Feature Code 

Takeover Feature Code 

• Functionality

Enable Call Monitor Function: Configure to enable the call monitor function.

Support Call Monitor Privacy Mode: The configuration supports the privacy mode for call monitor, which can be manually switched on or off on the LCD after it is supported.

Barge-in Feature Code: Configure the call monitor barge-in feature code.

Listen Feature Code: Configure the call monitor listen feature code.

Whisper Feature Code: Configure the call monitor whisper feature code.

Takeover Feature Code: Configure the call monitor takeover feature code.

• Pvalues

Pvalue	Description	Value Range	Default
95017/95117/95217/ 95317/95417/95517	<New Pvalue> Enable Call Monitor Function	Number : 0 – No 1 – Yes	1
95018/95118/95218/ 95318/95418/95518	<New Pvalue> Support Call Monitor Privacy Mode	Number : 0 – No 1 – Yes	1
95019/95119/95219/ 95319/95419/95519	<New Pvalue> Barge-in Feature Code	String	null
95020/95120/95220/ 95320/95420/95520	<New Pvalue> Listen Feature Code	String	null
95021/95121/95221/ 95321/95421/95521	<New Pvalue> Whisper Feature Code	String	null
95022/95122/95222/ 95322/95422/95522	<New Pvalue> Takeover Feature Code	String	null

LOCAL CALL FEATURE MODE IMPROVEMENT

• Web Configuration

This option can be found under device web UI → Account X → Feature Codes:

Local Call Features Mode ?

Enabled

Disabled

Enabled

Call Forward & DND Only

Enabled without Feature Codes

- **Functionality**

Local Call Features Mode:

If set to "Disabled", the provisioned feature codes from the server will be used. User configured feature codes will be used only if server provisioned feature codes are not provided.

If set to "Enabled", phone can perform Do No Disturb, Call Forwarding and other call features locally.

If set to "Call Forwarding & DND Only", phone can only perform Do No Disturb and Call Forwarding feature locally.

If set to "Enabled without Feature Codes", phone can perform local call features, but lacks local feature codes support.

- **Pvalues**

Pvalue	Description	Value Range	Default
191/420/520/ 620/720/820	<New Pvalue> Local Call Features Mode	Number : 0 – Disabled 1 – Enabled 2 – Call Forward & DND only 3 – Enabled without Feature Codes	1

FIRMWARE VERSION 1.0.7.49

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

01/21/2026

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: c228da178a4b733e2670abe9108c1b82

ENHANCEMENT

- Added Support to control the registration retry interval when the server returns 403 Forbidden [REGISTRATION RETRY WAIT TIME(S) UPON 403 FORBIDDEN]
- Added Support to set Geolocation Header Format [GEOLOCATION HEADER FORMAT]
- Added Support to add Auth Header on Re-Register [ADD AUTH HEADER ON RE-REGISTER]
- Added Support to control reboot when receiving SIP NOTIFY with "Event: Check-Sync" header for each SIP account [REBOOT ON CHECK-SYNC EVENT WITHOUT "REBOOT="]
- Added Support to upload Third-party Vendor Configuration (Yealink and Fanvil are supported for now)

BUG FIX

- Fixed Device cannot pick up calls with certain feature code

NEW FEATURES OVERVIEW

REGISTRATION RETRY WAIT TIME(S) UPON 403 FORBIDDEN

- Web Configuration**

This option can be found under device web UI → Account X → SIP Settings:

Registration Retry Wait Time(s) upon 403 Forbidden ?

1200

- Functionality**

Specifies the interval to retry registration if the process is failed due to 403 Forbidden. Valid range is 0 to 3600 in second. 0 second means stopping retry registration.

- **Pvalues**

Pvalue	Description	Value Range	Default
26002/26102/26202/ 26302/26402/26502	<New Pvalue> Registration Retry Wait Time(s) upon 403 Forbidden	Number : 0-3600	1200

GEOLLOCATION HEADER FORMAT

- **Web Configuration**

This option can be found under device web UI → External Service → E911 Service:

Geolocation Header Format 

Legacy 

- **Functionality**

There are two options in this option:

RFC6442: Geolocation header example is Geolocation: <cid: 8476BD6B-5FDD-339D-900B-AEAB0AA0429A>

Legacy: Geolocation header example is Geolocation: 8476BD6B-5FDD-339D-900B-AEAB0AA0429A

- **Pvalues**

Pvalue	Description	Value Range	Default
8725	<New Pvalue> Geolocation Header Format	Number : 0 – Legacy 1 – RFC6442	0

ADD AUTH HEADER ON RE-REGISTER

- **Web Configuration**

This option can be found under device web UI → Account X → SIP Settings:

Add Auth Header on RE-REGISTER 



- **Functionality**

If enabled, the phone will add Authorization header in RE-REGISTER request.

- **Pvalues**

Pvalue	Description	Value Range	Default
95029/95129/95229/ 95329/95429/95529	<New Pvalue> Add Auth Header on RE-REGISTER	Number : 0 – No 1 – Yes	1

REBOOT ON CHECK-SYNC EVENT WITHOUT "REBOOT="

- **Web Configuration**

This option can be found under device web UI → Account X → Advanced Settings:

Reboot on check-sync event without "reboot=" 



- **Functionality**

If option is enabled, the phone will do reboot when receiving SIP NOTIFY check-sync event without "reboot=" header. If the option is disabled, the phone will do provision and not reboot when receiving SIP NOTIFY check-sync event without "reboot=" header.

- **Pvalues**

Pvalue	Description	Value Range	Default
95030/95130/95230/ 95330/95430/95530	<New Pvalue> Reboot on check-sync event without "reboot="	Number : 0 – No 1 – Yes	1

FIRMWARE VERSION 1.0.7.39

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

10/21/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 098513543cff810e99921acda16b115c

ENHANCEMENT

- Added Support to change Call-ID to use host IP address [CALL-ID DOMAIN MODE]
- Added support for alert-info Bellcore mapping [ALERT-INFO BELLCORE MAPPING]
- Added Support to generate WLAN Session Keys file for Wi-Fi supported models [GENERATE WLAN SESSION KEYS FILE]
- Updated Web UI strings translation for German
- Added Support of "Dial DTMF" key mode for Custom Call Screen Softkeys
- Increased the Maximum allowed length for "SIP TLS Private Key" to more than 2048 characters

BUG FIX

- Fixed Device does not sending SIP TLS certificate under certain scenarios
- Fixed Device call quality issue when using Wi-Fi for Wi-Fi supported models

NEW FEATURES OVERVIEW

CALL-ID DOMAIN MODE

- Web Configuration**

This option can be found under device web UI → Phone Settings → Call Settings:

Call-ID Domain Mode 

Masked Info 

- Functionality**

Configure the Call-ID domain format.

If the Plaintext Host IP Address is selected, the Call-ID domain will use the Host IP address in plaintext.

If Masked Info is selected, the Host IP address will be transformed according to the built-in rules, and the resulting value will be used in the Call-ID domain.

- **Pvalues**

Pvalue	Description	Value Range	Default
22653	<New Pvalue> Call-ID Domain Mode	Number : 0 – Masked Info 1 – Plaintext Host IP Address	0

ALERT-INFO BELLCORE MAPPING

- **Web Configuration**

This option can be found under device web UI → Account X → Call Settings:

Enable Alert-Info Bellcore Mapping  ☐

- **Functionality**

This feature allows the IP phone to enable or disable the mapping of keywords in the Alert-Info header to predefined Bellcore ring tones.

When an Alert-Info header containing "Bellcore-dr%N" is received—where N is a value between 1 and 5—the corresponding Bellcore ring tone will be played if the option is enabled. If the option is disabled, a corresponding custom ring tone will be played instead.

When N is 0, a silent ringtone will be used. When N is 6, a corresponding custom ringtone will always be played, regardless of the option setting.

If N is outside the valid range (i.e., less than 0 or greater than 6), the default ring tone will be used.

- **Pvalues**

Pvalue	Description	Value Range	Default
95026/95126/95226/ 95326/95426/95526	<New Pvalue> Enable Alert-Info Bellcore Mapping (Account 1 – 6)	Number : 0 -- Disabled 1 -- Enabled	1

GENERATE WLAN SESSION KEYS FILE

- **Web Configuration**

This option can be found under device web UI → Maintenance → System Diagnostics:

Generate WLAN Session Keys File  ☐

- **Functionality**

After this configuration is enabled, the packet capture will carry the WLAN session key file, named 80211_keys, which records the WLAN session keys that the device has gone through from the start to the end of the capture process.

- **Pvalues**

Pvalue	Description	Value Range	Default
--------	-------------	-------------	---------

22619	<New Pvalue> Generate WLAN Session Keys File	Number : 0 – No 1 – Yes	0
-------	---	-------------------------------	---

FIRMWARE VERSION 1.0.7.32

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

8/8/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 67daebc758e4357afc97bfdc128ddd4f

ENHANCEMENT

- Added Support of Security Version display on the web UI
- Set Web Access Default value to HTTPS
- Disabled IP call after factory reset
- Limited SSH Public Key length to 2048 bits
- Disabled All Weak TLS Cipher Suites by default
- Set Minimum TLS Version default value to TLS V1.2
- Added Support to modify keypad lock icon display with XML file
- Added Support to configure media NAT traversal strategies [MEDIA NAT TRAVERSAL]
- Added Support of ICE function [CANDIDATE TYPE]
- Added Support of Silent Call mode for Programmable keys

BUG FIX

- Fixed Device XML idle screen not working accurately
- Fixed Device stops to send RTP after UCM HA failover event
- Fixed Device BLF turns off randomly
- Fixed Device disconnects from Wi-Fi and reconnects to another AP
- Fixed Device randomly stops registering the SIP account when using DNS SRV mode
- Fixed Cairo time zone display
- Fixed Certain TLS certificate not working

NEW FEATURES OVERVIEW

MEDIA NAT TRAVERSAL

- **Web Configuration**

This option can be found under device web UI → Account X → General Settings:

Media NAT Traversal  Auto 

- **Functionality**

To configure media NAT traversal strategies:

If configured as "No," media NAT traversal will not be used.

If configured as "Auto," it will follow the business logic of the "NAT traversal(STUN)" configuration.

If configured as "STUN," it will obtain the public IP and port information after NAT through a shared STUN server.

If configured as "TURN," it will forward the data stream through a TURN relay server.

If configured as "ICE," it will collect local IP addresses, STUN-reflected addresses, and TURN relay addresses to dynamically select the optimal connection path.

- **Pvalues**

Pvalue	Description	Value Range	Default
95002	<New Pvalue> Media NAT Traversal	Number : 0 – No 1 – Auto 2 – STUN 3 – TURN 4 – ICE	1

CANDIDATE TYPE

- **Web Configuration**

This option can be found under device web UI → Account X → General Settings:

Candidate Type  All 

- **Functionality**

Configure the ICE candidate type.

If "All" is selected, all address types will be collected.

If "Relay Candidates Only" is selected, the candidate addresses will be obtained through a TURN server, which will act as a relay for the media stream.

- **Pvalues**

Pvalue	Description	Value Range	Default
95005	<New Pvalue> Candidate Type	Number : 0 – All 1 – Relay Candidates Only	0

FIRMWARE VERSION 1.0.7.24

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

6/17/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: c09b442ae0acd34ed3100f9e6c89a56a

BUG FIX

- Fixed Device randomly disconnects from current Wi-Fi and reconnects to another AP
- Fixed BLF not working correctly with some PBX
- Fixed Device RFC2543 Hold feature not working correctly

FIRMWARE VERSION 1.0.7.23

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

6/4/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin
- MD5: cf018294cf2c9edf39f17f55e3f3a9d2

ENHANCEMENT

- Added Support to change the style of softkey bar [SOFTKEY BAR STYLE]

BUG FIX

- Fixed Device does not accept OpenVPN ciphers format from Pfsense
- Fixed No on hold reminder tone after attended transfer ends
- Fixed Device stuck on call screen after performing attended transfer

NEW FEATURES OVERVIEW

SOFTKEY BAR STYLE

- Web Configuration**

This option can be found under device web UI → System Settings → Preferences → Display Control:

Configure the softkey bar style ?

Style 1

- Functionality**

Configure the softkey bar style.

- Pvalues**

Pvalue	Description	Value Range	Default
22622	<New Pvalue> Configure the softkey bar style	Number : 0 – Style 1 1 – Style 2 2 – Style 3 3 – Style 4	0

FIRMWARE VERSION 1.0.7.19

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

5/5/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 88f570a7bba06e366ef15f45810d8ab9

ENHANCEMENT

- Added Support of Silent Call Mode to VPK/MPK

BUG FIX

- Fixed Device cannot do call transfer to a contact from remote phonebooks
- Fixed Remote phonebooks does not auto download after factory reset and provision

FIRMWARE VERSION 1.0.7.15

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

4/18/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 496ef7396a3a5879fd37cc64d6d48d00

ENHANCEMENT

- Added Support of Syslog Header Format [SYSLOG HEADER FORMAT]

BUG FIX

- Fixed Device handles simultaneous call answer issue
- Fixed Device syslog has no timestamp sometimes when using audiocodes syslog viewer
- Fixed Device does not take Voice Vlan until GDMS provisioning is completed after factory reset
- Fixed Blind transfer fails via softkey

NEW FEATURES OVERVIEW

SYSLOG HEADER FORMAT

- Web Configuration**

This option can be found under device web UI → Maintenance → System Diagnostics → Syslog:

Syslog Header Format [?](#)

Legacy

- Functionality**

Configure header format for syslog.

- Pvalues**

Pvalue	Description	Value Range	Default
8723	<New Pvalue> Syslog Header Format	Number : 0 – Legacy 1 -- RFC3164 Compliant	0

FIRMWARE VERSION 1.0.7.11

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

3/10/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 89c7f27d713aa92b73bce2e1e7aabbcc

ENHANCEMENT

- Updated Web UI strings
- Added Support of Monitored Voicemail Access Number [MONITORED VOICEMAIL ACCESS NUMBER]

BUG FIX

- Fixed Device randomly lost Wi-Fi connection
- Fixed Device phonebook search issue from LCD menu
- Fixed Device BLF monitoring issue

NEW FEATURES OVERVIEW

MONITORED VOICEMAIL ACCESS NUMBER

- Web Configuration**

This option can be found under device web UI → Account x → General Settings:

Monitored Voicemail Access Number 

- Functionality**

Configure the access code to monitor the voicemail box, and after configuration, it can monitor the voicemail box status of the corresponding account.

- Pvalues**

Pvalue	Description	Value Range	Default
60076/60176/60276/ 60376/20476/20576	<New Pvalue> Monitored Voicemail Access Number	String	null

FIRMWARE VERSION 1.0.7.10

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

1/21/2025

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: c27d6958dfd9988b5f31ed886238ba40

ENHANCEMENT

- Added Support of updated Click2Dial Added-on to share desktop and files
- Added Support of multicast timer
- Added Support of SIP URI format in peer-to-peer calling deployment
- Added Support to configure static DNS SRV
- Increase work field size in Contacts
- Added Support to use existing SIP session used for registration/calls for the RTCP-XR VQ collector
- Added Support to display call forward icon when call forwarding is enabled using the feature codes from UCM
- Improved XML customization idle screen
- Improved LDAP search feature
- Added Support to complete the attended transfer by on-hooking the phone
- Added Support to enable local dialing DTMF tone in speaker mode
- Added Support to send syslog debug messages after reset
- Added Support of direct SIP URI calls by entering a hostname in the speed dial value field
- Added Support of certain special characters in hostname for SIP URI dialing
- Added Support to control whether there is key pressing tone when dialing number at dialing page
- Updated web UI tooltip
- Added Support of 802.1X configuration from LCD menu
- Added Support to make calls when LCD has "missed calls" notification
- Improved Device vulnerability
- Added Support of "LDAP search" custom softkey to dial window
- Added Support of 802.1x under Ethernet for non Wi-Fi models
- Added Support of SCEP
- Added Support of AI Noise Suppression

BUG FIX

- Fixed Device random screen error
- Fixed Device rebooting issue
- Fixed Device transfer does not work under certain environments
- Fixed Device voice delay issue
- Fixed Device SIP registration issue via TLS
- Fixed Device randomly freezes after idle for a few hours
- Fixed Device does not showing full name after dialing number searched from LDAP
- Fixed Device activates multicast function when the multicast paging function is unchecked
- Fixed Device audio issue when using codec G729
- Fixed Device only displays first LDAP attribute while ringing
- Fixed Device time zone display for Helsinki, Athens, Talin, and Tehran
- Fixed Device does not request the config file via TFTP
- Fixed OpenVPN connection issue
- Fixed Device stuck in a loop when trying to get the call out between the primary and then the failover SIP server while using DNS SRV
- Fixed Device keeps sending EAPOL Start when a linux PC is connected to PC port
- Fixed Letter 'e' is missing in Italian language

FIRMWARE VERSION 1.0.5.71

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DTMF event DATE

12/6/2024

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 22b2782ad41de5224b37413f979ea416

ENHANCEMENT

- Added Support of LLDP Timeout before DHCP Request [LLDP TIMEOUT BEFORE DHCP REQUEST]

BUG FIX

- Fixed Device NameFilter and NumberFilter attributes display improperly
- Fixed Device works abnormally when using 802.1x authentication

NEW FEATURES OVERVIEW

LLDP TIMEOUT BEFORE DHCP REQUEST

- Web Configuration**

This option can be found under device web UI → Network Settings → Advanced Settings:

LLDP Timeout before DHCP Request (s) ?

- Functionality**

Configure the timeout period for LLDP to wait before DHCP requests. 0 means not waiting.

- Pvalues**

Pvalue	Description	Value Range	Default
22606	<New Pvalue> LLDP Timeout before DHCP Request (s)	Number	0

FIRMWARE VERSION 1.0.5.68

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

11/8/2024

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 382414c98f7954427386e60e18ad3c6a

ENHANCEMENT

- Added Support to disable voicemail
- Added Support to disable codec display during a call
- Added Support to configure a failover OpenVPN server

BUG FIX

- Fixed Device alias for “Enable Speaker Key” function is inverted
- Fixed Device cannot register an extension using SRV over TCP
- Fixed Device gets stuck when it’s using DNS SRV

FIRMWARE VERSION 1.0.5.65

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

10/28/2024

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: f6e9a855683033ccde2867548375ff24

ENHANCEMENT

- Added Support to dial without closing the missed call notification
- Updated the term to “block list” on the LCD menu
- Updated Spanish strings on the LCD display

BUG FIX

- Fixed Device doesn't answer to DHCP packet when CoS is set on default VLAN
- Fixed Device Transfer Softkey for On Hold state is not displayed
- Fixed Device Local phonebook exact match search is not working
- Fixed Device status changes randomly in GDMS
- Fixed Device randomly report abnormal connection to GDMS

FIRMWARE VERSION 1.0.5.60

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

7/3/2024

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: e10d94f679bd559253a228808da5b4f4

ENHANCEMENT

- Added Support of [x\X*]+ in dial plan
- Added Support of Enhanced Call Park [ENHANCED CALL PARK]
- Added Support to configure the PEAP 802.1X settings from LCD menu
- Improved Syslog to be more user-friendly
- Added Support of tertiary SIP Server
- Added Support to send 'R' as DTMF event
- Added Support to setup speed dial using the numeric key on the keypad

BUG FIX

- Fixed Device audio delay issue when it performs transfers while answering incoming call
- Fixed Device default value in the tooltips of Enable TR069

NEW FEATURES OVERVIEW

ENHANCED CALL PARK

- **Web Configuration**

The related options can be found under device web UI → Phone Settings → Call Settings:

Enable Call Park Softkey [?](#) ☒

Call Park Softkey Feature Code [?](#)

Call Park Retrieve Softkey Feature Code [?](#)

Group Call Park Softkey Feature Code [?](#)

• **Functionality**

Enable Call Park Softkey: Configures to enable call park service to use call park related softkeys.

Call Park Softkey Feature Code: Configure the feature access code for parking current call to parking lot or another extension.

Call Park Retrieve Softkey Feature Code: Configure the feature access code for retrieving the parked call on accounts or parking lot.

Group Call Park Softkey Feature Code: Configure the feature access code for parking current call to the group current user is in.

• **Pvalues**

Pvalue	Description	Value Range	Default
8611	<New Pvalue> Enable Call Park Softkey	Number : 0 – No 1 - Yes	1
8613	<New Pvalue> Call Park Softkey Feature Code	String	
22559	<New Pvalue> Call Park Retrieve Softkey Feature Code	String	
8614	<New Pvalue> Group Call Park Softkey Feature Code	String	

FIRMWARE VERSION 1.0.5.54

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

5/9/2024

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: ad4db0317bb9b3265f7c4be284676378

ENHANCEMENT

- Added Support to stop the warning beep sound when receiving a multicast paging call
- Disabled the user account by default (require factory reset)

BUG FIX

- Fixed Initial audio issue after establishing a call
- Fixed Device display issue for certain time zones
- Fixed Device OVPN server connecting issue
- Fixed Device sending wrong RTCP packets data
- Fixed Device SSH Vulnerability

FIRMWARE VERSION 1.0.5.50

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

4/15/2024

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: cba6056e124622b56d1f6e0475f18523

BUG FIX

- Fixed Initial audio issue after establishing a call
- Fixed Device display issue for certain time zones
- Fixed Device OVPN server connecting issue

FIRMWARE VERSION 1.0.5.46

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

3/12/2024

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: e8ecbd088e181768bfb9f7a50c3e0a5c

ENHANCEMENT

- Improved Maximum group number in Contacts to 128
- Improved Maximum XML remote phonebook number to 5
- Added Support to disable the indicator when recording
- Updated Device web UI tooltip for trusted domain setting
- Added Support to disable local DTMF tone at dialing page
- Added Support to do direct SIP URI calls with VPK/MPK
- Added Support of valid hostname for sip uri dialing

BUG FIX

- Fixed Device PC port in in half duplex mode
- Fixed Device audio issue when using codec G729
- Fixed Device only displays the first attribute of LDAP during ringing
- Fixed Device cannot resume the first call after doing attended transfer and the transferee rejects the call
- Fixed Device activates Multicast function after the Multicast Paging function is disabled
- Fixed Device does not send RTP after receiving 181 SIP message

FIRMWARE VERSION 1.0.5.38

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

12/8/2023

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: a8773bd0685b26308d34cec253b5a8af

ENHANCEMENT

- Improved Device to clear warning icon automatically from the LCD after a certain period of time
- Added Support to configure static DNS SRV records
- Added Support to have a LED signaling when receiving an incoming call [ENABLE INCOMING CALL INDICATOR]
- Added Support of codec G726-16/24/40
- Added Support to disable Headset key for option "Headset Key Mode"
- Updated the customized softkey icons
- Added Support of Transfer to VM feature code [TRANSFER TO VM FEATURE CODE]
- Added Support of VPK Paging Auto Return Timeout [VPK PAGING AUTO RETURN TIMEOUT(S)]
- Added Support to send syslog debug messages after factory reset [MAINTAIN SYSTEM LOG INFO AFTER FACTORY RESET]

BUG FIX

- Fixed Device cannot register SIP accounts via TLS under certain circumstances
- Fixed The Accounts in the uploaded phonebook will change to "Auto" instead of what it is configured
- Fixed Device syslog shows wrong port information used for SIP while SIP message is using the right port
- Fixed Device freezes after few hours under certain circumstances
- Fixed Device XML customization idle screen issue
- Fixed Device call gets disconnected when receiving incoming call for certain platform
- Fixed Device does not send LDAP queries under certain configurations
- Fixed Device does not display full name after dialing number searched from LDAP

NEW FEATURES OVERVIEW

ENABLE INCOMING CALL INDICATOR

- Web Configuration**

This option can be found under device web UI → System Settings → Preferences → Display Control:

Enable Incoming Call Indicator  ☐

- Functionality**

If set to “Yes”, the LED indicator on the upper right corner of the phone will light up when there is incoming call on the phone.

- Pvalues**

Pvalue	Description	Value Range	Default
82285	<New Pvalue> Enable Incoming Call Indicator	Number : 0 – No 1 - Yes	0

TRANSFER TO VM FEATURE CODE

- Web Configuration**

This option can be found under device web UI → Account X → Call Settings → Transfer:

Transfer to VM feature code 

*

- Functionality**

During a call, press the transfer to voicemail softkey or voicemail hard button, enter the extension number, and then transfer the call to the extension voicemail. At this point, the code will be used as an extension prefix and called into the server to complete the transfer to voicemail event.

- Pvalues**

Pvalue	Description	Value Range	Default
60092/60192/60292/ 60393/60492/60592	<New Pvalue> Transfer to VM feature code	String	*

VPK PAGING AUTO RETURN TIMEOUT(S)

- Web Configuration**

This option can be found under device web UI → Programmable Keys → Advanced Settings:

VPK Paging Auto Return Timeout(s) 

0

- Functionality**

Define the timeout period for returning to the main interface after paging through the VPK button. 0 is not returned.

- Pvalues**

Pvalue	Description	Value Range	Default
--------	-------------	-------------	---------

8670	<New Pvalue> VPK Paging Auto Return Timeout(s)	Number	0
------	---	--------	---

MAINTAIN SYSTEM LOG INFO AFTER FACTORY RESET

- Web Configuration**

This option can be found under device web UI → Maintenance → System Diagnostics → Syslog:

Maintain System Log Information after Factory Reset  ☐

- Functionality**

If Enable, syslog settings and internal logs will be saved across a factory reset.

- Pvalues**

Pvalue	Description	Value Range	Default
82307	<New Pvalue> Maintain System Log Information after Factory Reset	Value = 0; No Value = 1; Yes	0

FIRMWARE VERSION 1.0.5.26

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

11/11/2023

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 0bf5a7770137f3eb8cfc51203ef40d3d

ENHANCEMENT

- Improved Web UI display strings
- Increased work field maximum length in Contact to 128
- Improved Device to use the same server/port that is used for SIP registration to process XR reports

NEW FEATURES OVERVIEW

VQ RTCP-XR COLLECTOR ADDRESS SELECTION

- Web Configuration**

This option can be found under device web UI → Account X → Codec Settings:

VQ RTCP-XR Collector Address Selection ?

Manual

- Functionality**

When select Manual, the collector address will be manually configured and transmitted using the SIP Transport protocol. When select Auto, if the collector address is manually filled in, use this address. If not filled in, use the SIP registered address.

- Pvalues**

Pvalue	Description	Value Range	Default
60087/600187/600287/ 600387/600487/600587	<New Pvalue> VQ RTCP-XR Collector Address Selection	Number : 0 – Manual 1 - Auto	0

FIRMWARE VERSION 1.0.5.25

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

08/22/2023

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 66eec4629b9d6bc60c46705fcc17e03b

ENHANCEMENT

- Improved Wi-Fi settings from LCD menu requires administrator authentication
- Added Serial under display on Web UI System Info page
- Improved Incorrect display format of warning info on the LCD
- Improved LCD strings display
- Improved Voice delay issue
- Added Support of SIP URI calls
- Added Support to display call forward icon when the call forward is enabled by feature code from the device and also "Feature key sync" is enabled
- Added Support of multicast timer [MULTICAST CALL TIMEOUT(S)]

BUG FIX

- Fixed Device does not send INVITE to secondary server if registration fails on primary server
- Fixed Device crashes when avstem operation and phone enters the deep energy-saving mode
- Fixed Password of GDS by manual input cannot be deleted from web UI
- Fixed some devices cannot play ringtone issue
- Fixed some devices get stuck at Grandstream Logo during bootup
- Fixed Transfer process doesn't work under certain environment
- Fixed Devices randomly get screen error

NEW FEATURES OVERVIEW

MULTICAST CALL TIMEOUT(S)

- **Web Configuration**

This option can be found under device web UI → Phone Settings → Multicast Paging:

Multicast Call Timeout(s) ?

- **Functionality**

Set multicast based call timeout. When the multicast call exceeds the set time, it will automatically hang up and set to 0 without timeout.

- **Pvalues**

Pvalue	Description	Value Range	Default
22532	<New Pvalue> Multicast Call Timeout(s)	Number	0

FIRMWARE VERSION 1.0.5.19

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

06/29/2023

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: a54494ed2aad15f483bdf7f0c129b2d4

ENHANCEMENT

- Added Support to hide LCD pop-up options [HIDE POP-UP OPTIONS]
- Updated MPK value mapping
- Added Support of MPK/VPK mode HTTP command
- Added Support of MPK/VPK mode Call Flip
- Updated VPK Value name max length to 256
- Added Support of Trusted Domain Name List [TRUSTED DOMAIN NAME LIST]
- Optimized Device web UI organization for Call Settings tab under Phone Settings
- Added Support of Phonebook Matching [PHONEBOOK MATCHING]
- Added Support of Virtual Extension Board
- Added Support of Exty App for the option Auto Provision List Starting Point
- Added Support to configure SSH port [SSH PORT]
- Added Support of Online Contacts [ONLINE CONTACTS]
- Added Support of TLS 1.3 for Client Certificate
- Added Support of In-call Contact Info Display [IN-CALL CONTACT INFO DISPLAY]
- Added Support to play the ringtone contained in Alert-Info sent from server

BUG FIX

- Fixed Quick IP Call page have no dial tone
- Fixed Device cannot make outgoing call under certain network environment
- Fixed Device cannot delete block entries when deleting all CTI history
- Fixed Device LCD Arabic/Hebrew display issue
- Fixed Device does not apply VLAN when set by LLDP
- Fixed Device Transfer custom softkey does not display in call after enabling Custom Softkey Layout
- Fixed Device shows previous guest address after logging out hoteling with Broadsoft

- Fixed Device DNS display issue
- Fixed MPK restriction issue when keypad lock is turned on

NEW FEATURES OVERVIEW

HIDE POP-UP OPTIONS

- **Web Configuration**

This option can be found under device web UI → Phone Settings → General Settings:



- **Functionality**

Configure to control LCD prompt.

When set to Disable (Default), Device will show all the prompts.

When set to All Info, All the Information prompts will be hidden.

When set to All alarm & All info, All the information and alarm prompts will be hidden.


When set to All, All the prompts will be hidden.

When set to Custom, users can choose which prompt to be hidden.

TRUSTED DOMAIN NAME LIST

- **Web Configuration**

This option can be found under device web UI → Account x → Advanced Settings:



- **Functionality**

Fill in the list of trusted domain names, which supports filling in the SAN list used only for domain name verification in TLS to obtain certificates. If it matches any item in the trusted domain name list, the certificate is trusted. By default, the remote proxy domain name and SIP server domain name are trusted.

- **Pvalues**

Pvalue	Description	Value Range	Default
60082/60182/60282/ 60382/60482/60582	<New Pvalue> Trusted Domain Name List	String	Null

PHONEBOOK MATCHING

- **Web Configuration**

This part can be found under device web UI → Phone Settings → Call Settings:

Enable Phonebook Matching Rules ?

- ☐ Dial number
- ☐ Query number
- ☐ Display number

Phonebook Matching Rules ?



Phonebook Matching Rules Test ?

Number

>>

Test result

• Functionality

Enable Phonebook Matching Rules: Enable phonebook matching rules. Multiple options are supported. This function is disabled by default.

→ Dial number Indicates the dialing number will be processed.

→ Query number Indicates the number for querying contact will be processed.

→ Display number Indicates the number displayed of the receiver will be processed.

Phonebook Matching Rules: Configure rules for processing numbers. Numbers of 4,7, and 9 digits can be matched from top to bottom.

Phonebook Matching Rules Test: Enter the number to test the rules.

• Pvalues

Pvalue	Description	Value Range	Default
22473	<New Pvalue> Enable Phonebook Matching Rules	String	Null
22472	<New Pvalue> Phonebook Matching Rules	String	Null

SSH PORT

• Web Configuration

This option can be found under device web UI → System Settings → Security Settings:

SSH Port ?

22

• Functionality

Configures the port for SSH access.

• Pvalues

Pvalue	Description	Value Range	Default
27006	<New Pvalue> SSH Port	Number	22

ONLINE CONTACTS

- Web Configuration**

This part can be found under device web UI → Application → Online Contacts:

Contacts Search URL ?

Contacts search HTTP POST ?

Contacts Search Auth Username ?

Contacts Search Auth Password ?

Contact Search Response Syntax ?

Response Syntax

success:/success,
 reason:/errorMsg,
 name:/data/name,
 title:/data/position,
 department:/data/orgNamePath,

- Functionality**

Contacts Search URL: Contacts Search URL to search contacts. This field could be protocol, server address, path, or query parameters, with up to 256 characters.

Contacts search HTTP POST: Configures the HTTP POST to search contacts. This field could be protocol, server address, path, or query parameters, with up to 1024 characters.

Contacts Search Auth Username: Configures the auth username for the Searching HTTP/HTTPS server.

Contacts Search Auth Password: Configures the password for the Searching HTTP/HTTPS server.

Contact Search Response Syntax: Configure contact search response syntax.

- Pvalues**

Pvalue	Description	Value Range	Default
22467	<New Pvalue> Contacts Search URL	String	Null
22510	<New Pvalue> Contacts search HTTP POST	String	Null
22468	<New Pvalue> Contacts Search Auth Username	String	Null
22469	<New Pvalue> Contacts Search Auth Password	String	Null


22470	<New Pvalue> Contact Search Response Syntax	String	Null
-------	--	--------	------

IN-CALL CONTACT INFO DISPLAY

- Web Configuration**

This option can be found under device web UI → Phone Settings → Call Settings:

[In-call Contact Info Display ?](#)

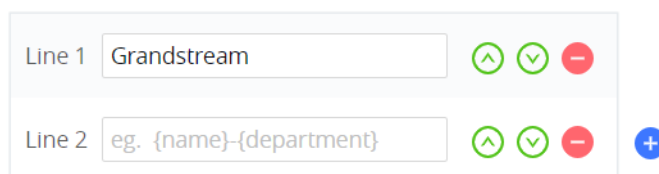

- Functionality**

Configure the contact information displayed during a call, up to 5 lines to display.

- Pvalues**

Pvalue	Description	Value Range	Default
22471	<New Pvalue> In-call Contact Info Display	String	Null

FIRMWARE VERSION 1.0.3.98

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

05/02/2023

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 3373695f3caed41f0fd109839b228041

ENHANCEMENT

- Added Support to display Transfer softkey in call after enabling it in the Custom Call Screen Softkey Layout
- Improved Web UI display strings
- Updated Hebrew translation
- Updated Japanese translation for Web UI strings
- Added Support to stop Packet Capture automatically after reaching the design upper limit
- Added Support to allow adding protocol header in Config Server Path field (Eg:https://) and ignore "Upgrade Via"
- Added Support to display recording indicator when a call is recorded [ENABLE THE INDICATOR IN RECORDING]
- Added Support to adjust Inbound DTMF Volume [INBOUND DTMF VOLUME]
- Added Support to stream a ringtone based on a remote URL
- Added Support of VBeT EHS headset type
- Added Support of multiple departments for the remote phonebook
- Updated the timezone for Mexico
- Added "XML Help Document" link for "Download Device Configuration (XML)" config file
- Added Support to modify the speed dial custom softkey icon

BUG FIX

- Fixed Device Broadsoft guest Address does not go empty after logging out
- Fixed Device zero config provision issue
- Fixed Device does not try to connect to primary OBP after registering to secondary OBP
- Fixed The character "Θ" is not displayed correctly
- Fixed Device does not send snmp trap messages correctly

- Fixed Device cannot process Wi-Fi name that contains spaces correctly
- Removed Grandstream Name from Device configuration backup
- Fixed Config file downloaded from phone should not contain PValues the specific model don't use

NEW FEATURES OVERVIEW

ENABLE THE INDICATOR IN RECORDING

- **Web Configuration**

This option can be found under device web UI → Phone Settings → Call Settings:

Enable the Indicator in Recording  

- **Functionality**

When the call is recorded, the recording indicator is displayed on the LCD.

- **Pvalues**

Pvalue	Description	Value Range	Default
1697	<New Pvalue> Enable the Indicator in Recording	Value = 0; No Value = 1; Yes	Yes

INBOUND DTMF VOLUME

- **Web Configuration**

This option can be found under device web UI → Account X → Codec Settings:

Inbound DTMF Volume 

18

- **Functionality**

Set the volume size when using in-audio DTMF transmission mode. The higher the parameter value, the higher the volume value.

- **Pvalues**

Pvalue	Description	Value Range	Default
60079/60179/60279/ 60379/60479/60579	<New Pvalue> Inbound DTMF Volume	Number: 0 - 32	18

FIRMWARE VERSION 1.0.3.87

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

01/16/2023

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 106c7ef955f48aaa319a902f9d3bd95d

ENHANCEMENT

- Improved Web UI display strings
- Added Support of Public Mode Timeout

BUG FIX

- Fixed Device Call history display issue after CTI modifies the blacklist
- Fixed Device SRTP encryption logo disappears after inviting conference member fails
- Fixed BroadSoft phonebook display issue for contact with Unicode characters
- Fixed Device sends message continuously when UCM conference room invite member is empty
- Fixed The default value of Enable Missed Call Backlight when using maximum Energy Saving mode
- Fixed Device does not apply VLAN while the VLAN is set by LLDP

NEW FEATURES OVERVIEW

PUBLIC MODE TIMEOUT

- Web Configuration**

This option can be found under device web UI → Phone Settings → General Settings:

Public Mode Timeout ?

- Functionality**

Set the public mode timeout (min), the time starts from the last idle state of the phone.

- **Pvalues**

Pvalue	Description	Value Range	Default
2915	<New Pvalue> Public Mode Timeout	Number: 10 - 1440	10

FIRMWARE VERSION 1.0.3.86

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

12/23/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 7e674eff840dd7142f8960054359310c

ENHANCEMENT

- Improved Web UI display strings
- Added warning message for invalid custom certificate uploading
- Added MPK configuration and installation tutorial video link on web UI
- Removed ChaCha20-Poly1305 algorithm from OpenVPN® Cipher Method dropdown list
- Added Support of remote SSH capture
- Improved Web UI displays for Deep energy-saving duration
- Added Support to enable UCM LDAP Auto-config Feature on LCD [UCM LDAP AUTO-CONFIG FEATURE ON LCD]

BUG FIX

- Fixed Device time display issue
- Fixed illegal values can be saved as syslog server
- Fixed Device audio issue with some specific VoIP provider
- Fixed Broadsoft contacts download limit not being enforced properly
- Fixed Failback Expiration doesn't take effect
- Fixed Device displays previous user's local call history after new user signed in
- Fixed Device energy saving data should be recounted after the factory reset
- Fixed remote phonebook name display issue for certain languages
- Fixed Second registration not incrementing nonce counter
- Fixed Device HTTPS upgrade fails when https server timeout is set to 30s

NEW FEATURES OVERVIEW

UCM LDAP AUTO-CONFIG FEATURE ON LCD

- **Web Configuration**

This option can be found under device web UI → Application → LDAP:

Enable UCM LDAP Auto-config Feature on LCD  

- **Functionality**

When it is turned off, the setting soft key supporting UCM LDAP automatic configuration will no longer be displayed on the LCD.

- **Pvalues**

Pvalue	Description	Value Range	Default
22511	<New Pvalue> Enable UCM LDAP Auto-config Feature on LCD	Value = 0; No Value = 1; Yes	1

FIRMWARE VERSION 1.0.3.83

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

11/14/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 018d06be2b5c75ce0145bc63443ff2bb

ENHANCEMENT

- Added Support to dial BLF number with dial plan prefix when pressing the BLF key
- Added Support to display QR code of its SSID to share with cellphones (GRP2602W)
- Updated Customized softkey icons
- Improved Arabi and Hebrew web UI display languages
- Added Support of Energy Saving [ENERGY SAVING]
- Added Support of Total Number of Custom Ringtone Update [TOTAL NUMBER OF CUSTOM RINGTONE UPDATE]
- Added Support to synchronize time via sip header when the NTP server is not configured
- Added Error prompt if configured idle LCD brightness is greater than active LCD brightness
- Added Support to clear user data if a different user logs in [CLEAR USER DATA WHILE DIFFERENT USERS LOG IN]
- Updated "Enable Busy Tone on Remote Disconnect" default value to Yes
- Added Support to display upgrade prompt in LCD screensaver page

BUG FIX

- Fixed Device cannot sync date and time with local NTP server
- Fixed P-Early-Media Header option issue for Account 3
- Fixed Device does not send INVITE to Secondary SIP Server when primary SIP server has no response
- Fixed Device LCD display language does not change after keypad is locked
- Fixed VPK icon error for Call Park and Monitored Call Park
- Fixed Device port issue when sending NTP Request
- Fixed Device DHCP Option 12 does not take effect
- Fixed MWI does not work sometimes if SUBSCRIBE for MWI is enabled
- Fixed Call gets disconnected after holding 30 mins+

- Fixed LDAP search issue

KNOWN ISSUE

- DUT does not support ChaCha20-Poly1305 algorithm

NEW FEATURES OVERVIEW

ENERGY SAVING

- **Web Configuration**

This option can be found under device web UI → System Settings → Energy Saving:

Energy Saving Master Control ?

Standard Mode ▼

- **Functionality**

Provides users the option to reduce their energy cost if they configure the energy saving feature.

- **Pvalues**

Pvalue	Description	Value Range	Default
1000	<New Pvalue> Energy Saving Master Control	Value = 0; Standard Mode Value = 1; Maximum Energy Saving Mode Value = 2; Customized Energy Saving Mode	0

TOTAL NUMBER OF CUSTOM RINGTONE UPDATE

- **Web Configuration**

This option can be found under device web UI → Phone Settings → Ringtone:

Total Number of Custom Ringtone Update ?

6

- **Functionality**

Configures the number of custom ringtones to update in the provisioning process.

- **Pvalues**

Pvalue	Description	Value Range	Default
8509	<New Pvalue> Total Number of Custom Ringtone Update	0 - 10	6

CLEAR USER DATA WHILE DIFFERENT USERS LOG IN

- **Web Configuration**

This option can be found under device web UI → Phone Settings → General Settings:

Clean User Data While Different Users Log In ?

☐

- **Functionality**

When enabled, if the current login account is different with last one, DUT will delete the contact and call history of the last account.

- **Pvalues**

Pvalue	Description	Value Range	Default
8628	<New Pvalue> Clean User Data While Different Users Log In	Value = 0; Yes Value = 1; No	0

FIRMWARE VERSION 1.0.3.72

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

09/02/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 5dba4ab61ba29a280ef8b2362ec9d600

ENHANCEMENT

- Added Support to adjust call tone volume [CALL TONE VOLUME]
- Added Support to disable speaker phone [ENABLE SPEAKER KEY]
- Added Support for the available softkeys layout to be used in the XML idle screen
- Improved LCD strings for different languages
- Improved Web UI display strings for different languages
- Added Support of OpenVPN® Client Key Password [OPENVPN CLIENT KEY PASSWORD]
- Added Support to customize Early media response [EARLY-MEDIA]

BUG FIX

- Fixed Some Web UI tooltips
- Fixed Device does not download phonebook.xml after multiple reboots
- Fixed LCD display hides number in talking after disabling Callee ID Display
- Fixed Device hook switch sometimes does not take effect

NEW FEATURES OVERVIEW

CALL TONE VOLUME

- Web Configuration**

This option can be found under device web UI → System Settings → Preferences → Audio Control:



- Functionality**

This feature allows user to configure call tone volume in dB. The valid range is -15 to 15.

- **Pvalues**

Pvalue	Description	Value Range	Default
22484	<New Pvalue> Call Tone Volume	-15 - 15	0

ENABLE SPEAKER KEY

- **Web Configuration**

This option can be found under device web UI → Phone Settings → Call Settings:

Enable Speaker Key ?

Yes

- **Functionality**

Sets whether to enable the speaker key. When "Yes" is selected, the speaker key can be used to make calls, end calls, and switch channels; when "No" is selected, the speaker key is completely disabled; when "For Switching Channels" is selected, the user cannot use the speaker key to hang up the call.

- **Pvalues**

Pvalue	Description	Value Range	Default
22410	<New Pvalue> Enable Speaker Key	Value = 0; Yes Value = 1; No Value = 2; For Switching Channels	0

OPENVPN CLIENT KEY PASSWORD

- **Web Configuration**

This option can be found under device web UI → Network Settings → OpenVPN® Settings:

OpenVPN® Client Key Password ?



- **Functionality**

This feature allows user to set password for client.key file.

- **Pvalues**

Pvalue	Description	Value Range	Default
20715	<New Pvalue> OpenVPN® Client Key Password	String	NULL

EARLY-MEDIA

- **Web Configuration**

"Use P-Early-Media Header" can be found under device web UI → Accounts → Account X → SIP Settings:

Use P-Early-Media Header  ☐

“Ringback Tone at No Early Media” can be found under device web UI → Accounts → Account X → Call Settings:

Ringback Tone at No Early Media  ☐

- **Functionality**

“Use P-Early-Media Header” is to configure if the “P-Early-Media Header” support is enabled.

“Ringback Tone at No Early Media” is to configure whether to play ringback tone when there is no receiving early media RTP packets.

- **Pvalues**

Pvalue	Description	Value Range	Default
60072/60172/60272/ 60372/60472/60572	<New Pvalue> Use P-Early-Media Header	Value = 0; No Value = 1; Yes	No
60073/60173/60273/ 60373/60473/60573	<New Pvalue> Ringback Tone at No Early Media	Value = 0; No Value = 1; Yes	No

FIRMWARE VERSION 1.0.3.70

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

08/08/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: d076e9067aa530f1a6d28e53dfda89df

ENHANCEMENT

- Updated Device algorithms to make it to be compatible with SSH clients
- Added Greek language support for LCD strings
- Updated Device web UI English strings
- Updated Device web UI Chinese strings
- Updated Device LCD Spanish strings
- Added Warning prompt on web UI if uploading illegal backup config file
- Added Support of ringtone that says the Caller ID in Spanish
- Added Support of Weak Cipher Suites [WEAK SIPHER SUITES]

BUG FIX

- Fixed Some Web UI tooltips
- Fixed Device registered account intermittently becomes invalid
- Fixed Device connection fails when the OpenVPN mode is set to TCP IPv4 only
- Fixed Device RX no sound when DUT makes calls by IPv6 with Symmetric RTP enabled
- Fixed LDAP search shows extra string on some results

NEW FEATURES OVERVIEW

WEAK SIPHER SUITES

- **Web Configuration**

This section can be found under device web UI → System Settings → Security Settings → Client Certificate:

Enable/Disable Weak Cipher Suites ?

SIP TLS Certificate ?

Enable Weak TLS Ciphers Suites ^

Enable Weak TLS Ciphers Suites
 Disable Symmetric Encryption RC4/DES/3DES
 Disable Symmetric Encryption SEED
 Disable All Weak Symmetric Encryption
 Disable Symmetric Authentication MD5
 Disable All Weak TLS Ciphers Suites

• Functionality

This feature defines the function for weak cipher suites. If set to "Enable Weak TLS Cipher Suites", allow users to encrypt data by weak TLS cipher suites. If set to "Disable Symmetric Encryption RC4/DES/3DES", allow users to disable weak cipher DES/3DES and RC4.

• Pvalues

Pvalue	Description	Value Range	Default
8536	<New Pvalue> Enable/Disable Weak Cipher Suites	Value = 0; Enable Weak TLS Ciphers Suites Value = 1; Disable Symmetric Encryption RC4/DES/3DES Value = 2; Disable Symmetric Encryption SEED Value = 3; Disable All Weak Symmetric Encryption Value = 4; Disable Symmetric Authentication MD5 Value = 5; Disable All Weak TLS Ciphers Suites	0

FIRMWARE VERSION 1.0.3.67

PRODUCT NAME

GRP2601(P), GRP2602(P/G/W), GRP2603(P), GRP2604(P)

DATE

07/19/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: a3b702e0e95766ecdcd121f6be049c22

ENHANCEMENT

- Added Support to adjust handset sidetone volume [HANDSET SIDETONE VOLUME]
- Added Support of VMPK in GRP2602/2603 Bypass dial plan
- Added Support of HAC [HAC]
- Added Support of more options for OpenVPN transport [OPENVPN TRANSPORT]
- Updated Device algorithms to improve security

BUG FIX

- Fixed some Web UI tooltips
- Fixed Device registered account intermittently becomes invalid

KNOWN ISSUES

Due to the updated algorithms that aim to improve device security, some SSH clients are not compatible anymore, e.g.: Putty, Kitty.

NEW FEATURES OVERVIEW

HANDSET SIDETONE VOLUME

- Web Configuration**

This section can be found under device web UI → System Settings → Preferences → Audio Control:



- Functionality**

This feature allows user to Configure Handset sidetone volume. The valid range is 0 to 30.

- **Pvalues**

Pvalue	Description	Value Range	Default
22484	<New Pvalue> Handset Sidetone Volume	0 - 30	15

HAC

- **Web Configuration**

This section can be found under device web UI → System Settings → Preferences → Audio Control:

Enable HAC  ☐

- **Functionality**

If enabled, the phone will be compatible with nearby hearing AIDS.

- **Pvalues**

Pvalue	Description	Value Range	Default
22485	<New Pvalue> Handset Sidetone Volume	Value = 0; No Value = 1; Yes	No

OPENVPN TRANSPORT

- **Web Configuration**

This section can be found under device web UI → Network Settings → OpenVPN® Settings:

OpenVPN® Transport  UDP 

- **Functionality**

Configures network protocol used for OpenVPN®.

- **Pvalues**

Pvalue	Description	Value Range	Default
2912	<New Pvalue> OpenVPN® Transport	Value = 0; UDP Value = 1; TCP Value = 2; UDP IPv4 Only Value = 3; TCP IPv4 Only Value = 4; UDP IPv6 Only Value = 5; TCP IPv6 Only	UDP

FIRMWARE VERSION 1.0.3.63

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

06/21/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: d9f6e0b63f394fee958a5070f1a25b75

ENHANCEMENT

- Added warning message when certificate upgrading fails
- Added Support of Individual Certificate information display on LCD
- Added GEN2 individual certificate upgrade mechanism for existing units
- Added Support of E911 Service [E911 SERVICE]
- Added Support of Zoom E911 X-switch-info SIP Header [ZOOM E911 X-SWITCH-INFO SIP HEADER]
- Added Support to include the P-Asserted-Identity Header in the SIP INVITE
- Added Support of "private" string for VPK Key Mode
- Added Support of SIP Intercom config on the Web UI [PAGING CALL MODE]

BUG FIX

- Fixed Intercom softkey is displayed without input
- Fixed Device LCD does not hide call status correctly
- Fixed Device warning icon displays upon initial provisioning with 3CX
- Fixed Device automatic time zone does not display correctly
- Fixed Device abnormal DTMF issue when fast pressing a string of DTMF using RTPevent

NEW FEATURES OVERVIEW

E911 SERVICE

- **Web Configuration**

This section can be found under device web UI → External Service → E911 Service:

Enable E911 [?](#) ☐

HELD Protocol [?](#) HTTP

HELD Synchronization Interval [?](#)

Location Server [?](#)

Location Server Username [?](#)

Location Server Password [?](#)

Secondary Location Server [?](#)

Secondary Location Server Username [?](#)

Secondary Location Server Password [?](#)

HELD Location Types [?](#)

☐ 0 Item Available		☐ 3 Items Selected
	↑	☐ geodetic
	^	☐ civic
	>	☐ locationURI
	<	
	↓	
	⇅	

HELD Use LLDP Information [?](#) ☐

HELD NAI [?](#) ☐

	HELD Identity	HELD Identity Value
1		
2		
3		
4		
5		
6		
7		
8		
9		
10		

E911 Emergency Numbers [?](#)

Geolocation-Routing Header [?](#) ☐

Priority Header [?](#) ☐

- **Functionality**

This feature allows user to enable enhanced 911 call and configure HELD transfer protocol.

- **Pvalue**

Pvalue	Description	Value Range	Default
8565	<New Pvalue> Enable E911	Value = 0; Disable Value = 1; Enable	0
8566	<New Pvalue> HELD Protocol	Value = 0; HTTP Value = 1; HTTPS	0
8567	<New Pvalue> HELD Synchronization Interval	Value = 0; Disable Range: 0, 30-1440 (mins)	0
8568	<New Pvalue> Location Server	String	
8569	<New Pvalue> Location Server Username	String	
8570	<New Pvalue> Location Server Password	String	
8571	<New Pvalue> Secondary Location Server	String	
8572	<New Pvalue> Secondary Location Server Username	String	
8573	<New Pvalue> Secondary Location Server Password	String	
8574	<New Pvalue> HELD Location Types	String	Geodetic,civic,locationURI
8575	<New Pvalue> HELD Use LLDP Information	Value = 0; No Value = 1; Yes	0
8576	<New Pvalue> HELD NAI	Value = 0; No Value = 1; Yes	0
8577	<New Pvalue> HELD Identity 1	String	

8578	<New Pvalue> HELD Identity 1 Value	String	
8579	<New Pvalue> HELD Identity 2	String	
8580	<New Pvalue> HELD Identity 2 Value	String	
8581	<New Pvalue> HELD Identity 3	String	
8582	<New Pvalue> HELD Identity 3 Value	String	
8583	<New Pvalue> HELD Identity 4	String	
8584	<New Pvalue> HELD Identity 4 Value	String	
8585	<New Pvalue> HELD Identity 5	String	
8586	<New Pvalue> HELD Identity 5 Value	String	
8587	<New Pvalue> HELD Identity 6	String	
8588	<New Pvalue> HELD Identity 6 Value	String	
8589	<New Pvalue> HELD Identity 7	String	
8590	<New Pvalue> HELD Identity 7 Value	String	
8591	<New Pvalue> HELD Identity 8	String	
8592	<New Pvalue> HELD Identity 8 Value	String	

8593	<New Pvalue> HELD Identity 9	String	
8594	<New Pvalue> HELD Identity 9 Value	String	
8595	<New Pvalue> HELD Identity 10	String	
8596	<New Pvalue> HELD Identity 10 Value	String	
8597	<New Pvalue> E911 Emergency Numbers	String	911
8598	<New Pvalue> Geolocation-Routing Header	Value = 0; No Value = 1; Yes	0
8599	<New Pvalue> Priority Header	Value = 0; No Value = 1; Yes	0

ZOOM E911 X-SWITCH-INFO SIP HEADER

- Web Configuration**

This section can be found under device web UI → Accounts → Account X → SIP Settings:

Use Zoom E911 X-switch-info SIP Header  ☐

- Functionality**

This feature allows users to configure whether the "Zoom E911 X-switch-info SIP Header" is present in the SIP REGISTER message.

- Pvalues**

Pvalue	Description	Value Range	Default
60070	<New Pvalue> Use Zoom E911 X-switch-info SIP Header	Value = 0; No Value = 1; Yes	No

PAGING CALL MODE

- Web Configuration**

This section can be found under device web UI → Phone Settings → Call Settings:

Enable Paging Call Mode  ☒

- **Functionality**

This feature allows users to configure enable/disable paging call mode of the phone. If set to "Yes", the feature of paging call will be enabled.

- **Pvalues**

Pvalue	Description	Value Range	Default
22278	<New Pvalue> Enable Paging Call Mode	Value = 0; Yes Value = 1; No	Yes

FIRMWARE VERSION 1.0.3.59

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

05/24/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 35523d99c00de9bac4376455fafae5dd

ENHANCEMENT

- Improved Device web UI display strings
- Added Support to configure CA Signature Algorithm [CA SIGNATURE ALGORITHM]
- Added Display of "Device Individual Certificate" in web UI system info

BUG FIX

- Fixed Device duplicate external service call center save navigation bar
- Fixed Cancel softkey doesn't work correctly in attended transfer mode

NEW FEATURES OVERVIEW

CA SIGNATURE ALGORITHM

- Web Configuration**

This option can be found under device web UI → System Settings → Security Settings → Client Certificate:

CA Signature Algorithm ?

ecdsa-with-SHA384

- Functionality**

This feature allows users to configure CA signature algorithm. Please note this configuration must be consistent with the root certificate deployed on your server. Otherwise, the TLS communication may be failed.

- Pvalues**

Pvalue	Description	Value Range	Default
8603	<New Pvalue> CA Signature Algorithm	Value = 0; md5WithRSAEncryption Value = 1; ecdsa-with-SHA384	ecdsa-with-SHA384

FIRMWARE VERSION 1.0.3.57

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

04/25/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 91ceadc3dc6cd52954795fe07c9919eb

ENHANCEMENT

- Added Support to display the contacts when pressing the idle screen softkey “LDAP Search” before the search
- Added Support of Input Method for Contacts and LDAP [INPUT METHOD]
- Added Support of Remote Phonebook as a call screen softkey
- Added Support of GDS OpenDoor mode for MPK
- Added Support to set distinctive ringtone based on alert-info string syntax
- Improved Broadsoft call park indication by adding both display and sound notification
- Added Support to register to multiple servers

BUG FIX

- Fixed Device doesn't display number of instant messages
- Fixed Device codec OPUS issue
- Fixed Device doesn't identify the parked user on a monitored user
- Fixed Device LDAP display name issue if setting LDAP Mail Attributes only
- Fixed Device plays busy tone after ending a call via click-to-dial
- Fixed Device LCD does not display correct firmware version after manually uploading the firmware to upgrade
- Fixed Device still uses SRTP when receiving both RTP and SRTP in re-invite, but also with SRTP mode set to disabled
- Updated Device tooltip for Hidden Number Features
- Fixed After device factory reset, 3CX Management Console doesn't get correct IP address
- Fixed Device hold softkey issue when it fails to add members into a conference
- Fixed Device 802.1x client certificate doesn't be updated in real time
- Fixed 3CX uaCSTA issues after Device switches to TCP

NEW FEATURES OVERVIEW

INPUT METHOD

- Web Configuration**

This option can be found under device web UI → System Settings → Input Method:

Input Method for Contacts ?

123



Input Method for LDAP ?

123



- Functionality**

This feature allows users to set the input method for contacts and LDAP.

- Pvalues**

Pvalue	Description	Value Range	Default
22465	<New Pvalue> Input Method for Contacts	Value = 0; 123 Value = 1; abc Value = 2; ABC Value = 3; Ab2 Value = 4; Q9	123
22466	<New Pvalue> Input Method for LDAP	Value = 0; 123 Value = 1; abc Value = 2; ABC Value = 3; Ab2 Value = 4; Q9	123

FIRMWARE VERSION 1.0.3.51

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

03/23/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: e72f3b1532f9f19b84fb14e5a7c3e67c

ENHANCEMENT

- Added Support the LDAP filter used for email lookups [LDAP MAIL FILTER]
- Added Support of an alert tone when device is initiating a multicast paging
- Added Support to have both header and name/number displayed on LCD screen

BUG FIX

- Fixed Device delay establishing the call when Primary SIP Server is down
- Fixed Device doesn't trigger registration request once NET is up
- Fixed Device doesn't play ringback tone to remote party when establishing local 3-way conference call before answering
- Fixed Device randomly crash issue when dealing with SIP 183 scenarios
- Fixed Device prompt displays network error and does not register account o provision with 3CX
- Fixed Device randomly displays "Internal Error" and generates core dump
- Fixed Device cannot go back to idle screen after staying in diagnosis mode for more than one minute
- Fixed Device responses 200 with wrong port if UCM send notify twice
- Fixed When direct IP dialing is enabled, pressing # cannot redial in the keypad lock interface
- Fixed Device sends reply to wrong SIP port for SIP Notify from UCM

NEW FEATURES OVERVIEW

LDAP MAIL FILTER

- Web Configuration**

This option can be found under device web UI→Application→LDAP:

LDAP Mail Filter 

LDAP Mail Attributes [?](#)

- **Functionality**

LDAP Mail Filter configures the filter used for email lookups. Examples: `((mail=%)(mailBox=%))` returns all records which has the “mail” or “mailBox” field containing the entered filter value; `!(mail=%)` returns all the records which do not have the “mail” field containing the entered filter value; `(&(mail=%) (cn=*))` returns all the records with the “mail” field containing the entered filter value and “cn” field set.

LDAP Mail Attributes specifies the “mail” attributes of each record which are returned in the LDAP search result. This field allows users to configure multiple space separated email attributes.

- **Pvalues**

Pvalue	Description	Value Range	Default
8039	<New Pvalue> LDAP Mail Filter	String	NULL
8038	<New Pvalue> LDAP Mail Attributes	String	NULL

FIRMWARE VERSION 1.0.3.44

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

02/13/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 5caf53788581b4b19ff421fafc4ec513

ENHANCEMENT

- Added Support to adjust speaker ring volume [SPEAKER RING VOLUME]
- Added Support of an alert tone when a multicast paging is received

BUG FIX


- Fixed Device prompt is incorrect when the number of added contacts is full

NEW FEATURES OVERVIEW

SPEAKER RING VOLUME

- Web Configuration**

This option can be found under device web UI → System Settings → Preferences → Audio Control.



- Functionality**

Configures speaker ring volume. The valid range is 0 to 8.

- Pvalues**

Pvalue	Description	Value Range	Default
8352	<New Pvalue> Speaker Ring Volume	0 - 8	4

FIRMWARE VERSION 1.0.3.42

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

01/24/2022

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: e3e11ed39dce329cb997153de27f8927

ENHANCEMENT

- Added Input language support for Arabic, Catalan, Nederland's, Svenska, Slovakian
- Added Support of DNS & NAT Status display from Device's web UI
- Added Support to access the Wi-Fi network settings on the GRP2602W LCD when the device is in Constraint Mode [WI-FI SETTINGS SECURITY LEVEL]
- Added Ethernet, Wi-Fi and VPN pages in LCD menu network status
- Added Support to customize Device's VPK, MPK and hotkey function from LCD menu
- Added Support to configure UCM user SIP password [UCM USER PASSWORD]
- Improved Device DNS SRV Failover Design
- Added Support for Greek letters input with keypad
- Added Support to use Shared line feature only with primary SIP server, and to use Default mode with secondary SIP server when primary server is down
- Added Support to disable mute key in call feature [ENABLE MUTE KEY IN CALL]
- Added Support of SRTP key length "AEAD AES 256 GCM" crypto
- Added Support of special feature option "Zoom"
- Added Support of TCP Keep-alive for the TCP connection between the terminal and the SIP server [ENABLE TCP KEEP-ALIVE]
- Improved VPK/MPK BLF status
- Added Support "Yerevan" to GMT +04:00 Time zone
- Added Support to send extended DTMF [A,B,C,D] for transfer key
- Updated some of the VPK icons
- Added Support of more detailed network port information
- Improved Device prompt message when the input character of dialing rule exceeds the length limit
- Improved Presence Watcher icon status to distinguish different phone status
- Added Support of RTCP keep-alive method [RTCP KEEP-ALIVE METHOD]
- Added Support of RTP keep-alive method [RTP KEEP-ALIVE METHOD]

- Added Ability to customize keypad to lock when phone is idle or in call [CUSTOMIZED KEYPAD LOCK]

BUG FIX

- Fixed Device web configuration failed to save after enabling Test Password Strength option
- Fixed The incomplete display of "download XML file..." in the language Download Interface in Japanese
- Fixed Device LCD menu Setting page display issue in Traditional Chinese
- Fixed Device Web UI VPK/MPK display abnormal in Arabic
- Fixed Device CTI cannot get connected after swapping accounts
- Fixed Device LCD menu only displays one IPv6 address when it gets two IPv6 addresses
- Fixed Device cannot download language after the language path is configured
- Fixed Device OpenVPN certificate uploading issue
- Fixed Device Register Before DNS SRV Failover not working on receiving 503
- Fixed Device LCD LDAP search box display issue after searching a long value
- Fixed Device syslog SIP logs are truncated
- Fixed Device DHCP Option 150 cannot handle multiple Ips
- Fixed Device enables Shared line feature when received "line-size" allow-events from server even if the feature is disabled on the phone
- Fixed Device LCD language cannot be changed after continuous language switching from LCD menu
- Fixed Device Call Park / Monitored Call Park VPK does not display remote status
- Fixed Device BLF VPK display error when Hide BLF Remote Status is enabled
- Fixed Device cannot make a call when line-seize failed in SCA mode
- Fixed Device works abnormal after inputting Greek character Ω several times
- Fixed Click to dial contact ignores some special character
- Fixed Device call forward to default value on UCM platform is not synchronized
- Fixed Device outbound notification XMPP didn't work
- Fixed Device does not reconnect TCP when device keep-alive fails
- Fixed Device DHCP DNS resolution logic does not work correctly when Option 15 is enabled
- Fixed Device doesn't connect the 802.1X SSID issue
- Fixed Device GMT-03:00 (Brazil, Sao Paulo) time zone issue

NEW FEATURES OVERVIEW

WI-FI SETTINGS SECURITY LEVEL

- **Web Configuration**

This option can be found under device web UI → System Settings → Security Settings.

Wi-Fi Settings Security Level ?

Default

- **Functionality**

Configure the password inquiry for Wi-Fi settings. If set to "Default", Password is needed when configuration via keypad menu is not Unrestricted. If set to "Always Require Password", Password is needed no matter what configuration via keypad menu mode is. If set to "No password Required", No password is needed no matter what configuration via keypad menu mode is.

- **Pvalues**

Pvalue	Description	Value Range	Default
22460	<New Pvalue> Wi-Fi Settings Security Level	Value = 0; Default Value = 1; Always Require Password Value = 2; No Password Required	Default

UCM USER PASSWORD

- **Web Configuration**

This option can be found under device web UI → Accounts → Account X → General Settings.

UCM User Password ?

- **Functionality**

Configure UCM user login password to connect UCM user settings

- **Pvalues**

Pvalue	Description	Value Range	Default
60061,60161,60261,60361,60461,60561	<New Pvalue> UCM User Password	String	NULL

ENABLE MUTE KEY IN CALL

- **Web Configuration**

This option can be found under device web UI → Phone Settings → Call Settings.

Enable Mute Key In Call ?



- **Functionality**

When set to "No", the mute key will not work while on call.

- **Pvalues**

Pvalue	Description	Value Range	Default
22441	<New Pvalue> Enable Mute Key In Call	Value = 0; Yes Value = 1; No	Yes

ENABLE TCP KEEP-ALIVE

- **Web Configuration**

This option can be found under device web UI → Accounts → Account X → SIP Settings.

- **Functionality**

Configures whether to enable TCP Keep-alive for the TCP connection between the terminal and the SIP server.

- **Pvalues**

Pvalue	Description	Value Range	Default
60065,60165,60265,60365,60465,60565	<New Pvalue> Enable TCP Keep-alive	Value = 0; No Value = 1; Yes	Yes

RTCP KEEP-ALIVE METHOD

- **Web Configuration**

This option can be found under device web UI → Account x → Codec Settings.

RTCP Keep-Alive method ?

Sender Report

- **Functionality**

Configures the RTCP channel keep-alive packet type. If set to "Receiver Report", the RTCP channel will send "receiver report+source description+RTCP extension" as keep-alive data. If set to "Sender report", the RTCP channel will send "Sender report+source description+ RTCP extension" as keep-alive data.

- **Pvalues**

Pvalue	Description	Value Range	Default
60066,60166,60266,60366,60466,60566	<New Pvalue> RTCP Keep-Alive method	Value = 1; Receiver Report Value = 2; Sender Report	Receiver Report

RTP KEEP-ALIVE METHOD

- **Web Configuration**

This option can be found under device web UI → Account x → Codec Settings.

RTP Keep-Alive method ?

RTP Version 1

- **Functionality**

Configures the RTP channel keep-alive packet type. If set to "No", no data will be sent. If set to "RTP version 1", the wrong version info for "1" will be carried when sending RTP data packets.

- **Pvalues**

Pvalue	Description	Value Range	Default
60067,60167,60267, 60367,60467,60567	<New Pvalue> RTP Keep-Alive method	Value = 1; RTP Version 1 Value = 0; No	RTP Version 1

CUSTOMIZED KEYPAD LOCK

- Web Configuration**

This option can be found under device web UI → System Settings → Security Settings → Keypad Lock.

Keypad Lock Type  Customized 

Keys to Lock when idle 

☐ 8 items Available

☐ Hookswitch
☐ Number Keys
☐ Star Key
☐ Pound Key
☐ Volume Keys
☐ Speaker Key
☐ Headset Key

☐ 6 items Selected

☐ Soft Keys
☐ Navigation Keys
☐ Voicemail Key
☐ Mute Key
☐ Transfer Key
☐ Send Key

Keys to Lock when in call 

☐ 9 items Available

☐ Hookswitch
☐ Number Keys
☐ Star Key
☐ Pound Key
☐ Volume Keys
☐ Speaker Key
☐ Send Key

☐ 5 items Selected

☐ Soft Keys
☐ Navigation Keys
☐ Voicemail Key
☐ Mute Key
☐ Transfer Key

- Functionality**

When “Keypad Lock Type” is set to “Customized”, the keys will be locked based on the user configuration.

- Pvalues**

Pvalue	Description	Value Range	Default
--------	-------------	-------------	---------

22462	<New Pvalue> Keys to Lock when idle	SoftKeys,NavigationKeys,VoiceMailKey,MuteKey,TransferKey,SendKey,Hookswitch,NumberKeys,StarKey,PoundKey,VolumeKeys,SpeakerKey,HeadsetKey,LineKeys	SoftKeys,NavigationKeys,VoiceMailKey,MuteKey,TransferKey,SendKey
22463	<New Pvalue> Keys to Lock when in call	SoftKeys,NavigationKeys,VoiceMailKey,MuteKey,TransferKey,Hookswitch,NumberKeys,StarKey,PoundKey,VolumeKeys,SpeakerKey,SendKey,HeadsetKey,LineKeys	SoftKeys,NavigationKeys,VoiceMailKey,MuteKey,TransferKey

FIRMWARE VERSION 1.0.3.31

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

12/7/2021

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 955a11bdb61fa496b52ea1b482d14551

ENHANCEMENT

- Added Support of MPK configuration preview
- Added Ability to configure programmable keys via LCD [ALLOW PROGRAMMABLE KEY CONFIGURATION VIA LCD]
- Updated Web UI and LCD display in Chinese language
- Added Support of multiple screens for custom idle screen XML file
- Updated XML idle screen sample file
- Updated Web UI display in Arabic
- Added Remote Phonebook support in softkey configuration
- Updated Device LCD warning message behavior for Account not registering
- Updated Device behavior that when only 1 account is configured, on-hook VM button does not ask to select account
- Added Alias support for certain Pvalues
- Added Support for WPA3 Wi-Fi security
- Added Support of Rport (RFC 3581) [SUPPORT RPORT (RFC3581)]
- Added Ability to enable DND from web UI [ENABLE DND FROM WEB UI]
- Added Support of Genband server compatibility for BLF
- Added Support of Selection "All For Selection" for Option "Transfer Mode via Programmable Keys"
- Added Ability to remove password requirement during factory reset [FACTORY RESET SECURITY LEVEL]
- Added key combination (Softkey1+Down) and call feature code (**02030203**) to do factory reset
- Added "X-Xss-Protection" header in HTTP response
- Added "X-Content-Type-Options" header in HTTP response
- Added HSTS(Strict-Transport-Security) header in HTTP response
- Added CSP(Content-Security-Policy) header and X-Frame-Options header in HTTP response

BUG FIX

- Fixed Device crashes after logging into public mode and filling in the secondary SIP server
- Fixed Device LCD time does not take effect after modifying date/time display format on the web UI
- Fixed Device does not call out if pressing send key in dialing page while keypad is locked
- Fixed Device phonebook downloading issue
- Fixed Device failed to redial after dialing IPv6 IP call
- Fixed Device phonebook blacklist is not synchronized in public mode
- Fixed Device transferring via BLF MPK failed
- Fixed Device Web UI display issue when switching between Arabic and Hebrew
- Fixed Device erased custom screen saver automatically after disabling Idle Screen XML Download
- Fixed Device cannot enter voicemail when there's no voice message
- Fixed Device LCD does not prompt warning when screensaver downloading failed
- Fixed Device lost conference softkey in dial page when enabling hold call before adding conference
- Fixed the default value of Minimum TLS Version issue
- Fixed the time of custom Idle Screen XML is not updated when there is a prompt on LCD
- Fixed Device LCD prompt message overlapping display issue
- Fixed Call History for Remote Phonebook does not show name but only number
- Fixed Device sent SRV request constantly even when the server responded successfully
- Fixed Device Broadsoft XSI voicemail menu is not showing correctly when use login credential
- Fixed Device LCD still displayed contact entries after clearing remote phonebook URL
- Fixed GRP2602W Wi-Fi signal strength is none after connecting hidden ssid
- Fixed the title bar of some Broadsoft pages does not display completely
- Fixed Device Network-based conference works abnormally
- Fixed Device LCD display of the Executive Assistant is incomplete
- Fixed Device does not display Remote-Party-ID after dialing pickup call feature code *8
- Fixed Device does not download remote XML phonebook upon boot
- Fixed Device crashes after being transferred in certain situation
- Fixed Device crashes after conference being built
- Fixed Device Callee ID display does not get updated after performing call pickup
- Fixed Device VPK icon display wrong when changing from Shared to Default mode
- Fixed Device crashes after performing multicast
- Fixed Device multicast sender auto-answers multicast paging call when it has lower priority
- Fixed Device prompt display when saving call filtering or divert option from LCD menu
- Fixed Device LCD scroll bar of Allow Programmable Key Configuration via LCD display is not friendly
- Fixed Device prompt display error when provision to upgrade to the same version
- Fixed Device Callee ID display not updated after performing call pickup
- Fixed Device doesn't explicitly indicate that the admin password should be entered to factory reset
- Fixed Device LCD brightness displayed wrong in active LCD timeout page
- Fixed Device always displays password input box even when device is connected to Wi-Fi
- Fixed Device lock icon is not displayed in the RTP conference room

NEW FEATURES OVERVIEW

ALLOW PROGRAMMABLE KEY CONFIGURATION VIA LCD

- Web Configuration**

This option can be found under device web UI→Programmable Keys→Advanced Settings.

Allow Programmable Key Configuration via LCD  

- Functionality**

Configure to enable Programmable Key configuration via LCD by pressing and holding MPKs/VPKs..

- Pvalues**

Pvalue	Description	Value Range	Default
8444	<New Pvalue> Allow Programmable Key Configuration via LCD	Value = 0; No Value = 1; Yes	Yes

SUPPORT RPORT (RFC3581)

- Web Configuration**

This option can be found under device web UI→Accounts→Account X→General Settings.

Support Rport (RFC 3581)  

- Functionality**

Configures to use symmetric response routing. If it is used, the "rport" field will be added to the Via header field in the SIP Request, and the information will be extracted from the SIP 200OK Response for SIP Register to rewrite the SIP Contact information and apply it in subsequent SIP Requests.

- Pvalues**

Pvalue	Description	Value Range	Default
131	<New Pvalue> Support Rport (RFC 3581)	Value = 0; No Value = 1; Yes	Yes

ENABLE DND FROM WEB UI

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable DND Feature 



- **Functionality**

This button allows user to enable DND from the web interface.

FACTORY RESET SECURITY LEVEL

- **Web Configuration**

This option can be found under device web UI→System Settings→Security Settings→Web/SSH/Access.

Factory Reset Security Level 

Default

- **Functionality**

Configure the password inquiry for factory reset. If set to "Default", Password is needed when configuration via keypad menu is not Unrestricted. If set to "Always Require Password", Password is needed no matter what configuration via keypad menu mode is. If set to "No Password Required", No password is needed no matter what configuration via keypad menu mode is.

- **Pvalues**

Pvalue	Description	Value Range	Default
22373	<New Pvalue> Factory Reset Security Level	Value = 0; Default Value = 1; Always Require Password Value = 2; No Password Required	Default

FIRMWARE VERSION 1.0.3.18

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

9/22/2021

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 39c7ae719ede64f0ec02072801a391ea

ENHANCEMENT

- Added Multi-language support for language downloading UI
- Updated LCD and Web English strings
- Updated Time Zone list
- Added Support of different accounts registering separately under IPv4/IPv6 network environment
- Improved Device performance when encountering unstable network environment
- Added UCM Call Features and UCM Call Center Softkeys
- Added Support of displaying Call Feature Status from Web UI
- Updated tooltips for some options
- Updated Korean strings in Reboot prompt
- Added Support of XML Application [XML APPLICATION]
- Added an XML file example for customer
- Added Support of Last Call Forward Always feature [LAST CALL FORWARD ALWAYS]
- Added Support of Show SIP Error Response feature [SHOW SIP ERROR RESPONSE]
- Added Support of Enable Hook Switch feature [ENABLE HOOK SWITCH]
- Added Support of Contact Source Priority feature [CONTACT SOURCE PRIORIY]
- Added Support of Direct IP Call [ENABLE DIRECT IP CALL]
- Added Support of Use Quick IP Call Mode [USE QUICK IP CALL MODE]
- Added Support of Predictive Dialing Feature [PREDICTIVE DIALING FEATURE]
- Added Support of Predictive Dialing Source [PREDICTIVE DIALING SOURCE]
- Added Support of Onhook Dial Barging feature [ONHOOK DIAL BARGING]
- Added Support of Auto Redial feature [AUTO REDIAL]
- Added Support of Call Completion Service [CALL COMPLETION SERVICE]
- Added Support of Incoming Call Popup feature [INCOMING CALL POPUP]
- Added Support of Missed Call Notification feature [MISSED CALL NOTIFICATION]
- Added Support of Call Waiting Tone [CALL WAITING TONE]

- Added Support of In-call DTMF Display [IN-CALL DTMF DISPLAY]
- Added Support of Show on Hold Duration feature [SHOW ON HOLD DURATION]
- Added Support of Auto Unmute feature [AUTO UNMUTE]
- Added Support of Busy Tone on Remote Disconnect feature [BUSY TONE ON REMOTE DISCONNECT]
- Added Support of enable or disable transfer function [ENABLE TRANSFER]
- Added Support of Attended Transfer Mode [ATTENDED TRANSFER MODE]
- Added Support of Override DND feature [OVERRIDE DND]
- Added Support of enable or disable conference function [ENABLE CONFERENCE]
- Added Support of Hold Call Before Adding Conferee feature [HOLD CALL BEFORE ADDING CONFEREE]
- Added Support of Hidden Number Plan [HIDDEN NUMBER PLAN]
- Added Support of Warning tone [WARNING TONE]
- Added Support of Group listening with handset/speaker [GROUP LISTEN]
- Added Support of multiple retries for the device to send requests to server [MAX NUMBER OF SIP REQUEST RETRIES]
- Added Support of Failback Expiration time [FAILBACK EXPIRATION]

BUG FIX

- Fixed Broadsoft XSI login issue via HTTP or HTTPS
- Fixed Web page issue after factory reset
- Fixed GUI crashed after editing local group
- Fixed GUI crashed after disabling Wi-Fi in scanning status
- Fixed Device has no audio when using with headset Plantronics SP11
- Fixed Device does not use OpenVPN IP after changing NAT mode to VPN
- Fixed Device handles MWI Notify from both primary and secondary server
- Fixed Device cannot detect NAT type correctly without rebooting
- Fixed DND feature does not work correctly after failover
- Fixed 3CX CSTA receives multiple call abnormally
- Fixed Device cannot use Sennheiser EHS to end a call
- Fixed Headset cannot turn on after switching between speaker and headset mode
- Fixed Dialing screen sometimes doesn't close after pressing headset key on headset
- Fixed Settings Page is displayed in English when System Language is Traditional Chinese
- Fixed Device BLF call-pickup does not work correctly

NEW FEATURES OVERVIEW

XML APPLICATION

- **Web Configuration**

The settings for XML Application can be found under device web UI→Application→XML Application.

Idle Screen XML Download [?](#) Disabled ▼

Download Screen XML at Boot-up [?](#) ☐

Use Custom Filename [?](#) ☐

Idle Screen XML Server Path [?](#)

XML File Example [?](#) [Download](#)

- **Functionality**

Configures to set up XML applications.

- **Pvalues**

Pvalue	Description	Value Range	Default
340	<New Pvalue> Idle Screen XML Download	Value = 0; Disable Value = 1; Enabled, use HTTP Value = 2; Enabled, use TFTP Value = 3; Enabled, use HTTPS	Disable
1349	<New Pvalue> Download Screen XML at Boot-up	Value = 0; Disable Value = 1; Enable	Disable
1343	<New Pvalue> Use Custom Filename	Value = 0; Disable Value = 1; Enable	Disable
341	<New Pvalue> Idle Screen XML Server Path	String: Max length is 256.	NULL

LAST CALL FORWARD ALWAYS

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Last Call Forward Always [?](#) ☐

- **Functionality**

If enabled, the number inputted into the ForwardAll feature will be stored the next time you use the ForwardAll softkey.

Note: ForwardAll softkey currently only used for account 1.

- **Pvalues**

Pvalue	Description	Value Range	Default
--------	-------------	-------------	---------

32063	<New Pvalue> Last Call Forward Always	Value = 0; Disable Value = 1; Enable	Disable
-------	--	---	---------

SHOW SIP ERROR RESPONSE

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Show SIP Error Response  

- Functionality**

Configures to enable SIP error response information displayed on LCD screen.

- Pvalues**

Pvalue	Description	Value Range	Default
8376	<New Pvalue> Show SIP Error Response	Value = 0; Disable Value = 1; Enable	Enable

ENABLE HOOK SWITCH

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Hook Switch 

- Functionality**

When set to "No", disable hook switch completely; When set to "Yes, except answering call", hook switch cannot be used for answering call.

- Pvalues**

Pvalue	Description	Value Range	Default
6763	<New Pvalue> Enable Hook Switch	Value = 0; Yes Value = 1; No Value = 1; Yes, except answering call	Yes

CONTACT SOURCE PRIORIY

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Contact Source Priority ?

Local
 Remote
 BroadSoft Xsi
 LDAP
 Network Signaling

- Functionality**

Configure the priority of the ID source displayed on the phone when incoming/outgoing calls. Select one ID source and click the Up/Down arrow on the right to adjust the order.

Note: If the "Caller ID Display" under the account is configured as "Disabled", the caller number cannot be obtained, the phone will only display "Unavaliabe".

- Pvalues**

Pvalue	Description	Value Range	Default
22439	<New Pvalue> Contact Source Priority	Local, Remote, BSXSI, LDAPPhonebook, NETWorkSignaling	Local,Remote,BSXSI,LDAP Phonebook,NETWorkSigna ling

ENABLE DIRECT IP CALL

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Direct IP Call ? ☒

- Functionality**

Configure to enable direct IP call feature.

- Pvalues**

Pvalue	Description	Value Range	Default
1310	<New Pvalue> Enable Direct IP Call	Value = 0; Yes Value = 1; No	Yes

USE QUICK IP CALL MODE

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Use Quick IP Call Mode  ☐

- **Functionality**

When set to "Yes", users can dial an IP address under the same LAN/VPN segment by entering the last octet of the IP address.

- **Pvalues**

Pvalue	Description	Value Range	Default
184	<New Pvalue> Use Quick IP Call Mode	Value = 0; No Value = 1; Yes	No

PREDICTIVE DIALING FEATURE

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Predictive Dialing Feature  ☒

- **Functionality**

Configures the predictive dialing feature on the call screen.

- **Pvalues**

Pvalue	Description	Value Range	Default
22126	<New Pvalue> Predictive Dialing Feature	Value = 0; No Value = 1; Yes	Yes

PREDICTIVE DIALING SOURCE

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Predictive Dialing Source 

☐ 0 item
 Available

☐ 8 items
 Selected

☐ Local Phonebook
☐ Call History
☐ BroadSoft Direct...
☐ BroadSoft Call Log
☐ LDAP

- **Functionality**

Predictive dialing feature will sequentially search the number based on the selected sources.

- **Pvalues**

Pvalue	Description	Value Range	Default
8442	<New Pvalue> Predictive Dialing Source	LocalPhonebook, CallHistory, BSPhonebook, BSCallHistory, LDAPPhonebook, PersonalPhonebook, RemotePhonebook, FeatureCode	LocalPhonebook, CallHistory, BSPhonebook, BSCallHistory, LDAPPhonebook, PersonalPhonebook, RemotePhonebook, FeatureCode

ONHOOK DIAL BARGING

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Onhook Dial Barging  ☒

- **Functionality**

When the option is set to "Disabled", onhook dialing won't be interrupted by an incoming call.

- **Pvalues**

Pvalue	Description	Value Range	Default
8397	<New Pvalue> Onhook Dial Barging	Value = 0; No Value = 1; Yes	Yes

AUTO REDIAL

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Auto Redial  ☐

Auto Redial Times 

Auto Redial Interval 

- **Functionality**

Configures to redial automatically at a later time when the dialed number is currently busy.

- **Pvalues**

Pvalue	Description	Value Range	Default
8353	<New Pvalue> Enable Auto Redial	Value = 0; No Value = 1; Yes	No

8354	<New Pvalue> Auto Redial Times	Number: 1 - 200	10
8355	<New Pvalue> Auto Redial Interval	Number: 1 - 360	10

CALL COMPLETION SERVICE

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Call Completion Service  ☐

- Functionality**

If enabled, phone will automatically redial the previous failed call when the remote party becomes available.

- Pvalues**

Pvalue	Description	Value Range	Default
8391	<New Pvalue> Enable Call Completion Service	Value = 0; No Value = 1; Yes	No

INCOMING CALL POPUP

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Incoming Call Popup  ☒

- Functionality**

If enabled, phone will pop up an incoming call window to notify users when there is an incoming call.

- Pvalues**

Pvalue	Description	Value Range	Default
8401	<New Pvalue> Enable Incoming Call Popup	Value = 0; No Value = 1; Yes	Yes

MISSED CALL NOTIFICATION

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Missed Call Notification  ☒

- Functionality**

If enabled, phone will pop up a window to remind users of a missed call.

- Pvalues**

Pvalue	Description	Value Range	Default
8393	<New Pvalue> Enable Missed Call Notification	Value = 0; No Value = 1; Yes	Yes

CALL WAITING TONE

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Call Waiting Tone ? ☒

- Functionality**

If enabled, phone will play call waiting alert tone when there is an incoming call while a call is in progress.

- Pvalues**

Pvalue	Description	Value Range	Default
186	<New Pvalue> Enable Call Waiting Tone	Value = 0; Yes Value = 1; No	Yes

IN-CALL DTMF DISPLAY

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable In-call DTMF Display ? ☒

- Functionality**

When set to "No", the DTMF digits entered during a call will not be displayed on LCD.

- Pvalues**

Pvalue	Description	Value Range	Default
338	<New Pvalue> Enable In-call DTMF Display	Value = 0; Yes Value = 1; No	Yes

SHOW ON HOLD DURATION

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Show on Hold Duration ? ☒

- Functionality**

If enabled, phone will show the duration of holding a call on the LCD.

- **Pvalues**

Pvalue	Description	Value Range	Default
8503	<New Pvalue> Show on Hold Duration	Value = 0; No Value = 1; Yes	Yes

AUTO UNMUTE

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Auto Unmute  ☒

- **Functionality**

If enabled, phone will be automatically unmuted when user resumes a call or establishes a new call.

- **Pvalues**

Pvalue	Description	Value Range	Default
8488	<New Pvalue> Enable Auto Unmute	Value = 0; No Value = 1; Yes	Yes

BUSY TONE ON REMOTE DISCONNECT

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Busy Tone on Remote Disconnect  ☐

- **Functionality**

If enabled, phone will play busy tone when call is disconnected remotely.

- **Pvalues**

Pvalue	Description	Value Range	Default
6762	<New Pvalue> Enable Busy Tone on Remote Disconnect	Value = 0; No Value = 1; Yes	Yes

ENABLE TRANSFER

- **Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Transfer  ☒

- **Functionality**

This option is to configure to enable call transfer feature.

- **Pvalues**

Pvalue	Description	Value Range	Default
1341	<New Pvalue> Enable Transfer	Value = 0; No Value = 1; Yes	Yes

ATTENDED TRANSFER MODE

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Attended Transfer Mode  Dynamic 

- Functionality**

If set to "Static", attended transfer can only be performed with established calls. If set to "Dynamic", attended transfers can be performed with established calls or be initiated during the transfer process. This option does not affect the user's ability to perform blind transfers.

- Pvalues**

Pvalue	Description	Value Range	Default
1376	<New Pvalue> Enable Transfer	Value = 0; Static Value = 1; Dynamic	Dynamic

OVERRIDE DND

- Web Configuration**

The options can be found under device web UI→Phone Settings→Call Settings.

Override DND  Off 

Override DND Numbers  

- Functionality**

Configures to override the local DND function.

If set to "Off", the local DND function is normal; if set to "Allow All", the local DND function is invalid; if set to "Allow Only Contacts", when the local DND function is enabled, only local contacts and the configured override numbers can call in ; If set to "Allow Override Numbers", when the local DND is turned on, only the configured coverage numbers can call in. The default setting is "Off".

- Pvalues**

Pvalue	Description	Value Range	Default
8372	<New Pvalue> Override DND	Value = 0; Off Value = 1; Allow All Value = 2; Allow Only Contacts Value = 4; Allow Override Numbers	OFF

22450	<New Pvalue> Override DND Numbers	Number	NULL

ENABLE CONFERENCE

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Enable Conference  ☒

- Functionality**

This option is to configure to enable call transfer feature.

- Pvalues**

Pvalue	Description	Value Range	Default
1311	<New Pvalue> Enable Conference	Value = 0; Yes Value = 1; No	Yes

HOLD CALL BEFORE ADDING CONFeree

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings.

Hold Call before Adding Conferee  ☐

- Functionality**

This option is to configure whether to put the current call on hold while adding new members to a conference. If set to "Yes", the current call will be put on hold when the host presses conference or add key to invite new members. When the invited member answers the call and agrees to attend the conference, the host needs to manually resume the conference with the new member added. If set to "No", the current call will not be put on hold and the invited member will join the meeting automatically after answering the call.

- Pvalues**

Pvalue	Description	Value Range	Default
22346	<New Pvalue> Hold Call before Adding Conferee	Value = 0; No Value = 1; Yes	No

AUTHENTICATED NTP

- Web Configuration**

This option can be found under device web UI→System Settings→Time and Language.

Enable Authenticated NTP  ☐

- Functionality**

Configures whether to enable NTP authentication. If enabled, a cryptographic signature appended to each network packet. If the key is incorrectly configured, the phone will refuse to use the time provided by the NTP server.

- **Pvalues**

Pvalue	Description	Value Range	Default
22309	<New Pvalue> Enable Authenticated NTP	Value = 0; No Value = 1; Yes	No

HIDDEN NUMBER PLAN

- **Web Configuration**

This option can be found under device web UI→Accounts→Account x→Hidden Number Plan.

Hidden Number Features ⓘ

Disabled

Hidden Number Plan List ⓘ

x+(xxxx)xxxx

xx(xx+)xx

x(xx+)x

x(x+)

(x+)

Hidden Number Plan Test ⓘ

Number
 >>
 Test result

- **Functionality**

Currently, incoming and outgoing number display will be handled according to hidden number plan.

Users are able to configure the hidden number rules, matching their syntax rules from top to bottom as follows:

1. Expression

element(element)element

(element)element

element(element)

(element)

2. Element Rules

- x: any digit number from 0-9

- +: any length after x(>=1)

- \[-+...] or *: Escape symbol

- (): The part that needs to be hidden, there can only be one hidden part in a rule

3.Examples

x+(xxxx)xxxx: 13705806547 -> 137****6547

xxx(x+)xxxx: 07113705806547 -> 071*****6547

071\-x+(xxxx)xxxx: 071-13705806547 -> 071-137****6547

- Pvalues**

Pvalue	Description	Value Range	Default
26043	<New Pvalue> Hidden Number Features	Value = 0; Disabled Value = 1; Incoming Calls Only Value = 2; Outgoing Calls Only Value = 3; Both Direction Calls	Disabled
60058	<New Pvalue> Hidden Number Plan List	String	{ x+(xxxx)xxxx xx(xx+)xx x(xx+)x x(x+) (x+) }

WARNING TONE

- Web Configuration**

This option can be found under device web UI→System Settings→Preferences→Audio Control.

Enable Warning Tone  ☒

- Functionality**

Configures whether to enable the warning tone of the phone. If disabled, all pop-up and notifications will play no tone.

- Pvalues**

Pvalue	Description	Value Range	Default
22444	<New Pvalue> Enable Warning Tone	Value = 0; No Value = 1; Yes	Yes

GROUP LISTEN

- Web Configuration**

This option can be found under device web UI→System Settings→Preferences→Audio Control.

Group Listen with handset  ☐

Group Listen with Speaker  ☐

- Functionality**

Group Listen with handset: Allow handset to be able to listen when picked up during a call with headset.

Group Listen with Speaker: In a call, phone will display softkey to enable speaker listening when audio mode is set to handset or headset.

- Pvalues**

Pvalue	Description	Value Range	Default
--------	-------------	-------------	---------

22100	<New Pvalue> Group Listen with Handset	Value = 0; No Value = 1; Yes	No
22163	<New Pvalue> Group Listen with Speaker	Value = 0; No Value = 1; Yes	No

MAX NUMBER OF SIP REQUEST RETRIES

- Web Configuration**

This option can be found under device web UI→Accounts→Account x→General Settings.

Maximum Number of SIP Request Retries ?

- Functionality**

Sets the maximum number of retries for the device to send requests to the server. In DNS SRV configuration, if the destination address does not respond, all request messages are resent to the same address according to the configured retry times. Valid range: 1-10.

- Pvalues**

Pvalue	Description	Value Range	Default
60055	<New Pvalue> Maximum Number of SIP Request Retries	Number: 1 - 10	4

FAILBACK EXPIRATION

- Web Configuration**

This option can be found under device web UI→Accounts→Account x→General Settings.

Failback Expiration (m) ?

- Functionality**

Specifies the duration (in minutes) since failover to the current SIP server or Outbound Proxy before making failback attempts to the primary SIP server or Outbound Proxy.

- Pvalues**

Pvalue	Description	Value Range	Default
60056	<New Pvalue> Failback Expiration (m)	Number	60

FIRMWARE VERSION 1.0.1.57

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

7/21/2021

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 7b951c6b0f5f2ddfa3d18889f7805c0a

ENHANCEMENT

- Updated Some options' tooltips in web UI
- Updated Web UI language display
- Added Support of Recommend Time Zone display in Web UI to represent the time zone detected by IP address
- Added System time zone display in web UI [SYSTEM TIME ZONE]

BUG FIX

- Fixed GUI crashed after set broadsoft agent status to unavailable or wrap-up
- Fixed Device cannot end a call correctly by pressing the button on some EHS headsets
- Fixed Device-connected EHS headset won't turn on after switching between speakers and headset
- Fixed Device-connected EHS headset plays popping sound after ending call using Answer/End Call headset key
- Fixed Dialing screen sometimes doesn't close after pressing headset key on some EHS headset
- Fixed Device can't upgrade to target version successfully sometimes
- Fixed Device works abnormally when receiving multiple 3CX CSTA calls
- Fixed Device LCD menu IP Geographic information display issue
- Fixed Device LCD IPv6 address display issue

NEW FEATURES OVERVIEW

SYSTEM TIME ZONE

- **Web Configuration**

System Time Zone can be found under device web UI→Status→System Info.

| IP Geographic Information

Language	English
Recommend Time Zone	GMT-08:00 (US Pacific Time, Los Angeles)

| System Time

System Up Time	2: 3
System Time	07/21/21 16:58:44
System Time Zone	GMT+08:00 (Beijing, Taipei, Kuala Lumpur, Irkutsk)

- **Functionality**

System Time Zone displays the time zone that is configured by user;

Recommend Time Zone displays the time zone that is detected by IP address.

FIRMWARE VERSION 1.0.1.52

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

6/24/2021

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: 342989995087979d01b7d391b5a9a04b

ENHANCEMENT

- Improved Hebrew language display
- Improved Chinese language display
- Improved Korean language display
- Improved Web UI language display
- Added ability to Use Route Set in NOTIFY [USE ROUTE SET IN NOTIFY]
- Added support for Auto Answer Numbers [AUTO ANSWER NUMBERS]
- Added ability to finish an attended transfer by on-hooking the phone
- Added support for configuring the number to be dialed as DTMF using the TRANSFER button [IN-CALL DIAL NUMBER ON PRESSING TRANSFER KEY]
- Added Multicast Paging related MPKs on GRP2604/P [MULTICAST PAGING MPKs]
- Added ability to configure VPKs [VPK]
- Added ability to use up to 3 XML Phonebook URLs [3 XML PHONEBOOK URLS]
- Updated Wi-Fi firmware for FragAttacks Wi-Fi Vulnerability for GRP2602W
- Added ability to return to idle screen after you press the activated Line key
- Added BLF-related options from GRP2604 to GRP2601/02/03
- Removed “Enable SCA” setting under Account Advanced Settings since you can now enable SCA by configuring Shared VPK

BUG FIX

- Fixed an issue where changing the LLDP TX interval wouldn't update until after a reboot
- Fixed an issue where the MPK lights for Auto Provision Eventlist BLF keys would stay lit up even after deleting the Eventlist BLF URI on the Web UI
- Fixed a crashing issue when enabling “Check Domain Certificates”
- Fixed an issue where DHCP Option 2 wasn't taking effect

- Fixed an issue where audio would come through both the speakers and handset/headset when enabling the “Ring for Call Waiting” setting and receiving a call waiting notification
- Fixed issue where “Doorbell” ringtone wasn’t working when using the “Match Incoming Caller ID” feature
- Fixed an issue where Multicast Paging Listening wouldn’t always work in certain network environments
- Update voice monitor message for GDMS
- Fixed Device adding auto answer number issue
- Fixed Device cannot dial star key when there is a message on the screen
- Fixed Device switches to new IP address after renewing IP address
- Fixed Device attended transfer call issue via CSTA with 3CX
- Fixed Config template v2 provisioning issue via HTTP
- Fixed Device cannot resolve DNS query
- Fixed Device BLF Call-pickup issue
- Fixed Incorrect packet loss rate

NEW FEATURES OVERVIEW

USE ROUTE SET IN NOTIFY

- **Web Configuration**

This option can be found under device web UI→Account_x→SIP Settings→Basic Settings

Use Route Set In NOTIFY (Follow RFC 6665) ?



- **Functionality**

Configures whether to use route set in NOTIFY (follow RFC 6665).

- If enabled, the Request URI of the refresh subscription will use the URI in the received NOTIFY Contact (RFC 6665).
- If disabled, the URI in the previously subscribed 200 OK Contact will be used.

- **Pvalues**

Pvalue	Description	Value Range	Default
60059	<New Pvalue> Use Route Set in NOTIFY(Follow RFC 6665) – Account 1	Value = 0; Disable Value = 1; Enable	Enable
60159	<New Pvalue> Use Route Set in NOTIFY(Follow RFC 6665) – Account 2	Value = 0; Disable Value = 1; Enable	Enable
60259	<New Pvalue> Use Route Set in NOTIFY(Follow RFC 6665) – Account 3	Value = 0; Disable Value = 1; Enable	Enable

60359	<New Pvalue> Use Route Set in NOTIFY(Follow RFC 6665) – Account 4	Value = 0; Disable Value = 1; Enable	Enable
60459	<New Pvalue> Use Route Set in NOTIFY(Follow RFC 6665) – Account 5	Value = 0; Disable Value = 1; Enable	Enable
60559	<New Pvalue> Use Route Set in NOTIFY(Follow RFC 6665) – Account 6	Value = 0; Disable Value = 1; Enable	Enable

AUTO ANSWER NUMBERS

- Web Configuration**

This option can be found under device web UI→Account_x→Call Settings→Call Features

Auto Answer Numbers  

- Functionality**

Allows the user to configure specific numbers to auto answer. If not set, all numbers will be auto answered if auto answer is enabled. Up to 10 numbers can be configured.

- Pvalues**

Pvalue	Description	Value Range	Default
29064	<New Pvalue> Auto Answer Numbers – Account 1	Up to 10 numbers	NULL
29164	<New Pvalue> Auto Answer Numbers – Account 2	Up to 10 numbers	NULL
29264	<New Pvalue> Auto Answer Numbers – Account 3	Up to 10 numbers	NULL
29364	<New Pvalue> Auto Answer Numbers – Account 4	Up to 10 numbers	NULL
29464	<New Pvalue> Auto Answer Numbers – Account 5	Up to 10 numbers	NULL
29564	<New Pvalue> Auto Answer Numbers – Account 6	Up to 10 numbers	NULL

IN-CALL DIAL NUMBER ON PRESSING TRANSFER KEY

- Web Configuration**

This option can be found under device web UI→Phone Settings→Call Settings

In-call Dial Number on Pressing Transfer Key [?](#)

- **Functionality**

Allows the user to configure the number to be dialed as DTMF when using the TRANSFER button.

- **Pvalues**

Pvalue	Description	Value Range	Default
1525	<New Pvalue> In-call Dial Number on Pressing Transfer Key	0 to 512 characters	NULL

MULTICAST PAGING MPK

- **Web Configuration**

This option can be found under device web UI→Programmable Keys→Multi-Purpose Keys.

Order	Mode	Account	Value	Label
1	Multicast Paging ▾	Account 1 ▾	* 1.1.1.1	MulticastPage

- **Functionality**

Multicast Paging - This option is for multicast sending. Enter Line key description in Description field and multicast sending address in Value field.

Multicast Listen Address - The MPK button can be used to access directly to the Multicast Listening IP list.

Multicast Paging Address - The MPK button can be used to access directly to the Multicast Paging IP list.

- **Pvalues**

Pvalues	Description	Value	Default
323-329, 353, 357, 361	<New Key Mode> Multicast Paging	13 = Multicast Paging	
323-329, 353, 357, 361	<New Key Mode> Multicast Listen Address	25 = MulticastListenAddress	
323-329, 353, 357, 361	<New Key Mode> Multicast Paging Address	33 = MulticastPagingAddress	

VPK

- **Web Configuration**

This option can be found under device web UI→ Programmable Keys→Virtual Multi-Purpose Keys

1	 Default ▼	Account 1 ▼	1012		⬆ ⬇
2	 Default ▼	Account 1 ▼	1012		⬆ ⬇

• Functionality

Allows the user to configure VPKs with modes such as Shared line, BLF, and Speed Dial.

Modes:

None (-1), SpeedDial (0), BLF (1), PresenceWatcher (2), EventlistBLF (3), SpeedDialViaActiveAccount (4), DialDTMF (5), VoiceMail (6), CallReturn (7), Transfer (8), CallPark (9), Intercom (10), LDAPSearch (11), Conference (12), MulticastPaging (13), CallLog (15), MonitoredCallPark (16), Menu (17), Information (19), Message (20), Forward (21), DND (22), Redial (23), MulticastListenAddress (25), EventListPresence (28), Provision (29), Default (31), SharedLine (32), Multicast Paging Address(33)

• Pvalues

Pvalue	Description	Value Range	Default
1363	<New Pvalue> VPK 1 – Key Mode	-1 - 33	31
1364	<New Pvalue> VPK 1 – Account	0-5	0
1465	<New Pvalue> VPK 1 – Label	Up to 32 characters	NULL
1466	<New Pvalue> VPK 1 – Value	Up to 64 characters	NULL
1365	<New Pvalue> VPK 2 – Key Mode	-1 - 33	31
1366	<New Pvalue> VPK 2 – Account	0-5	1
1467	<New Pvalue> VPK 2 – Label	Up to 32 characters	NULL
1468	<New Pvalue> VPK 2 – Value	Up to 64 characters	NULL
1367	<New Pvalue> VPK 3 – Key Mode	-1 - 33	31
1368	<New Pvalue> VPK 3 – Account	0-5	2
1469	<New Pvalue> VPK 3 – Label	Up to 32 characters	NULL

1470	<New Pvalue> VPK 3 – Value	Up to 64 characters	NULL
1369	<New Pvalue> VPK 4 – Key Mode	-1 - 33	31
1370	<New Pvalue> VPK 4 – Account	0-5	3
1471	<New Pvalue> VPK 4 – Label	Up to 32 characters	NULL
1472	<New Pvalue> VPK 4 – Value	Up to 64 characters	NULL
1371	<New Pvalue> VPK 5 – Key Mode	-1 - 33	31
1372	<New Pvalue> VPK 5 – Account	0-5	4
1473	<New Pvalue> VPK 5 – Label	Up to 32 characters	NULL
1474	<New Pvalue> VPK 5 – Value	Up to 64 characters	NULL
1373	<New Pvalue> VPK 6 – Key Mode	-1 - 33	31
1374	<New Pvalue> VPK 6 – Account	0-5	5
1475	<New Pvalue> VPK 6 – Label	Up to 32 characters	NULL
1476	<New Pvalue> VPK 6 – Value	Up to 64 characters	NULL
23800	<New Pvalue> VPK 7 – Key Mode	0-33	0
23801	<New Pvalue> VPK 7 – Account	0-5	0
23802	<New Pvalue> VPK 7 – Label	Up to 32 characters	NULL
23803	<New Pvalue> VPK 7 – Value	Up to 64 characters	NULL
23804	<New Pvalue> VPK 8 – Key Mode	0-33	0
23805	<New Pvalue> VPK 8 – Account	0-5	0
23806	<New Pvalue> VPK 8 – Label	Up to 32 characters	NULL

23807	<New Pvalue> VPK 8 – Value	Up to 64 characters	NULL
23808	<New Pvalue> VPK 9 – Key Mode	0-33	0
23809	<New Pvalue> VPK 9 – Account	0-5	0
23810	<New Pvalue> VPK 9 – Label	Up to 32 characters	NULL
23811	<New Pvalue> VPK 9 – Value	Up to 64 characters	NULL
23812	<New Pvalue> VPK 10 – Key Mode	0-33	0
23813	<New Pvalue> VPK 10 – Account	0-5	0
23814	<New Pvalue> VPK 10 – Label	Up to 32 characters	NULL
23815	<New Pvalue> VPK 10 – Value	Up to 64 characters	NULL
23816	<New Pvalue> VPK 11 – Key Mode	0-33	0
23817	<New Pvalue> VPK 11 – Account	0-5	0
23818	<New Pvalue> VPK 11 – Label	Up to 32 characters	NULL
23819	<New Pvalue> VPK 11 – Value	Up to 64 characters	NULL
23820	<New Pvalue> VPK 12 – Key Mode	0-33	0
23821	<New Pvalue> VPK 12 – Account	0-5	0
23822	<New Pvalue> VPK 12 – Label	Up to 32 characters	NULL
23823	<New Pvalue> VPK 12 – Value	Up to 64 characters	NULL

3 XML PHONEBOOK URLS

- **Web Configuration**

This option can be found under device web UI→Application→Remote Phonebook.

	Display Name	URL	Username	Password
Phonebook 1				
Phonebook 2				
Phonebook 3				

Remote Phonebook Update Interval(m) [?](#)

- Functionality**

Allows the user to configure up to 3 XML Phonebook URLs

- Pvalues**

Pvalue	Description	Value Range	Default
22427	<New Pvalue> Display Name – Phonebook 1	0 to 512 characters	NULL
22428	<New Pvalue> URL – Phonebook 1	0 to 512 characters	NULL
22429	<New Pvalue> Username – Phonebook 1	0 to 512 characters	NULL
22430	<New Pvalue> Password – Phonebook 1	0 to 512 characters	NULL
22431	<New Pvalue> Display Name – Phonebook 2	0 to 512 characters	NULL
22432	<New Pvalue> URL – Phonebook 2	0 to 512 characters	NULL
22433	<New Pvalue> Username – Phonebook 2	0 to 512 characters	NULL
22434	<New Pvalue> Password – Phonebook 2	0 to 512 characters	NULL
22435	<New Pvalue> Display Name – Phonebook 3	0 to 512 characters	NULL
22436	<New Pvalue> URL – Phonebook 3	0 to 512 characters	NULL
22437	<New Pvalue> Username – Phonebook 3	0 to 512 characters	NULL
22438	<New Pvalue> Password – Phonebook 3	0 to 512 characters	NULL

22426	<New Pvalue> Remote Phonebook Update Interval(m)	0, 5-720	0
-------	---	----------	---

FIRMWARE VERSION 1.0.1.41

PRODUCT NAME

GRP2601(P), GRP2602(P/W), GRP2603(P), GRP2604(P)

DATE

3/25/2021

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: e0bd03c129e07e5246151a9524bbceb1

ENHANCEMENT

- Updated English strings for LCD display
- Updated English strings for Web UI display
- Updated Arabic strings display
- Added Support for Ukrainian language on LCD display
- Updated Customized softkey icons
- Added Support for 3CX
- Added VLAN tag settings on Device LCD menu
- Added Support for Line LED Color Scheme [LINE LED COLOR SCHEME]
- Added Support to force a reboot after provisioning by P-values [FORCE REBOOT BY PVALUE PROVISIONING]
- Added Support to configure remaining accounts with a SIP account when public mode is enabled [ALLOW MULTIPLE ACCOUNTS]
- Added Support of dial now option in the dial plan types [DIAL NOW TYPE]
- Added Support to setup a Forward Always softkey on idle screen [FORWARD ALWAYS SOFTKEY]
- Added Support of "Ring for call waiting" [RING FOR CALL WAITING]

BUG FIX

- Fixed web page displays wrongly after factory reset
- Fixed Device does not download language file when language is set to downloaded language
- Fixed LCD pops up "The number doesn't match dial plan" when dialing star feature code
- Fixed Web page has no Action URI Support option when logging in as end user
- Fixed Wi-Fi cannot scan SSID when 802.1x is enabled on Ethernet
- Fixed Device always uses TLS 1.2 if syslog protocol is set to SSL/TLS
- Fixed Device does not display VPN IP
- Fixed Device fails to log in to Openfire after XMPP is configured the destination address

- Fixed The default security mode for adding SSIDs on the web UI menu should be WPA
- Fixed The default security mode for adding SSIDs on the LCD menu should be WPA
- Fixed The conferee can't mute the call correctly
- Fixed Device password is mandatory in auto mode
- Fixed Device crashed after disabling Wi-Fi in scanning status
- Fixed Device LCD characters are not fully displayed in some LCD menu
- Fixed Device works abnormal when add SSID using static IPv6 address
- Fixed Device security issue with SSH tool
- Fixed Device integrated call forwarding issue
- Fixed Device caller interface displays abnormal when the phone keyboard is locked
- Fixed Device does not respond to NOTIFY after switching 3CX configuration method
- Fixed Device does not play second dial tone
- Fixed Device does not sent outbound notify when Ethernet uses IPv4 only

NEW FEATURES OVERVIEW

LINE LED COLOR SCHEME

- **Web Configuration**

This option can be found under device web UI→System Settings→Preferences→Display Control.

Line LED Color Scheme  ☒ Default ☐ Light up

- **Functionality**

Configures line key led color scheme.

- Default: off(idle)/green(in use)
- Light up: green(idle)/red(in use)

- **Pvalue**

Pvalue	Description	Value Range	Default
22362	<New Pvalue> Line LED Color Scheme	Value = 0; Default Value = 1; Light up	Default

FORCE REBOOT BY PVALUE PROVISIONING

- **Functionality**

Now with the new Pvalue 22421 (or alias “provision.config.forceReboot”) set to 1 in config file, phone will need to reboot if any change is applied by downloading the config file. Specifically following the process below:

1st time download:

- 1) Phone downloaded a config file (in any supported format) with P22421 set to 1 included.
- 2) Phone found there is change(s) comparing with current setting on the phone (Any valid Pvalue change, no matter it does need reboot to apply or not).

3) Phone will update to new setting (will not save P22421 itself) and will go into normal reboot process (eg: if there is active call, phone will wait until it is finished)

2nd time download:

4) After reboot, phone may download the same config file again (if the config file path did not change).

5) Phone checked the config file and found there is no Pvalue needed to be updated.

6) Phone will not reboot again.

- **Pvalue**

Pvalue	Description	Value Range	Default
22421	<New Pvalue> Provision config force reboot	Value = 0; No Value = 1; Yes	No

ALLOW MULTIPLE ACCOUNTS

- **Web Configuration**

This option can be found under device web UI→Phone Settings→General Settings→Public Mode.

Allow Multiple Accounts  ☐

- **Functionality**

Now users are able to configure remaining account with a SIP account and be able to make/receive calls on the configured account even if the user is not logged in to the public mode.

- If set to "No", then after the user logs in to the public mode account on LCD, only the public mode account can be used on the phone even though there are other configured SIP accounts
- If set to "Yes," then after the user logs in to the public mode account on LCD, other configured SIP accounts on the phone can also be used. Note: This option requires enabling public mode to take effect.

- **Pvalue**

Pvalue	Description	Value Range	Default
8564	<New Pvalue> Allow Multiple Accounts	Value = 0; No Value = 1; Yes	No

DIAL NOW TYPE

- **Web Configuration**

This option can be found under device web UI→Accounts→Account x→Dial plan→Type.

Accounts

Account 1 | Account 2 | Account 3 | Account 4 | Account 5 | Account 6

General Settings | SIP Settings | Codec Settings | Call Settings | Advanced Settings | **Dial Plan** | Feature Codes

Add | Save | Reset

Name	Rule	Type	
Empty name	x+	Dial now	X ⬆ ⬆
Empty name	\+x+	Pattern	X ⬆ ⬆
Empty name	*x+	Pattern	X ⬆ ⬆
Empty name	*xx*x+	Pattern	X ⬆ ⬆

- **Functionality**

With this "Dial now" type, the rules you set in combination with this type will be dialed out once the DTMF matches the dial plan.

FORWARD ALWAYS SOFTKEY

- **Web Configuration**

This option can be found under device web UI → Programmable Keys → Idle Screen Softkeys → Custom Softkey Layout.

Custom Softkey Layout

☐ Available ⓘ 4/15

☐ LogOut

☐ ParkedCalls

☒ **Forward Always**

☐ Menu

☐ Call History

☐ BS Call History


☒ Enabled ⓘ 4

1. Contacts

2. Redial

3. Do not Disturb

4. Forward Always

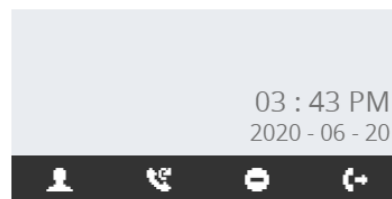

- **Functionality**

Now users are able to setup the Forward Always softkey on idle screen. By pressing the softkey, users get access to a menu on LCD screen to configure the Forward Always settings.

RING FOR CALL WAITING

- **Web Configuration**

This option can be found under device web UI → Phone Settings → Call Settings.

Ring for Call Waiting ⓘ ☐

- **Functionality**

Configures the phone to ring instead of playing call waiting tone when handset or headset is used.

- **Pvalue**

Pvalue	Description	Value Range	Default
22102	<New Pvalue> Ring for Call Waiting	Value = 0; No Value = 1; Yes	No

FIRMWARE VERSION 1.0.1.36

PRODUCT NAME

GRP2601(P), GRP2602(P), GRP2603(P), GRP2604(P)

DATE

2/9/2021

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: c487b0c3b4ce2361fc97e8d1a1882b21

ENHANCEMENT

- Improved Instant Messages popup message in idle page
- Improved popup message when user fails to log into web UI
- Improved popup message when user enters dial page in unregistered status from LCD
- Improved the MPK settings position
- Added Greek language support

BUG FIX

- Fixed The TX of attending phone is silent in four-way conference
- Fixed Device cannot use 1000M link to connect to the network
- Fixed Device GUI crashes after pressing DND key when outbound notification is enabled
- Fixed Device GUI crashed after pressing N-way conference key three times
- Fixed Device barge-in issue in SCA mode
- Fixed Device LDAP MPK works abnormally
- Fixed Device cannot disable local call features
- Fixed DND Call Feature On/Off cannot work correctly
- Fixed Device does not send INVITE with *72+number after the call forward unconditional with local UCM account is enabled from LCD menu
- Fixed Device works abnormally with MPK configured as speed dial or BLF mode
- Fixed Message Waiting ringtone doesn't work correctly after setting up in web
- Fixed Device still plays busy tone after getting coming call then cancelling it
- Fixed LCD displayed DTMF softkey abnormally when MPK user ID contains “,” or “;”
- Fixed press # or send key works abnormally when device have no call history entry
- Fixed Device locks all users when using wrong password to login web UI
- Fixed Device DialDTMF Mode via MPK works abnormally in dialing page
- Fixed firmware server password still does not display when it's set to be visible

- Fixed Account bar display issue after doing attended transfer
- Fixed Dial DTMF MPK works abnormally issue
- Fixed Trusted CA Certificates uploading issue
- Fixed Bypass Dial Plan works abnormally
- Fixed LCD pops up "Already dialing" when user dials voice mail via Message MPK
- Fixed Some P values uploaded from config file does not work
- Fixed Message MPK does not be disabled during a call
- Fixed Outbound Notification XMPP does not work
- Fixed Device displays "internal error" if clicking BLF MPK while its monitored account has an incoming call
- Fixed Device can still make IP call when it locks functional keys
- Fixed the calling interface of GDS does not display the door icon
- Fixed Device keypad lock related issue

FIRMWARE VERSION 1.0.1.18

PRODUCT NAME

GRP2601(P), GRP2602(P), GRP2603(P), GRP2604(P)

DATE

12/8/2020

FIRMWARE FILE INFORMATION

- Firmware file name: grp2600fw.bin

MD5: d057ec0050db9a944c820688b321427d

This is the initial version for GRP2601(P), GRP2602(P), GRP2603(P), GRP2604(P).