

GWN70xx Wireless Router Firmware Release Notes

IMPORTANT UPGRADING NOTE

- 1. GWN70xx 1.0.9.42 requires GWN Manager version to be at least 1.1.28.27 or newer.**
- 2. Downgrading from firmware 1.0.9.x or higher version to 1.0.7.x or lower version will cause device to perform factory reset automatically. All device configurations will be reset to factory default settings after downgrading.**

Table of Content

IMPORTANT UPGRADING NOTE	1
FIRMWARE FILE DOWNLOAD	5
FIRMWARE VERSION 1.0.9.42	6
PRODUCT NAME	6
DATE	6
FIRMWARE FILE INFORMATION	6
CHANGES/ENHANCEMENT	6
FIRMWARE VERSION 1.0.9.37	7
PRODUCT NAME	7
DATE	7
FIRMWARE FILE INFORMATION	7
CHANGES/ENHANCEMENT	7
FIRMWARE VERSION 1.0.9.34	8
PRODUCT NAME	8
DATE	8
FIRMWARE FILE INFORMATION	8
CHANGES/ENHANCEMENT	8
NEW FEATURE OVERVIEW	9
FIRMWARE VERSION 1.0.9.15	10
PRODUCT NAME	10
DATE	10
FIRMWARE FILE INFORMATION	10
CHANGES/ENHANCEMENT	10
FIRMWARE VERSION 1.0.9.10 (1.0.9.9)	11
PRODUCT NAME	11
DATE	11
FIRMWARE FILE INFORMATION	11
CHANGES/ENHANCEMENT	11
NEW FEATURE OVERVIEW	13
FIRMWARE VERSION 1.0.7.2	21
PRODUCT NAME	21

DATE.....	21
FIRMWARE FILE INFORMATION	21
CHANGES/ENHANCEMENT	21
FIRMWARE VERSION 1.0.7.1	22
PRODUCT NAME.....	22
DATE.....	22
FIRMWARE FILE INFORMATION	22
CHANGES/ENHANCEMENT	22
FIRMWARE VERSION 1.0.5.44	23
PRODUCT NAME.....	23
DATE.....	23
FIRMWARE FILE INFORMATION	23
CHANGES/ENHANCEMENT	23
FIRMWARE VERSION 1.0.5.38	24
PRODUCT NAME.....	24
DATE.....	24
FIRMWARE FILE INFORMATION	24
CHANGES/ENHANCEMENT	24
FIRMWARE VERSION 1.0.5.34	25
PRODUCT NAME.....	25
DATE.....	25
FIRMWARE FILE INFORMATION	25
CHANGES/ENHANCEMENT	25
FIRMWARE VERSION 1.0.5.12	26
PRODUCT NAME.....	26
DATE.....	26
FIRMWARE FILE INFORMATION	26
CHANGES/ENHANCEMENT	26
FIRMWARE VERSION 1.0.5.9	27
PRODUCT NAME.....	27
DATE.....	27
FIRMWARE FILE INFORMATION	27
CHANGES/ENHANCEMENT	27
[GWN7062] FIRMWARE VERSION 1.0.5.6	28

PRODUCT NAME	28
DATE	28
FIRMWARE FILE INFORMATION	28
CHANGES/ENHANCEMENT	28
[GWN7052] FIRMWARE VERSION 1.0.5.5	29
PRODUCT NAME	29
DATE	29
FIRMWARE FILE INFORMATION	29
CHANGES/ENHANCEMENT	29

FIRMWARE FILE DOWNLOAD

Individual firmware files are available for downloading at URL below:

<https://www.grandstream.com/support/firmware>

FIRMWARE VERSION 1.0.9.42

PRODUCT NAME

GWN7062 / GWN7052 / GWN7052F

DATE

6/24/2024

FIRMWARE FILE INFORMATION

- GWN7052 Firmware file name: gwn7062fw.bin
MD5 checksum: eed5f91d86c471be71c204870028511f
- GWN7062 Firmware file name: gwn7052fw.bin
MD5 checksum: f3ea3d18a4a236cf9bd1c7b683341c02
- GWN7052F Firmware file name: gwn7052ffw.bin
MD5 checksum: 1644ef290c230a978e166bdeda246e89

CHANGES/ENHANCEMENT

- Internal bug fixes

FIRMWARE VERSION 1.0.9.37

PRODUCT NAME

GWN7062 / GWN7052 / GWN7052F

DATE

4/1/2024

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: ef6754baaedef7c4eb66ecf3abacee2d
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: 3eaed1619354f3c61f22bb8faf71ee1
- GWN7052F Firmware file name: gwn7052ffw.bin
MD5 checksum: 93f94571e4a5bdd076efb8acf289de40

CHANGES/ENHANCEMENT

- Internal bug fixes

FIRMWARE VERSION 1.0.9.34

PRODUCT NAME

GWN7062 / GWN7052 / GWN7052F

DATE

1/12/2024

FIRMWARE FILE INFORMATION


- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 585ee63c4a921c8663c7fa381c5f745a
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: 408aec3afbcee3a6591ef75996470da8
- GWN7052F Firmware file name: gwn7052ffw.bin
MD5 checksum: 86cab22f806374919fea40f9cc1439bc

CHANGES/ENHANCEMENT

- Added the new feature of **Speed test**
- Added the new feature of **ISP default configuration**
- Internal bug fixes

NEW FEATURE OVERVIEW

- **Speed test**

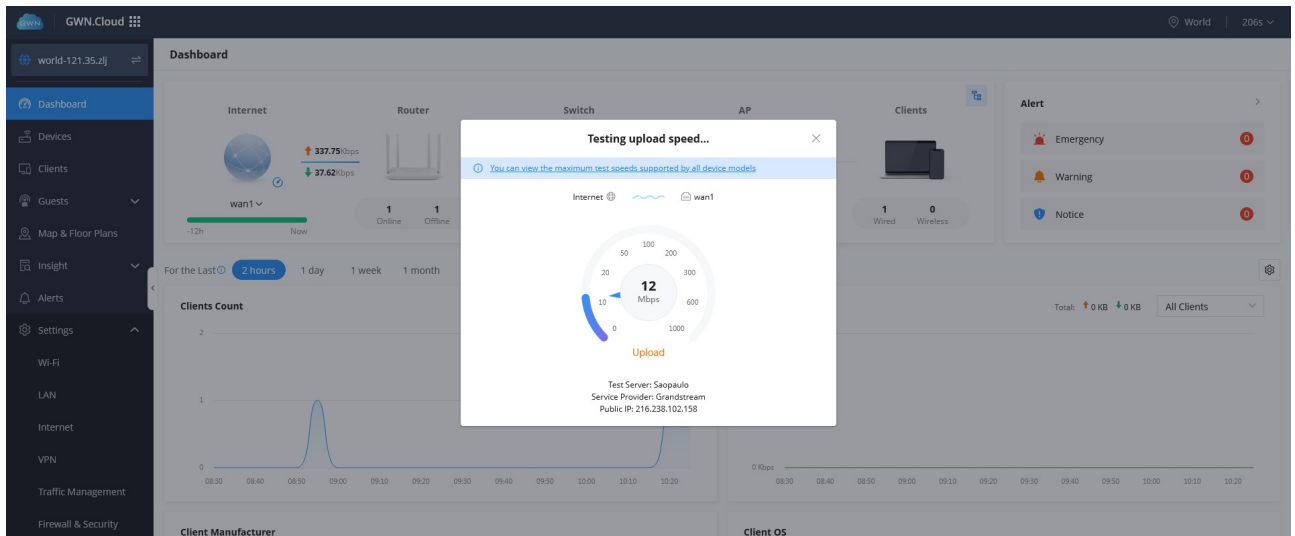

- **ISP default configuration**

With the provided gs configuration tool, administrators can provision an ISP default configuration to the router. After provisioning, by performing factory reset, the device will restore to the customized default configuration other than the original factory default.

FIRMWARE VERSION 1.0.9.15

PRODUCT NAME

GWN7062 / GWN7052 / GWN7052F

DATE

12/15/2023

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 02241fb65514c394e66a103a5e5b8050
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: 8dee45da1dcc7e555dba97244a47f40c
- GWN7052F Firmware file name: gwn7052ffw.bin
MD5 checksum: e7ab0fd20ad80e31834ca67eaa1e9f68

CHANGES/ENHANCEMENT

- Fixed an OpenVPN certificate issue from upgrading unit from 1.0.7.x to 1.0.9.9(10).
- Internal bug fixes.

FIRMWARE VERSION 1.0.9.10 (1.0.9.9)

PRODUCT NAME

GWN7062 / GWN7052 / GWN7052F

DATE

10/23/2023

FIRMWARE FILE INFORMATION

- GWN7062(1.0.9.10) Firmware file name: gwn7062fw.bin
MD5 checksum: 5e5ca5e7542851b291e6c9e6ae0712ba
- GWN7052(1.0.9.10) Firmware file name: gwn7052fw.bin
MD5 checksum: 1bc8dbef492c0587988a034f407dd268
- GWN7052F(1.0.9.9) Firmware file name: gwn7052ffw.bin
MD5 checksum: 227d4a06871a2c3be417eb228f973f8a

CHANGES/ENHANCEMENT


- Changed to new GWN router UI
- Added new feature of **AP Mode**
- Added new feature of **DoS Defense**
- Added new feature of **Spoofing Defense**
- Added new feature of **IGMP**
- Added new feature of Policy Routing: **ICMP** and **Schedule**
- Added new feature of **HostName** access
- Added new feature of **USB: 4G Dongle**(GWN7062 only)
- Added new feature of DHCP Option Optimization & **Option 43 Service List**
- Added new feature of **Alert**
- Added new feature of **Triple Play**

- Added new feature of **Bandwidth Limit**
- Added new feature of **Vouchers**
- Added new feature of **WireGuard®**
- Added new feature of **mDNS Bonjour**
- Added new feature of **Static IP binding by client ID**
- Added new feature of **TR069**
- Added new feature of **PPSK**
- Added support of 2.4G & 5G custom channel
- Added support of discovering APs across VLANs
- Added support of GWN Menu
- Added support of more Cloud Features: Portal, VPN, Policy Routing, Modifying web Password, Certification management, WAN Health, WAN VLAN Priority, Event: Client Authentication Information, Global Blacklist
- Optimized feature as enabling CH12 and CH13 in the 2.4G band for New Zealand

NEW FEATURE OVERVIEW


- **AP Mode**


Now GWN wireless router can change its Operation Mode between **Router** vs **Access Point**. The default is Router mode. Access Point mode will allow router to become a MESH RE-AP, in order to form MESH with other GWN CAP or wireless router.

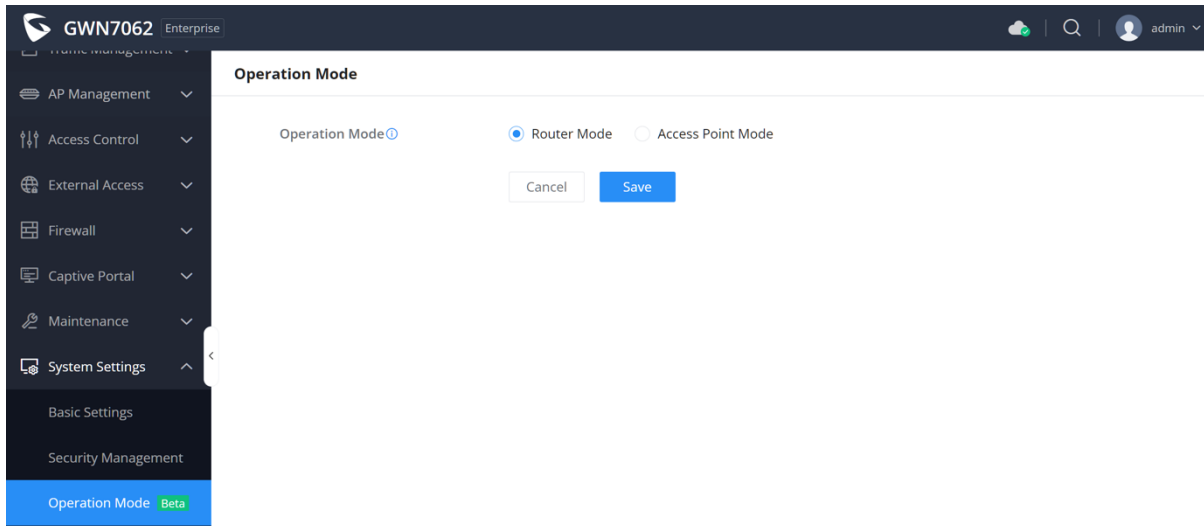

- **Firewall - DoS Defense & Spoofing Defense**


Added more firewall defense features

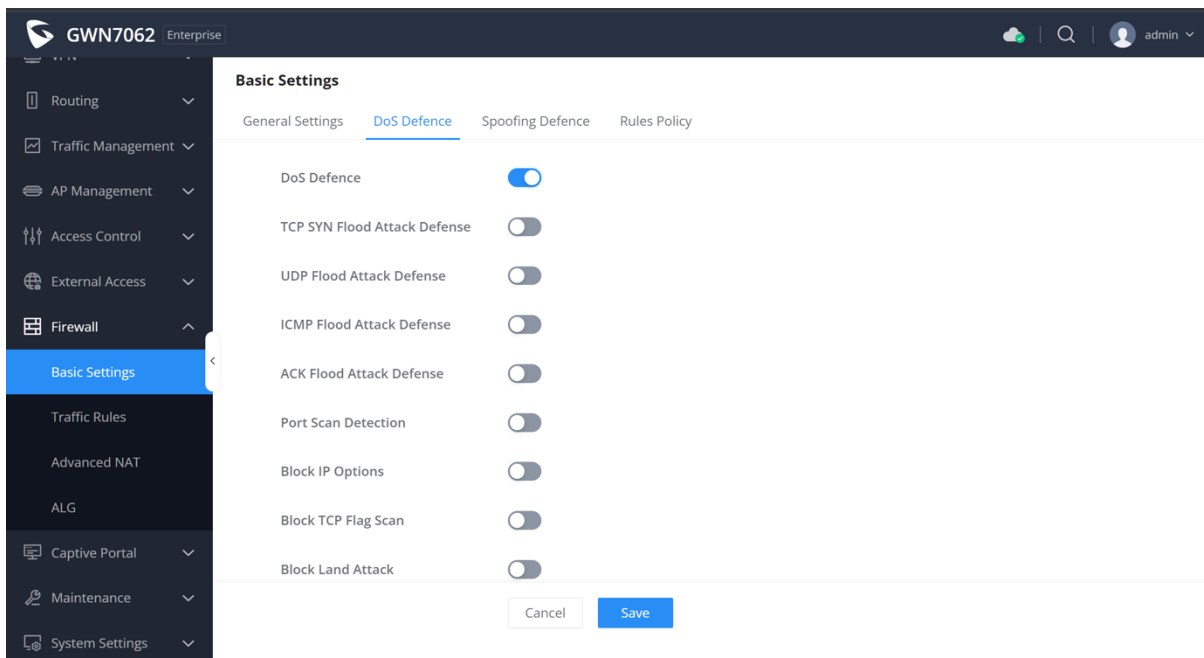

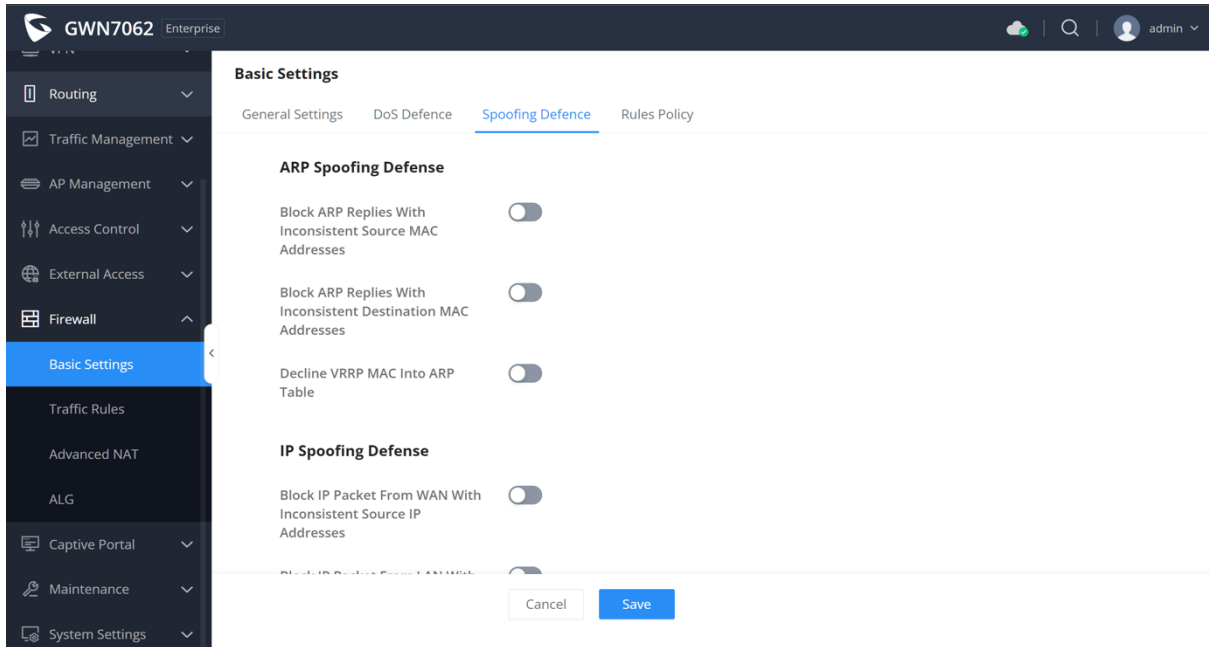


- **IGMP**

Support IGMP proxy and IGMP snooping settings.

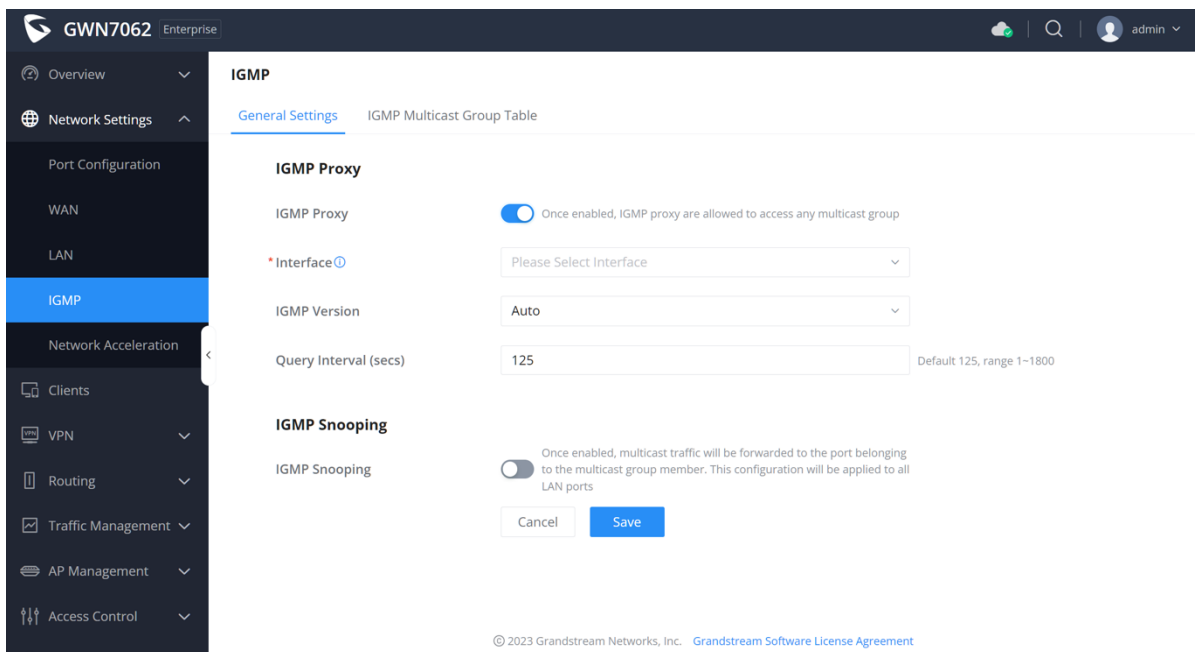

- **Policy Routing: ICMP & Schedule**

Added **ICMP** to protocol type and added **Schedule** to manage policy route.

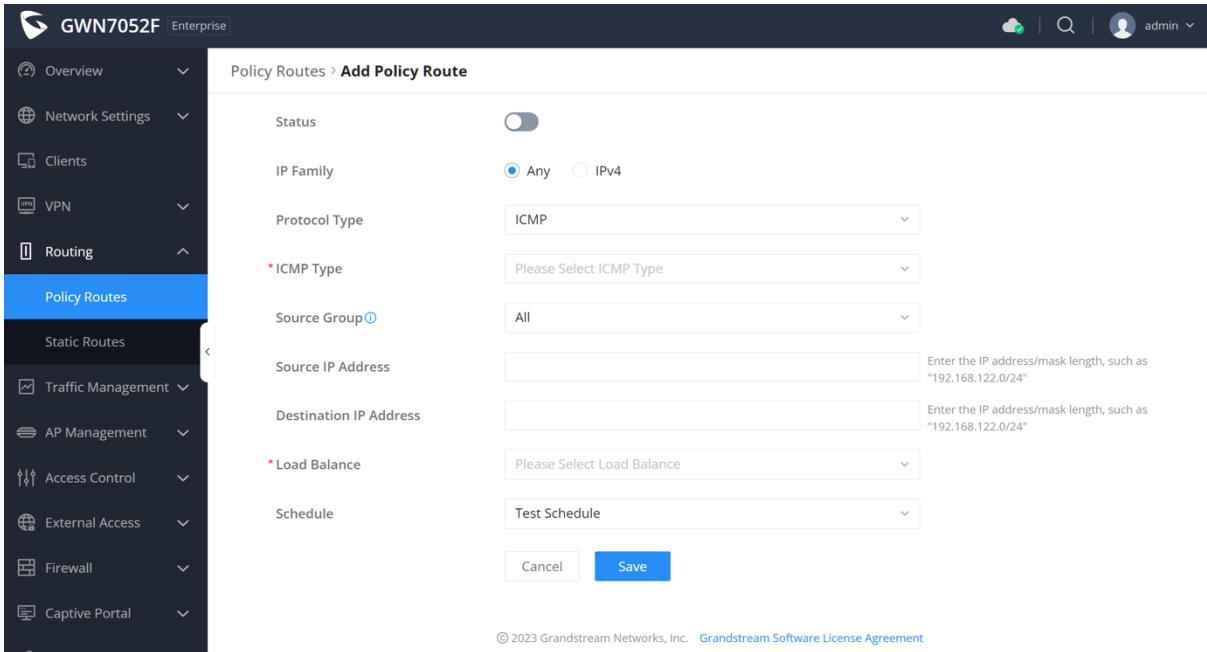


The screenshot shows the 'Policy Routes > Add Policy Route' configuration page in the Grandstream GWN7052F Enterprise web interface. The left sidebar is expanded to 'Policy Routes'. The main configuration area includes the following fields:

- Status:** A toggle switch is turned off.
- IP Family:** Radio buttons for 'Any' (selected) and 'IPv4'.
- Protocol Type:** A dropdown menu set to 'ICMP'.
- ICMP Type:** A dropdown menu with the text 'Please Select ICMP Type'.
- Source Group:** A dropdown menu set to 'All'.
- Source IP Address:** An empty text input field with a tooltip: 'Enter the IP address/mask length, such as "192.168.122.0/24"'. A small blue circle icon is next to the label.
- Destination IP Address:** An empty text input field with a tooltip: 'Enter the IP address/mask length, such as "192.168.122.0/24"'. A small blue circle icon is next to the label.
- Load Balance:** A dropdown menu with the text 'Please Select Load Balance'.
- Schedule:** A dropdown menu set to 'Test Schedule'.

At the bottom of the form are 'Cancel' and 'Save' buttons. A footer note reads: '© 2023 Grandstream Networks, Inc. Grandstream Software License Agreement'.

- **HostName Access**

This will allow local users to use configured hostname to access router web portal.

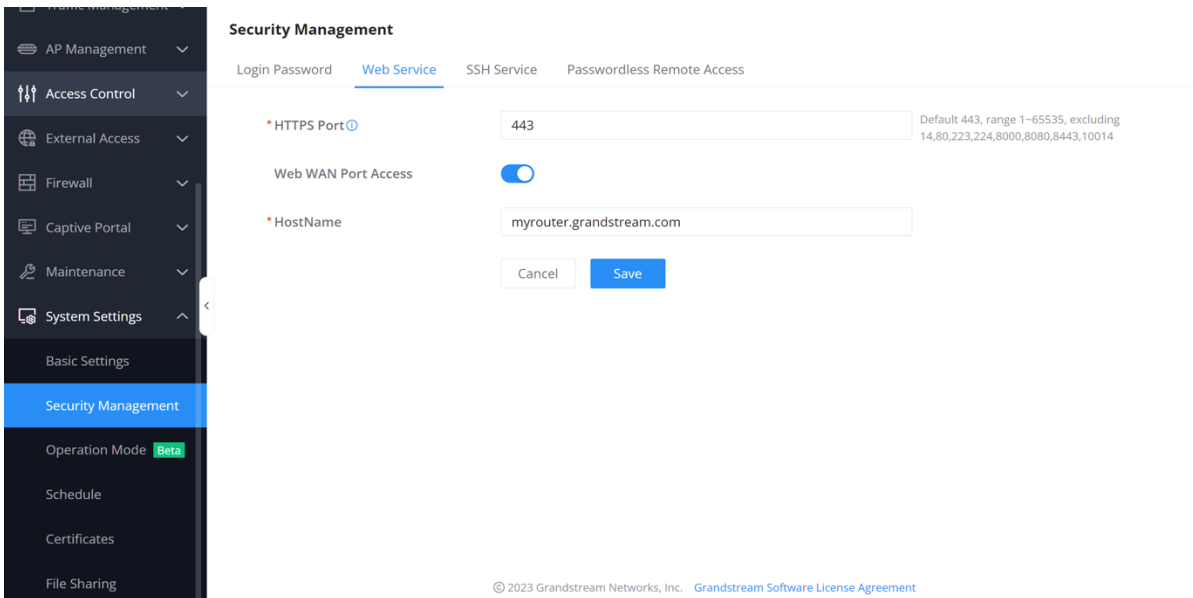



The screenshot shows the 'Security Management' configuration page in the Grandstream GWN7052F Enterprise web interface. The left sidebar is expanded to 'Security Management'. The main configuration area includes the following fields:

- Web Service:** A sub-section with tabs for 'Login Password', 'Web Service' (selected), 'SSH Service', and 'Passwordless Remote Access'.
- HTTPS Port:** A text input field containing '443' with a tooltip: 'Default 443, range 1-65535, excluding 14,80,223,224,8000,8080,8443,10014'. A small blue circle icon is next to the label.
- Web WAN Port Access:** A toggle switch is turned on.
- HostName:** A text input field containing 'myrouter.grandstream.com'.


At the bottom of the form are 'Cancel' and 'Save' buttons. A footer note reads: '© 2023 Grandstream Networks, Inc. Grandstream Software License Agreement'.

- **USB: 4G Dongle**

After insert 4G USB dongle, user will be able to see the 4G USB modem option as below:

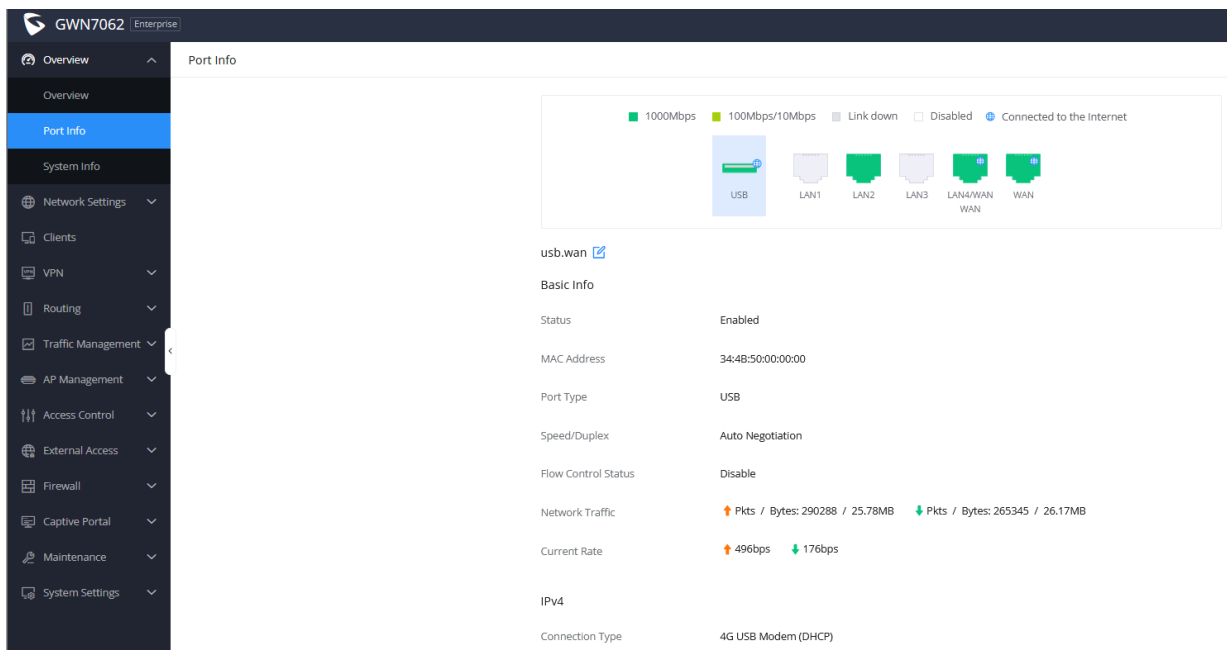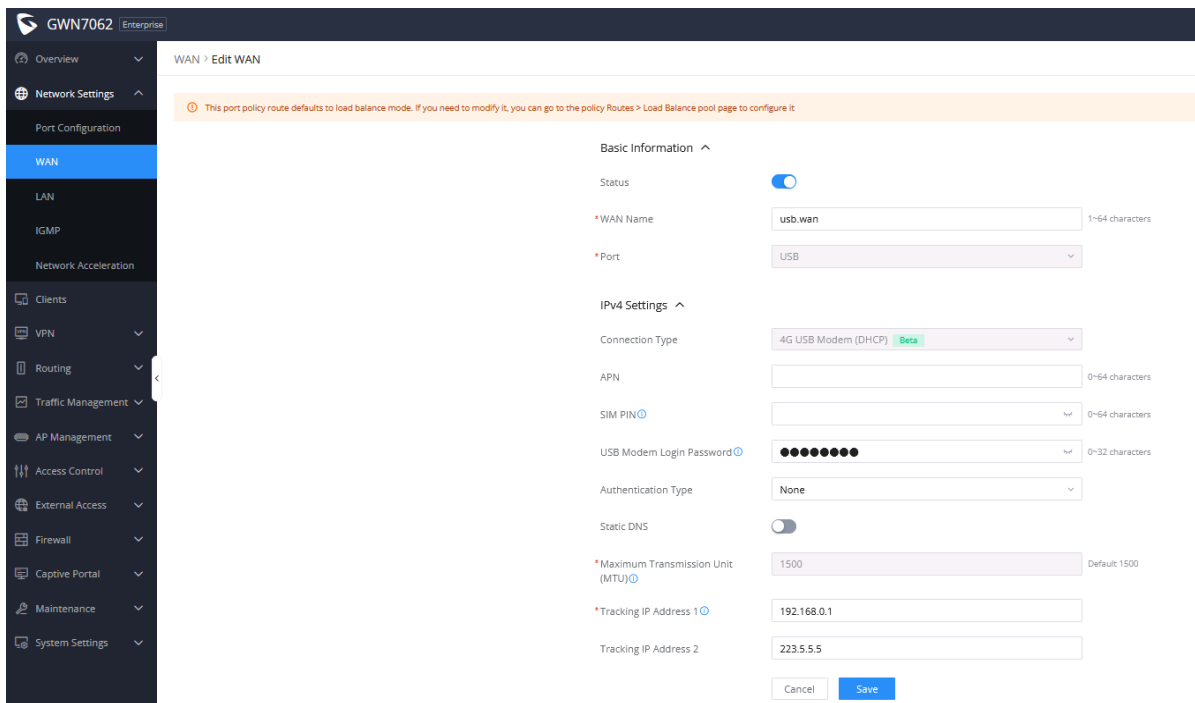


- **DHCP Option Optimization & Option 43 Service List**

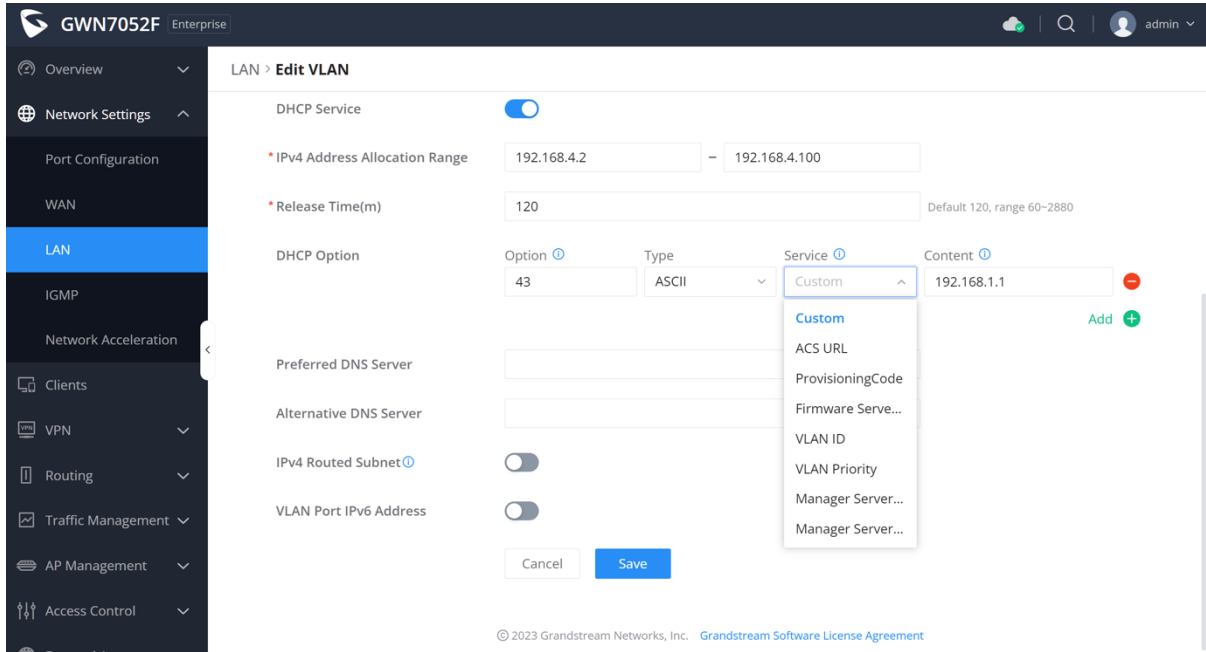

The screenshot shows the 'LAN > Edit VLAN' configuration page. The DHCP Service is enabled. The IPv4 Address Allocation Range is set to 192.168.4.2 - 192.168.4.100, and the Release Time is 120m. A table for DHCP Options is visible, with a dropdown menu open for Option 43. The dropdown lists various services, with 'Custom' selected. The content for Option 43 is set to 192.168.1.1. Other options like Preferred DNS Server, Alternative DNS Server, IPv4 Routed Subnet, and VLAN Port IPv6 Address are also visible.

Option	Type	Service	Content
43	ASCII	Custom	192.168.1.1

- **Alert**

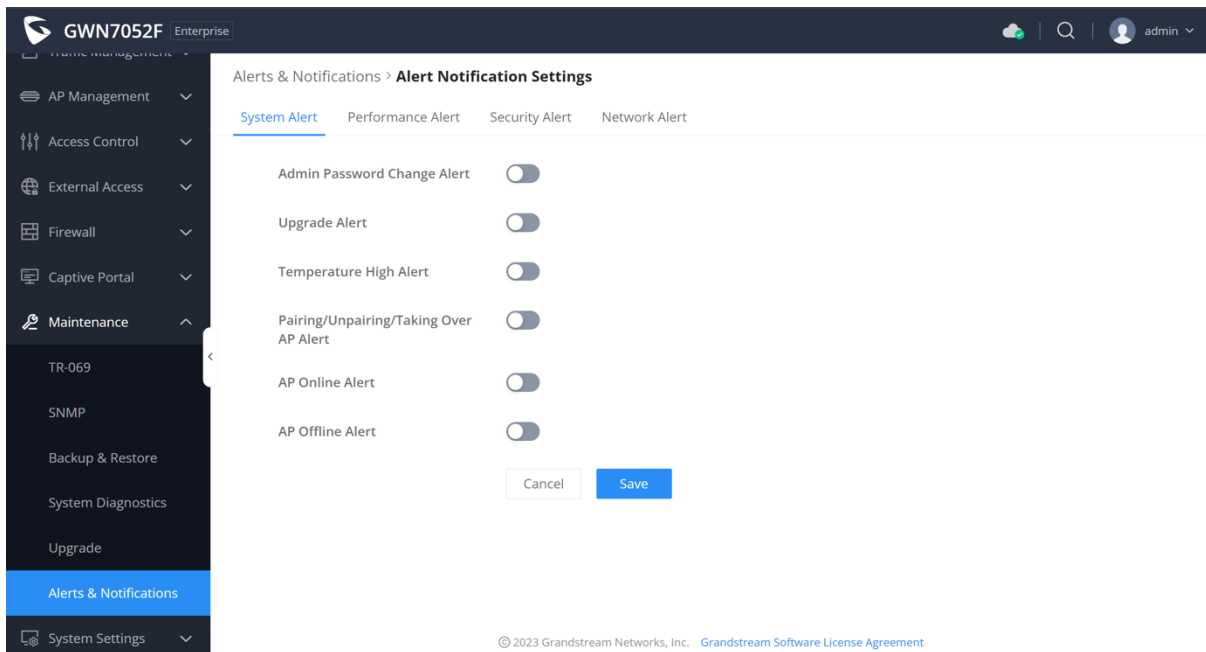

The screenshot shows the 'Alerts & Notifications > Alert Notification Settings' page. The 'System Alert' tab is selected. A list of alert types is shown, each with a toggle switch. All listed alerts are currently disabled.

Alert Type	Status
Admin Password Change Alert	Disabled
Upgrade Alert	Disabled
Temperature High Alert	Disabled
Pairing/Unpairing/Taking Over AP Alert	Disabled
AP Online Alert	Disabled
AP Offline Alert	Disabled

- **Triple Play**


Configuration is available at Network Settings → WAN → Edit WAN

Bridge Mode

*VLAN Tag ID/Port/Priority ⓘ

VLAN Tag ID	Port ⓘ	Priority ⓘ	
Enter VLAN Tag ID	Choose Port	0	<input type="button" value="−"/>

- **Bandwidth Limit**

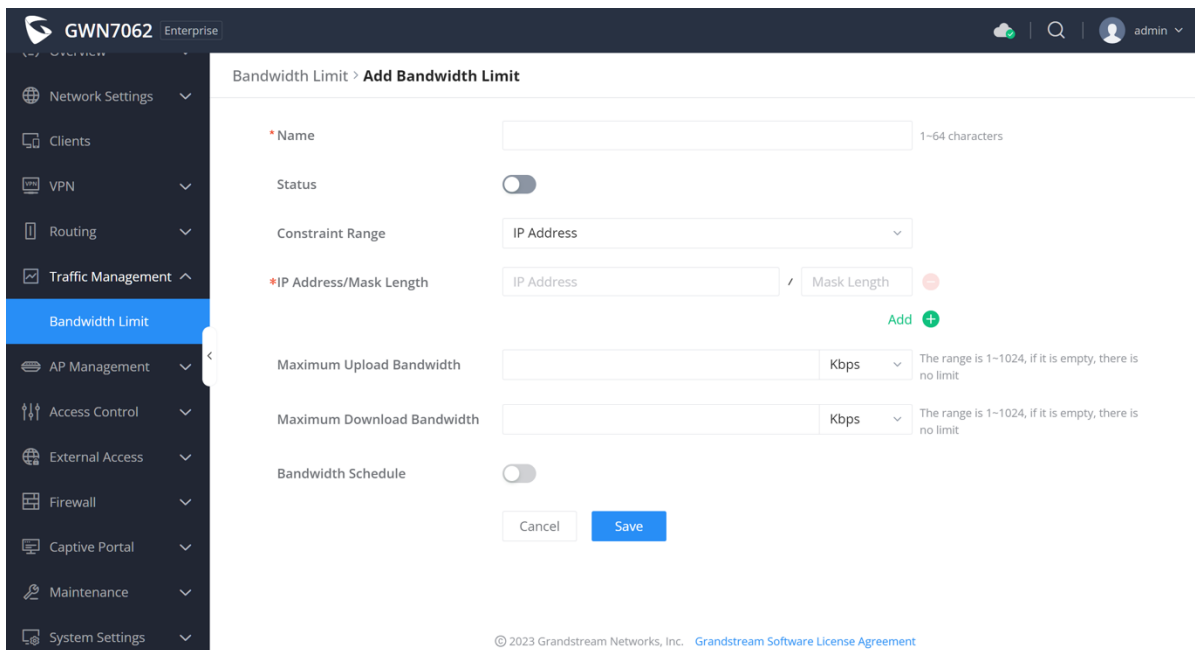

The screenshot shows the 'Bandwidth Limit > Add Bandwidth Limit' configuration page. The left sidebar contains a navigation menu with 'Bandwidth Limit' highlighted. The main content area includes the following fields:


- Name:** Text input field with a 1-64 characters limit.
- Status:** Toggle switch, currently turned off.
- Constraint Range:** Dropdown menu set to 'IP Address'.
- *IP Address/Mask Length:** Two input fields for 'IP Address' and 'Mask Length', with an 'Add +' button to the right.
- Maximum Upload Bandwidth:** Input field with a 'Kbps' dropdown and a note: 'The range is 1-1024, if it is empty, there is no limit'.
- Maximum Download Bandwidth:** Input field with a 'Kbps' dropdown and a note: 'The range is 1-1024, if it is empty, there is no limit'.
- Bandwidth Schedule:** Toggle switch, currently turned off.

At the bottom, there are 'Cancel' and 'Save' buttons. A footer note reads: '© 2023 Grandstream Networks, Inc. Grandstream Software License Agreement'.

- **Vouchers**

Configuration is available at Captive Portal → Vouchers

- **WireGuard®**

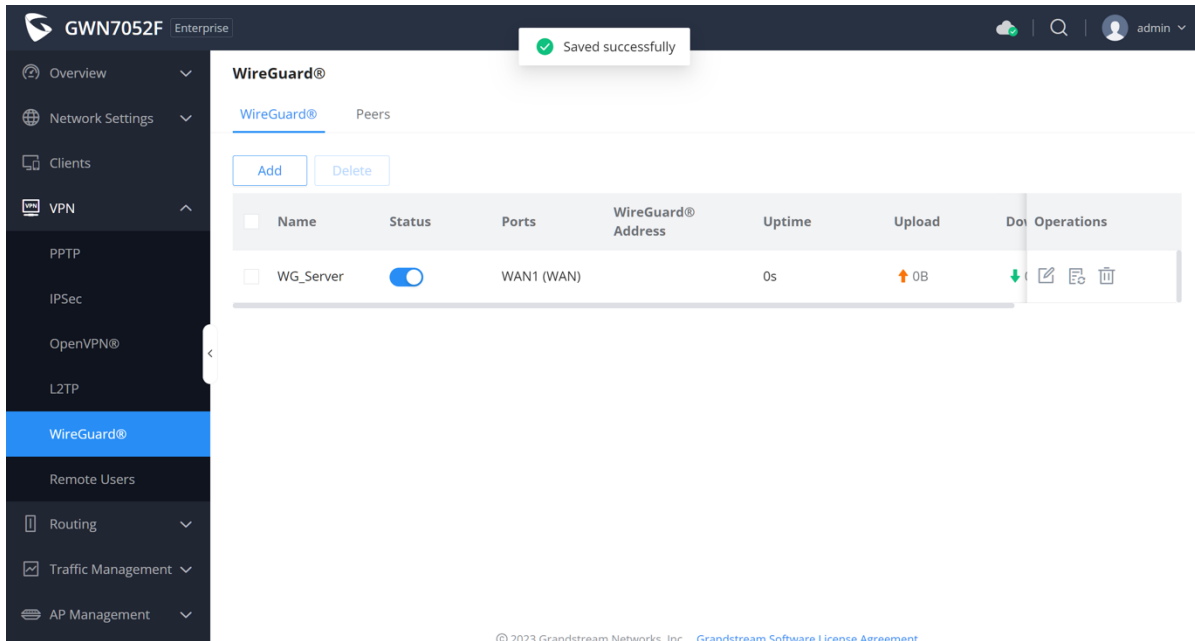


WireGuard® Peers

Buttons: [Add](#) [Delete](#)

<input type="checkbox"/>	Name	Status	Ports	WireGuard® Address	Uptime	Upload	Download	Operations
<input type="checkbox"/>	WG_Server	<input checked="" type="checkbox"/>	WAN1 (WAN)		0s	↑ 0B	↓	Edit Refresh Delete

© 2023 Grandstream Networks, Inc. [Grandstream Software License Agreement](#)

- **mDNS Bonjour**

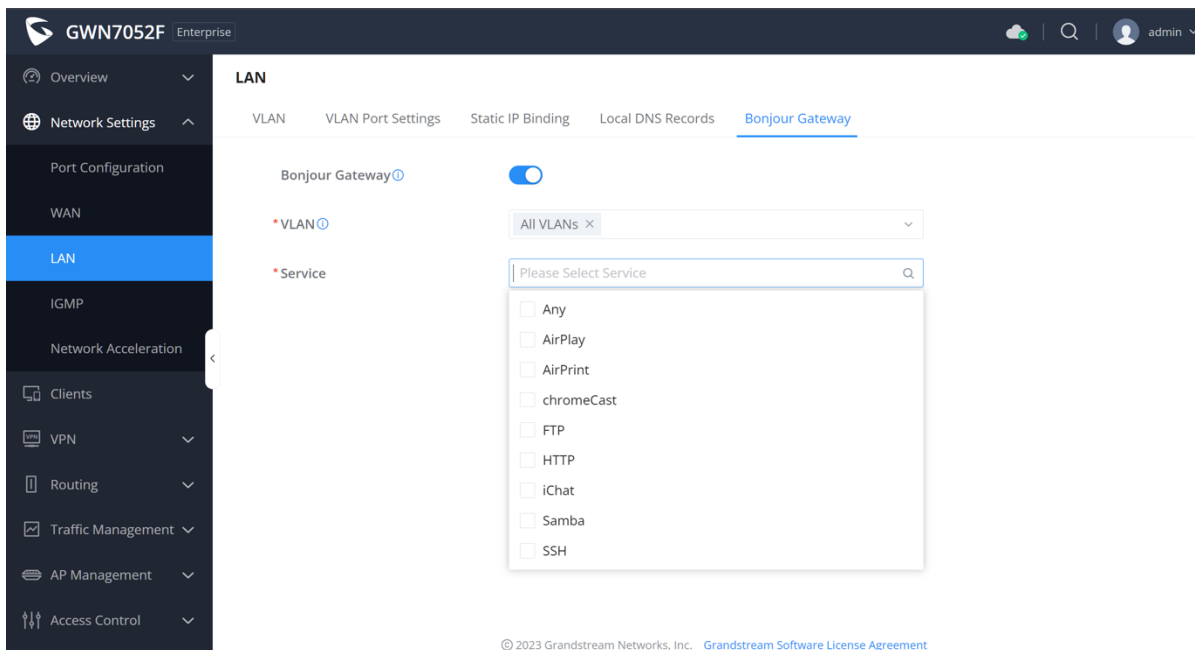

LAN Bonjour Gateway

Options: [VLAN](#) [VLAN Port Settings](#) [Static IP Binding](#) [Local DNS Records](#) [Bonjour Gateway](#)

Bonjour Gateway


*VLAN

*Service

- Any
- AirPlay
- AirPrint
- chromeCast
- FTP
- HTTP
- iChat
- Samba
- SSH

© 2023 Grandstream Networks, Inc. [Grandstream Software License Agreement](#)

- **Static IP binding by client ID**

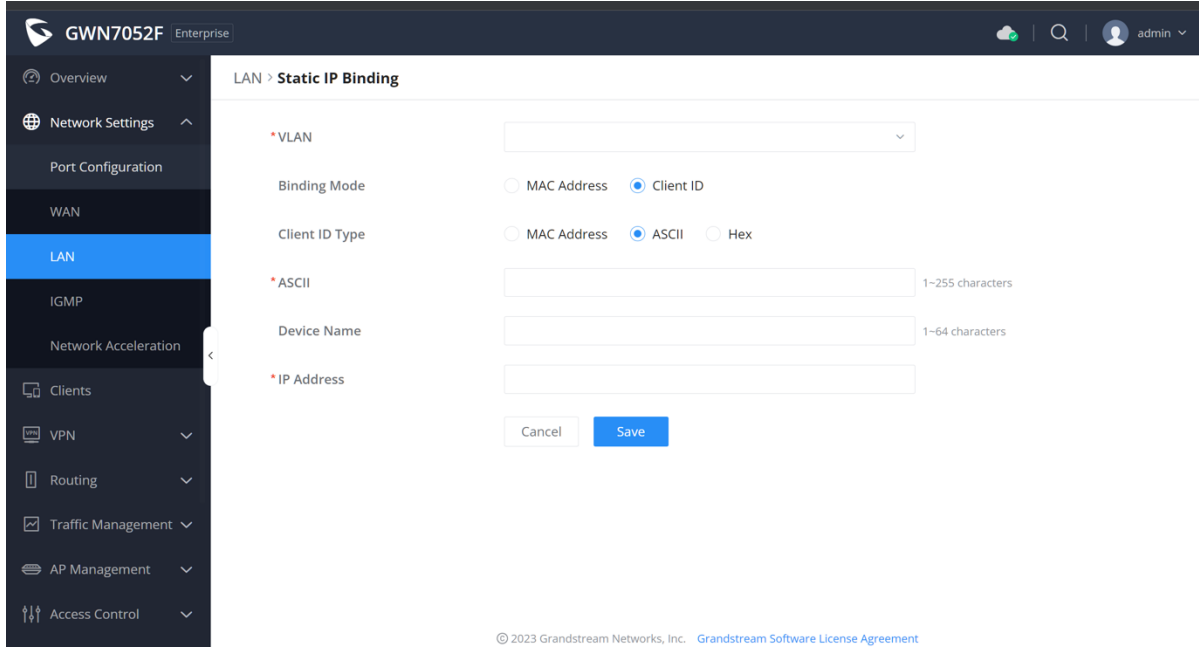

LAN > Static IP Binding

*VLAN

Binding Mode MAC Address Client ID

Client ID Type MAC Address ASCII Hex

*ASCII 1-255 characters

Device Name 1-64 characters

*IP Address


Cancel Save

© 2023 Grandstream Networks, Inc. Grandstream Software License Agreement

- **PPSK**

Configuration is available at AP Management → PPSK

- **TR069**

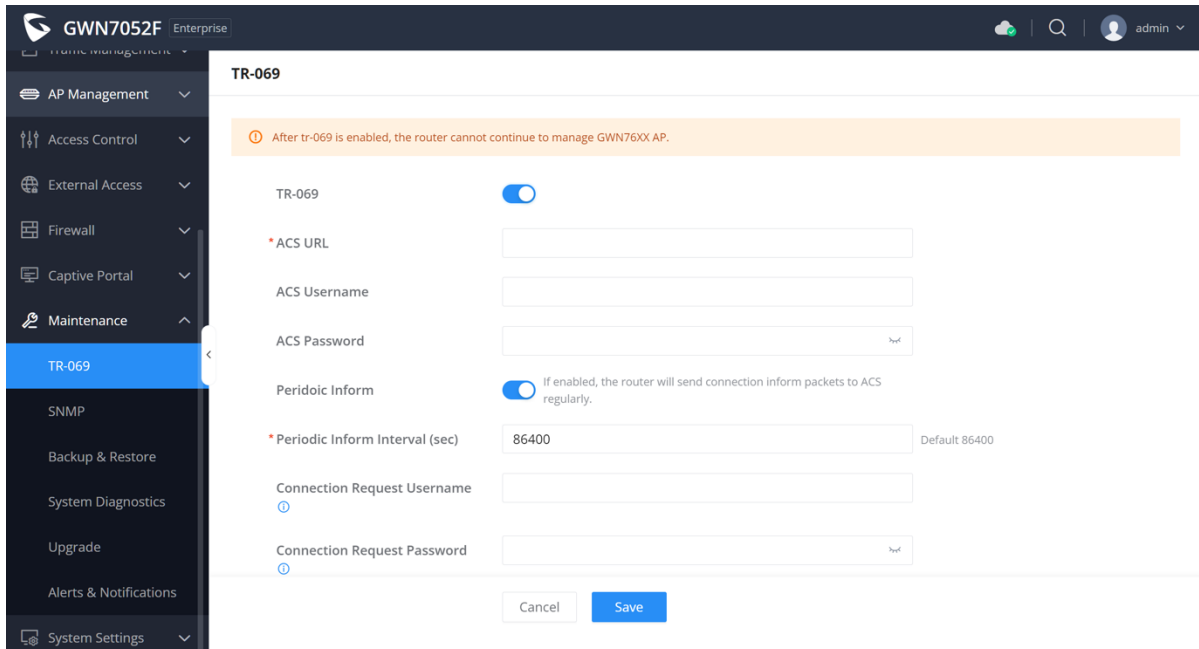

TR-069

ⓘ After tr-069 is enabled, the router cannot continue to manage GWN76XX AP.

TR-069

*ACS URL

ACS Username

ACS Password

Periodic Inform If enabled, the router will send connection inform packets to ACS regularly.

*Periodic Inform Interval (sec) 86400 Default 86400

Connection Request Username ⓘ

Connection Request Password ⓘ

Cancel Save

FIRMWARE VERSION 1.0.7.2

PRODUCT NAME

GWN7062 / GWN7052 / GWN7052F

DATE

6/19/2023

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 7d9ddc8d92370c3b8db4f9e4deb3aa19
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: 7a097966e45cbc70a6e4e3a215cf6c8c
- GWN7052F Firmware file name: gwn7052ffw.bin
MD5 checksum: 310f5da6b2a808e80b46b1649dc24eec

CHANGES/ENHANCEMENT

- Fixed an issue that causes GWN7052F 5G radio low bandwidth when acceleration is disabled.
- Fixed an issue that causes remote access from GWN.Cloud fails
- Fixed an issue that causes network loop in multiple VLAN configurations
- Fixed an issue that client speed limit does not take effect after restoring the router configuration
- Fixed an issue that DHCP option Hex format does not take effect
- Fixed an issue that DHCP option ASCII format does not take effect if configured without quote
- Fixed an issue that causes wireless client downlink real speed and rate display mismatch
- Fixed an issue that changing single band to dual on GWN.Cloud leads to missing SSID description
- Fixed an issue that dhcp option type display "1" after upgrade firmware from 1.0.4.x to 1.0.7.1
- Fixed a display issue of network acceleration's mouseover tooltip
- Other bug fixes

FIRMWARE VERSION 1.0.7.1

PRODUCT NAME

GWN7062 / GWN7052 / GWN7052F

DATE

5/22/2023

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 7e87f50b4826866ded05b585deabc6d8
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: 4234f6ce7eeb2d6cddef5f36ded6b420
- GWN7052F Firmware file name: gwn7052ffw.bin
MD5 checksum: cb0d91b8532574a98d078f154e120bfe

CHANGES/ENHANCEMENT

- Added new feature of GWN.Manager layer 2 discovery
- Added new feature of importing configurations files across different devices of the same model
- Added support of Cloud/Manager connection detection
- Added support of locking country code through Grandstream GAPS
- Optimized the DHCP option UI configuration format
- Fixed an issue of out of memory causing restart when hardware acceleration is enabled in GWN7062
- Fixed some configuration compatibility issues for cloud management
- Fixed an issue that syslog cannot be downloaded via gwnmenu
- Fixed an internal crash issue
- Changed the UI restriction to allow the gateway address to be within the DHCP pool
- Other bug fixes

FIRMWARE VERSION 1.0.5.44

PRODUCT NAME

GWN7062 / GWN7052

DATE

3/6/2023

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: e79b587ac220c634757f0426ed1e9845
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: ec408284e28d30e3ba0a2124069da102

CHANGES/ENHANCEMENT

- Added support of Mesh as CAP feature when managed by GWN.Cloud/GWN.Manager
- Internal bug fixes

FIRMWARE VERSION 1.0.5.38

PRODUCT NAME

GWN7062 / GWN7052

DATE

1/10/2023

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 86167cde0df080a43ba7021968489546
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: b4b6d9232af999bad6583d5d6137e93c

CHANGES/ENHANCEMENT

- Internal bug fixes

FIRMWARE VERSION 1.0.5.34

PRODUCT NAME

GWN7062 / GWN7052

DATE

12/22/2022

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 4c93665763caca56c8c3e11af83e6995
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: a733d3e54646b1c298b8e4f23f41ad66

CHANGES/ENHANCEMENT

- Added support for new GWN Cloud 1.1.23.28
- Added support third layer discovery for GWN Manager
- Optimized the Alert system
- Internal bug fixes

FIRMWARE VERSION 1.0.5.12

PRODUCT NAME

GWN7062 / GWN7052

DATE

10/27/2022

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 18089092e937345d91ae0d38b187ed45
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: 3ee377375658f2f2db627e6c37ca6a7a

CHANGES/ENHANCEMENT

- Fixed an issue that Top Clients data may show errors in overview page
- Fixed an issue that client cannot authenticate with the external portal from GWN AP under GWN router
- Fixed an issue that video stream does not present buffering on client from MESH RE AP.
- Fixed an issue that WAN2 web access may show 404.
- Fixed an issue that causes router to crash in long term throughput test.
- Some internal fixes.

FIRMWARE VERSION 1.0.5.9

PRODUCT NAME

GWN7062 / GWN7052

DATE

10/12/2022

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: 0125f142adf1d356982a0420ca42745a
- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: 7d95d0b59ee4ffd0a3913bd4d553a24b

CHANGES/ENHANCEMENT

- Fixed an issue that GWN Router shows offline from Cloud then Internet access is normal.
- Fixed an issue of wrong IPv6 address lifetime.
- Fixed an issue of IPv6 settings provisioning.
- Fixed an issue that core file cannot be downloaded if remote access via GWN Cloud.
- Fixed an issue that the 16th dual-band SSID cannot be changed to 5G only.
- Fixed some issues of AP settings provisioning.
- Fixed an issue that guest page authentication type is incorrect under Captive Portal.
- Changed the web setting to allow port changes even when WAN port web access is closed.
- Some other internal fixes.

[GWN7062] FIRMWARE VERSION 1.0.5.6

PRODUCT NAME

GWN7062

DATE

9/8/2022

FIRMWARE FILE INFORMATION

- GWN7062 Firmware file name: gwn7062fw.bin
MD5 checksum: cdfc394a060e04d34b384ad9e86a6e58

CHANGES/ENHANCEMENT

- This is the first release of GWN7062
- Note: GWN Cloud support for GWN7062 is only available in form of web tunnel.in current firmware. Full GWN Cloud support will be released in later version.

[GWN7052] FIRMWARE VERSION 1.0.5.5

PRODUCT NAME

GWN7052

DATE

9/8/2022

FIRMWARE FILE INFORMATION

- GWN7052 Firmware file name: gwn7052fw.bin
MD5 checksum: fe02e415e9e6ddb024a3ec5377bacf82

CHANGES/ENHANCEMENT

- This is the first release of GWN7052
- Note: GWN Cloud support for GWN7052 is only available in form of web tunnel.in current firmware. Full GWN Cloud support will be released in later version.